
# KNK Zing / Zing Air with Make The Cut1

February 28, 2014

This manual is based on Make The Cut (MTC), version 4.6.1. Because of regular updates to MTC, we recommend not printing this entire document, but rather read it on the screen or print only those pages you need at any given time.

#### **Features of this Online Interactive User Manual**

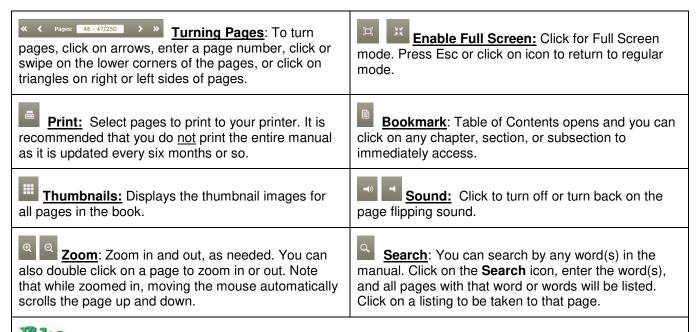

Videos: This user manual contains numerous links to online videos. Click on these green Video icons to open either a You Tube or Vimeo hosted video and learn the topic in that particular section of the manual. Past experience has shown that watching videos can be extremely beneficial when learning software and cutting applications.

#### Where to Start

- Thank you for choosing a Klic-N-Kut digital die cutter. Before using a <u>blade</u> in your new cutter, we suggest you read *Chapters 1 and 2* and watch the videos provided via links in these two chapters.
- If you run into difficulties with the operation of the KNK, turn off the power and look for a solution in this manual. Note that Appendix B is a Troubleshooting section. If you continue to have technical questions or issues, please contact <u>your KNK Zing supplier</u> as soon as possible.
- For additional support, please visit our Yahoo group at: <a href="http://groups.yahoo.com/group/KNK">http://groups.yahoo.com/group/KNK</a> Zing/ and our support forum at: <a href="http://knkusa.com/forums/">http://knkusa.com/forums/</a>.
- Joe Rotella, owner of <u>Create & Craft</u>, created an excellent one hour video for new owners of KNK Zings:

# **Table of Contents**

KNK ZING / ZING AIR WITH MAKE THE CUT <sup>1</sup>	
FEATURES OF THIS ONLINE INTERACTIVE USER MANUAL	1
WHERE TO START	
1. UNPACKING, INSTALLING, AND ASSEMBLING	
1.01 UNPACKING	8
1.02 CONTENTS	8
1.03 ITEMS TO NOTE (PLEASE READ!)	8
1.04 PARTS OF THE KNK ZING AIR	g
Front	
Back	
1.05 Accessories	
Test Pen HolderBlades Included With KNK Zing Air Purchase	
Blade Installation	
Mat (Carrier Sheet)	
1.06 REGISTERING AND INSTALLING MAKE THE CUT SOFTWARE	
Registering Make The Cut	
Installing in Windows	12
Installing on a Mac	12
1.07 CONNECTING THE KNK ZING AND ZING AIR TO YOUR COMPUTER	
1.07.1 Connecting on a Windows PC	
1.07.2 Connecting on a Mac	
1.00 FINCH WHEEL LEVERS	
1.10 TEST DRAW SHAPES	
1.10.1 Setup for Drawing	
1.10.2 Drawing Your First Shape	
1.11 MAINTENANCE	
2. CUTTING	25
2.01 What You Need to Understand About Cutting	
You Have To Make Mistakes	
The Most Common Mistakes Made by New Owners	
Begin with Easy Materials and Easy Shapes Record Your Successes	
Use the Correct Blade for the Material You Are Cutting	
Set the Blade Length To Match the Material Thickness	
Set the Blade Height Above the Material	24
Adjust the Speed, Force, and Number of Passes Based on the Material and Shapes	
Perform Test Cuts!	
Know Where Your Images Will Cut	
Keep the Cutting Mat Clean and Sticky	
Don't Get Frustrated, Get Help!	
2.02 CUT WITH KLIC-N-KUT ZING AND ZING AIR	
2.03 SPEED	
2.04 Force	29
2.05 MULTICUT	29
2.06 Blade Offset	30
2.07 Cut Type	
Knife Point	
WYSIWYG	
WYSIWYG – Virtual Mat Matches Ruled Grid on Actual Mat	
WYSIWYG – Virtual Mat Matches Material Dimensions	
2.08 SET BLADE ORIGIN	
2.09 CONNECTION STATUS AND TEST CUT MENU	
2.10 UPDATES, PRESETS, AND HELP	
2.11 IMPORTANT CHECKLIST BEFORE YOU CUT!	
2.12 Resolution Calibration	
2.13 ZING SPEAK	

	ng Speak?	
Why wo	d I want to use Zing Speak?	3
What do	need so that I can use Zing Speak?	3
How do	nstall Zing Speak?	4
	nitiate Zing Speak?	
	se Zing Speak?	
What els	do I need to know?	4
SETTINGS F	RM FOR CUTTING MATERIALS	43
SUGGESTED	Cut Settings for Various Materials on KNK Zing / Zing Air	44
MTC BASIC		10
3.01 Main N	TC Screen	49
3.02 TOOLB	35	50
	ar	
	olbar	
	lbar	
Node Mo	le Toolbar	5 <sup>.</sup>
3.03 BARS		5 <sup>-</sup>
	rties Bar	
	,	
	MAT	
	G AND PANNING	
	GMTC FILES	
	ening a New File/Project	
3.06.2 O	ening an Existing MTC File	5
3.06.3 Pi	viewing Thumbnails for Existing MTC Files	5
	MTC FILES	
	BASIC SHAPES	
	NG, MOVING, AND DELETING SHAPES	
	s, Copying, Pasting, Duplicating	
	ting to the Clipboard	
	bying Shapes and Copying to the Clipboard	
	ting from the Clipboard	
	olicating - Duplicate	
	plicating – Nested Duplicate	
	olicating – Rotated Duplicate	
	EDO	
	AR	
	G, ROTATING, SLANTING, AND WARPING	
	izingating and Slanting	
	rping	
	IG COLOR, TEXTURE, AND LINE STYLE	
	Color	
	Texture	
_	a Texture	
	Line Style	
	SHAPE MANIPULATIONS	
	f INTAIN CENTIONS	
	gnment	
	nment	
	nment	
•		
	and Flipping	
	AND EVPORTING	0
+. INIPORTING	AND EXPORTING	ŏl

4.02 IMPORTING FROM THE ONLINE MTC GALLERY	
	82
, , ,	
	83
	83
5. WORKING WITH TEXT	90
	90
	91
	91
	92
	93
	94
Wrapping Text Half-way Around the Top and the Bottom of a Cir	rcle
	99
Open Path in Bézier Warp	100
,	
6. TRACING	
6.01 Raster versus Vector	
6.03.2 Alpha Trace Method	110
	113
	117
	130
	Tool)
7 EDITING	136
•	
Blackout	
• • •	
	140
1.00 ONAFE IVIAGIO ADVANCE FAKT Z. DETAILS	141

View Path Detail	
7.04 Shape Magic Advance Part 3: The Path Functions	
Flatten Paths	
Thin Paths	
Fuse n' Weld	
Reverse Paths	
7.05 Shape Magic Advance Part 4: Tiler	
7.06 NODE MODE TOOLBAR	
7.07 EDIT THIS PROJECT NORMALLY (SELECT TOOL)	
7.08 MEASURE SHAPE LENGTHS AND ANGLES (MEASURE TOOL)	
7.09 SLICE SHAPES AND LINES (KNIFE TOOL)	
7.10 ERASE SECTIONS OF PATHS (ERASER TOOL)	
Erasing	150
Inverse Erasing (Adding to an Image)	
Eraser or Knife?	
Drawing Thin Lines	
Drawing Thick Lines	
Drawing with Other Line Styles	
7.12 DRAW BÉZIER CURVES AND STRAIGHT LINES (PEN TOOL)	
Drawing Straight Lines	157
Drawing Curves	
Combining Straight Lines and Curves	
Fat Path and Super Smooth	159
7.13 EDIT PATHS AT NODE LEVEL (NODE EDIT TOOL)	
Segment Editing	
Applications for Node Edit	
7.14 RECONNECTING BROKEN SEGMENTS.	
Using Fuse n' Weld	
Using Fuse n' Weld	164 165
Using Fuse n' Weld	164 165
Using Fuse n' Weld	
Using Fuse n' Weld	
Using Fuse n' Weld  Using Edit Paths at Node Level (Node Edit Tool):  Using the Drag Freehand Lines (Pencil Tool)  Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING  8.01 WHERE DO I START WITH LEARNING TO DESIGN?	
Using Fuse n' Weld  Using Edit Paths at Node Level (Node Edit Tool):  Using the Drag Freehand Lines (Pencil Tool)  Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8.01 WHERE DO I START WITH LEARNING TO DESIGN?  8.02 ADD BASIC SHAPES (BASIC SHAPES TOOL)	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING  8.01 Where Do I Start with Learning to Design? 8.02 Add Basic Shapes (Basic Shapes Tool) 8.03 Create Spirals (Spiral Tool)	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8.01 Where Do I Start with Learning to Design? 8.02 ADD Basic Shapes (Basic Shapes Tool) 8.03 Create Spirals (Spiral Tool). 8.04 Create Stars and Polygons (Star & Polygon Tool).	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING 8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool) Star	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8.01 Where Do I Start with Learning to Design? 8.02 ADD Basic Shapes (Basic Shapes Tool) 8.03 Create Spirals (Spiral Tool). 8.04 Create Stars and Polygons (Star & Polygon Tool).	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon. 8. 05 Shadow Layer. Outset Shadow	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon. 8. 05 Shadow Layer. Outset Shadow Blackout Option.	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool) 8. 04 Create Stars and Polygons (Star & Polygon Tool) Star Polygon  8. 05 Shadow Layer Outset Shadow Blackout Option. Corner Join Option.	
Using Fuse n' Weld	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon  8. 05 Shadow Layer. Outset Shadow Blackout Option. Corner Join Option. Inset Shadow  8. 06 Weld Tool	
Using Fuse n' Weld	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8.01 Where Do I Start with Learning to Design? 8.02 Add Basic Shapes (Basic Shapes Tool) 8.03 Create Spirals (Spiral Tool). 8.04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon 8.05 Shadow Layer Outset Shadow Blackout Option. Corner Join Option. Inset Shadow 8.06 Weld Tool Designing a Balloon Designing a Border	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon 8. 05 Shadow Layer Outset Shadow Blackout Option. Inset Shadow 8. 06 Weld Tool Designing a Balloon. Designing a Border Designing a Wreath	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Dray Freehand Lines (Pencil Tool). Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool). 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon 8. 05 Shadow Layer. Outset Shadow Blackout Option Inset Shadow 8. 06 Weld Tool Designing a Balloon Designing a Balloon Designing a Wreath 8. 07 BOOLEAN JOIN	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING 8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool) 8. 04 Create Stars and Polygons (Star & Polygon Tool) Star Polygon 8. 05 Shadow Layer Outset Shadow Blackout Option Corner Join Option Inset Shadow 8. 06 Weld Tool Designing a Balloon Designing a Border Designing a Wreath 8. 07 Boolean Join Cutting One Shape from Another	
Using Fuse n' Weld	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING 8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool) 8. 04 Create Stars and Polygons (Star & Polygon Tool) Star Polygon 8. 05 Shadow Layer Outset Shadow Blackout Option Corner Join Option Inset Shadow 8. 06 Weld Tool Designing a Balloon Designing a Border Designing a Wreath 8. 07 Boolean Join Cutting One Shape from Another	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool). Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING.  8.01 WHERE DO I START WITH LEARNING TO DESIGN? 8.02 ADD BASIC SHAPES (BASIC SHAPES TOOL). 8.03 CREATE SPIRALS (SPIRAL TOOL). 8.04 CREATE STARS AND POLYGONS (STAR & POLYGON TOOL). Star Polygon 8.05 SHADOW LAYER Outset Shadow Blackout Option. Corner Join Option. Inset Shadow 8.06 WELD TOOL Designing a Balloon Designing a Border Designing a Border Designing a Wreath 8.07 BOOLEAN JOIN Cutting One Shape from Another 8.08 WRAP OBJECTS TO PATH. 8.08.1 Designing a Scalloped Oval 8.08.2 Warp Objects to Path 8.08.3 Live Edit Window.	
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Dray Freehand Lines (Pencil Tool). Using the Dray Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars And Polygons (Star & Polygon Tool).  Star Polygon 8. 05 Shadow Layer Outset Shadow Blackout Option. Corner Join Option Inset Shadow 8. 06 Weld Tool Designing a Balloon Designing a Border Designing a Wreath 8. 07 Boolean Join Cutting One Shape from Another 8. 08 Wrap Objects to Path 8. 08. 1 Designing a Scalloped Oval 8. 08. 3 Live Edit Window. 8. 09 Auto 4-Point Warp	164
Using Fuse n' Weld Using the Parts at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool.) 8. 03 Create Spirals (Spiral Tool.) 8. 04 Create Spirals (Spiral Tool.) 8. 04 Create Stars and Polygons (Star & Polygon Tool.) Star	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8.01 Where Do I Start with Learning to Design? 8.02 ADD Basic Shapes (Basic Shapes Tool) 8.03 Create Spirals (Spiral Tool) 8.04 Create Stars and Polygons (Star & Polygon Tool) Star Polygon 8.05 Shadow Layer Outset Shadow Blackout Option Corner Join Option Inset Shadow 8.06 Weld Tool Designing a Balloon Designing a Balloon Designing a Broder Designing a Wreath 8.07 BOOLEAN JOIN Cutting One Shape from Another 8.08 WRAP Objects to Path 8.08.1 Designing a Scalloped Oval 8.08.2 Warp Objects to Path 8.08.3 Live Edit Window 8.09 AUTO 4-Point Warp Tumbler Wrap	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool): Using the Drag Freehand Lines (Pencil Tool): Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING 8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon 8. 05 Shadow Layer. Outset Shadow. Blackout Option. Corner Join Option. Inset Shadow 8. 06 Weld Tool. Designing a Balloon Designing a Border. Designing a Wreath. 8. 07 BOOLEAN JOIN Cutting One Shape from Another 8. 08 WRAP OBJECTS TO PATH. 8. 08. 1 Designing a Scalloped Oval. 8. 08. 2 Warp Objects to Path. 8. 08. 3 Live Edit Window. 8. 09 AUTO 4-POINT WARP 8. 10 CONICAL WARP Tumbler Wrap 8. 11 LATTICE Latticed Circle.	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool)  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 And Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool) 8. 04 Create Stars and Polygons (Star & Polygon Tool) Star Polygon 8. 05 Shadow Layer Outset Shadow Blackout Option Inset Shadow 8. 06 Weld Tool Designing a Balloon Designing a Balloon Designing a Barder Designing a Wreath 8. 07 BOOLEAN JOIN Cutting One Shape from Another 8. 08 Wrap Objects to Path 8. 08.1 Designing a Scalloped Oval 8. 08.2 Warp Objects to Path 8. 08.3 Live Edit Window 8. 09 Auto 4-Point Warp 8. 10 Conical Warp Tumbler Wrap 8. 11 Lattice Latticed Circle 8. 12 Rhinestone Design	164
Using Fuse n' Weld Using Edit Paths at Node Level (Node Edit Tool): Using the Drag Freehand Lines (Pencil Tool) Using the Draw Bézier Curves and Straight Lines (Pen Tool).  8. DESIGNING  8. 01 Where Do I Start with Learning to Design? 8. 02 Add Basic Shapes (Basic Shapes Tool) 8. 03 Create Spirals (Spiral Tool). 8. 04 Create Stars and Polygons (Star & Polygon Tool). Star Polygon 8. 05 Shadow Layer. Outset Shadow. Blackout Option. Corner Join Option. Inset Shadow 8. 06 Weld Tool. Designing a Balloon. Designing a Border. Designing a Wreath. 8. 07 BOOLEAN JOIN Cutting One Shape from Another 8. 08 WRAP OBJECTS TO PATH. 8. 08.1 Designing a Scalloped Oval. 8. 08.2 Warp Objects to Path. 8. 08.3 Live Edit Window. 8. 09 AUTO 4-POINT WARP 8. 10 CONICAL WARP Tumbler Wrap 8. 11 LATTICE. Latticed Circle.	164

Additional Tips on Rhinestone Designing	
8.13 Texture Snapshot	
Creating a Gradient Texture Fill	
8.14 JIGSAW PUZZLE	
8.15 Notes Window	193
8.16 Design Contest Tutorials	195
Designing a Whale by Brigit Mann	
Designing a Flower by Laury Vaden	197
9. PRINT AND CUT	203
9.01 WHAT IS A PRINT AND CUT (PNC)?	203
9.02 What is a PNC Calibration?	
9.03 PNC PROCEDURE PART 1: SETTING UP AND PRINTING	
Landscape Mode Option	
Portrait Mode Option	
9.04 PNC PROCEDURE PART 2: ALIGNING AND CALIBRATING	
Aligning the Laser with the Registration Marks	210
Adjusting the Laser Offset	
9.05 PRINT AND CUT TIPS	
9.06 Print and Cut Scenarios	
9.06.1 Cutting Multiple PNC Images on the Same Page	
9.06.2 PNC With a Contour Shape Larger Than the Printed Image	
9.06.3 PNC With a Contour Shape Smaller Than the Printed Image	
9.06.4 PNC with a Contour Shape Overlapping the Printed Image	
9.00.5 PNC with an inset cut line	
9.07.1 Printing from another Program	
9.07.2 PNC Applications with Existing Images	
10. APPLICATIONS	221
10.01 CARDSTOCK AND PAPER	221
Selecting Cardstock	
Settings	
Troubleshooting	
10.02 CHIPBOARD.	222
Selecting Chipboard	
Settings	
Troubleshooting	
10.03 VINYL	
Types of Vinyl	
Settings	223 22 <i>A</i>
10.04 FABRIC AND FELT	
10.05 IRON-ON TRANSFER	
Types of Iron-On Transfer	
Cutting Iron-On	
Adhering Iron-On	
10.06 RHINESTONE TEMPLATES	
Designing Rhinestone Patterns	
Cutting Rhinestone Template Material	
Weeding and Brushing in Rhinestones	
Heat Pressing Rhinestones	
Extra tips on Rhinestone Applications	
10.07 DRAWING WITH A PEN OR GLUE PEN	
Adjusting for the Difference in Diameters of Tools and Blade Holders	
10.08 EMBOSSING AND SCORING.	
10.09 ENGRAVING	
Project: Engraving a Dog Tag	
10.11 CAKE DECORATING	
10.12 ADDITIONAL APPLICATIONS	
Wood	
Craft Plastic	
Suggested Settings for Various Accessories <sup>1</sup>	
SETTINGS FORM FOR ACCESSORY TOOLS	238

APPENDIX A KEYBOARD SHORTCUTS	239
APPENDIX B TROUBLESHOOTING FAQ'S	244
COMMUNICATION ISSUES	
Cutting/Drawing Issues	246
SOFTWARE ISSUES	
APPENDIX C ZING SPEAK QUICK REFERENCE1	
APPENDIX D CONNECTING VIA BLUETOOTH ON A MAC	
ACKNOWLEDGEMENTS	256

## 1. Unpacking, Installing, and Assembling

## 1.01 Unpacking

- Verify that you have received all contents. There is a checklist below. Please notify <u>your</u> KNK Zing supplier <u>immediately</u> if anything is missing.
- Remove all foam pieces and other packaging before turning on the KNK Zing. Currently there are two end cap foam protectors and 3 internal smaller foam pieces, as well as two black plastic pieces supporting the pinch wheel bar.
- <u>Use the enclosed test pen</u> as you experiment and become familiar with operating the KNK Zing. Place scrap paper on the mat and simply draw shapes rather than cut them. This will prevent possible damage to the blade, mat, and cutting strip as you learn where shapes will cut and the basic operating procedures.
- Do not unplug the USB cable from your computer or from the KNK unless you first turn off the power.
- Always <u>turn off the Zing</u> when not in use. Leaving the cutter turned on for extended periods of time can
  possibly damage the machine.

## 1.02 Contents



Your KNK Zing package comes with the following:

KNK Zing digital die cutter

**Quick Start Guide** 

Make The Cut (MTC) activation pin

**Cutting Mat** 

Test Pen

2 test pen inserts and a spring

USB - Blue Tooth adaptor

Blade holder

45° blade (red cap)

60° blade (blue cap)

2 small springs for blades

USB cable

Power cable


## 1.03 Items to Note (Please Read!)

- <u>Blades:</u> The blades used by cutters are extremely fragile. Do not drop or even bump the blade onto any hard surface as they can chip easily. When not in use, retract the blade into the blade holder or remove and cover the sharp end with the soft plastic cap. Be careful to keep these small blades and their springs in a safe place.
- Warranty: The one year warranty covers Manufacturer's Defect only and does not include normal wear and tear. If warranty work is required, the owner is responsible for shipping costs to and from Accugraphic Sales. If a KNK Zing is damaged during shipment, then your dealer should be notified as soon as possible. If damages are reported later than three weeks after delivery, then it will be the responsibility of the owner to ship the damaged KNK back to Accugraphic for repair.
- Zing owners outside the USA should contact their distributor for procedures regarding warranty work or shipping damage.
- <u>Transporting:</u> When transporting the cutter, move the pinch wheel levers into the upward position. Remove the accessories from the Zing and place in a separate bag. We also recommend retaining the original boxes with the foam inserts in case you ever need to ship your KNK Zing.
- Additionally:
  - ♦ DO NOT touch or jam the plotter's track while it is operating. If the cutter is damaged, it is the owner's responsibility.
  - ♦ DO NOT shake the cutter while it is operating.

- ♦ DO NOT cut any materials that have staples or other embellishments attached.
- ♦ DO NOT touch the cutter with a magnet.
- ♦ DO NOT allow small items to fall into the cutter.
- TURN OFF the cutter when not in use.


#### 1.04 Parts of the KNK Zing Air

#### **Front**

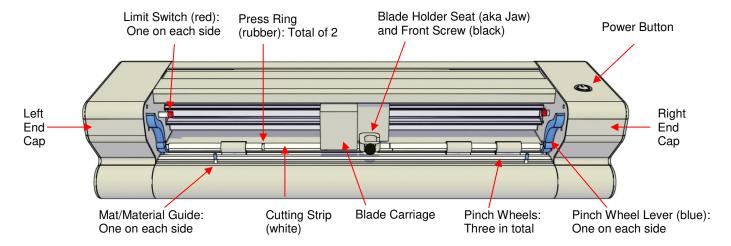

- Blade Carriage: Moves the Blade Holder Seat left and right
- Blade Holder Seat (Jaw): Holds the blade holder, test pen, markers, and other tools
- Front Screw: Tightens blade holder, test pen, markers, and other tools into blade holder seat
- Cutting Strip: Protects blade from cutting metal beneath
- Limit Switches: Provide a buffer between blade carriage and end cap
- Mat/Material Guides: Used to position the mat
- Pinch Wheels: Grip mat or material so that grit shaft (beneath) will feed mat or material in and out
- Pinch Wheel Levers: Lift pinch wheels up and down for loading of mat or material
- Power Button: Turns cutter on or off
- Press Rings: Help keep material from lifting during cutting

## **Back**

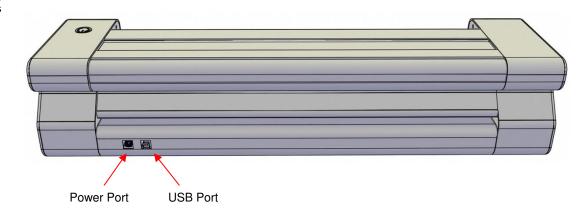

#### 1.05 Accessories

#### **Test Pen Holder**



• The test pen should be used until you are comfortable with the operation of the KNK Zing and know, with certainty, where shapes will cut. To assemble the test pen, remove the top cap, slip the spring over the top half of the pen insert and then drop the pen insert into the bottom half of the pen holder. Slide the cap over the pen insert, allowing the pen insert to fit through the hole at the top of the cap. Screw into place.



## **Blades Included With KNK Zing Air Purchase**

- There are two kinds of blades included with the KNK Zing. The 45 red capped blade is suited for cutting thinner materials such as paper and vinyl. The 60 blue capped blade is a much longer blade and is well-suited for cutting thicker materials, such as craft foam, chipboard, and rhinestone template material.
- Additionally, there are other tools sold separately, including a fabric blade, engraving tool, embossing/scoring tool, and pen holder. Details on these are covered in *Chapter 10* and in the following video:



#### **Blade Installation**




- The blade must be carefully inserted into the blade holder. Do this over a soft surface (e.g. over a hand towel). It's important to protect the fragile blade!
- The little springs that come with the blades are easy to lose, which is another reason to do this over a towel so that a dropped spring doesn't roll off the table. Remove the colored cap from the blade and slide the spring over the sharp end of the blade:



Spring is placed over the blade

- There are different ways to install the blade. This is the method I prefer, but experiment with other methods if you like. Again, the important thing is to just take it easy!
  - Tighten the main part of the blade holder by turning it clockwise until it is about half-way closed:





Place the blade into the tiny hole in the main part of the blade holder:





Gently guide the cap over the top of the blade and then begin screwing the cap on. Do NOT try to force it. You may need to wiggle the cap slightly for the spring to be positioned and for the cap to catch the threads and screw onto the main part of the blade holder:



IMPORTANT! Do not force the cap. Wiggle gently until the threads catch.

Screw the cap tight. Then, as you screw the main part of the blade holder (the top), the blade will begin to show through the hole in the cap. You only need as much blade exposed as is necessary to penetrate the material you are cutting. More blade does NOT result in better cutting. In fact the opposite is true.
Turn clockwise to expose more

blade. Turn counterclockwise to retract the blade.

The blade depth should be just a tiny bit longer than the thickness of the material you are cutting.

 Please read Chapter 2 before cutting. There are some tips on setting the blade exposure as well as other important information you need to be successful with your cutting.

#### **Mat (Carrier Sheet)**

- Always use the mat to hold the material to be cut unless the material has its own protective backing. For
  example, paper, fabric, and gum paste require a carrier sheet, whereas wall vinyl and iron-on transfer do
  not. Also, any materials that are less than ~13" wide will need to be placed on a mat so that the pinch
  wheels can properly feed the material.
- When placing the material you plan to cut onto the mat, you can locate the material anywhere it is sticky.
- When mats begin to lose their stickiness, they can be washed. Use a mild dishwashing detergent, warm water, and a brush to thoroughly clean the surface. Then allow to thoroughly dry. Normally, the mat will regain its original stickiness. But if not, apply a repositionable adhesive as necessary. **IMPORTANT**: Do not spray adhesives around your KNK! Not only can the adhesive get stuck to important parts of your Zing, but these adhesives should only be used in well-ventilated areas. Breathing in the adhesive can be damaging to your health!
- If the newly-sprayed mat is too sticky, causing difficulty in removing cut items without tearing, place an old but clean dish towel, fuzzy side down, over the surface of the mat and <u>press with a brayer or rolling pin</u>.
   Then pull up. Test the stickiness and repeat until the mat is more appropriate for your material. It should only take a few pressings to greatly reduce the stickiness, as micro-sized fibers are pressed to the surface.

- If you have cut items or scraps that you cannot easily remove from the mat, then use Un-Du or even acetone (nail polish remover) to temporarily wet the material and disarm the adhesive. Avoid scraping the mat while it is wet and allow to air dry.
- If you need to strip your mat of the adhesive, use Goo Gone or Duck Adhesive Remover. Wet the entire surface of the mat with the remover and allow to sit for about 30 seconds. Then use a metal or firm plastic scraper to scrape off the adhesive until the surface is clean.

#### 1.06 Registering and Installing Make The Cut Software

## **Registering Make The Cut**

IMPORTANT: Please read this section!!!

- Your KNK Zing comes with an Activation Pin for Make The Cut (MTC) software. This is NOT the code you use in the software.
  - ♦ If you already own MTC, you are free to sell this Activation Pin or give it away and you can continue using your current registration. If this is the case, skip to the section on Installing.
  - ♦ If you are new to Make the Cut, then you MUST use this Activation Pin to register the software to get the correct code for entering into the software.
- Go to the following link to register your Activation Pin:

https://www.make-the-cut.com/register.aspx

• Complete the form using the Activation Pin. <u>Carefully</u> enter your email address because you might need to request your registration number again in the future and it will be sent to that address. Upon completing the form, a registration number will be provided. This is your permanent registration number for the computers you own. You can leave this window open until you get MTC installed or you can verify that the number has also been emailed to you.

#### **Installing in Windows**

 All new owners should download and install the latest version of the software and the latest plug-in for the KNK Zing. Go to the following link to download the latest version of MTC:

http://www.iloveknk.com/Support/Software/Make-The-Cut/MTC-Windows/

Then go to this link to download the plug-in for the KNK Zing:

http://www.iloveknk.com/Support/Software/Make-The-Cut/Plugins/Zing/

- Install the software and plugin. Then open MTC. When asked if you wish to register or continue using the trial mode, enter the registration number that was provided when you registered.
- If you missed opening the software when asked, you will find the icon on your desktop open by locating *Make The Cut* from your **Windows Start>All Programs** menu).
- If you lose your registration number and you need to install MTC onto another computer, please go the same prior link and click on "**Recover Pin**."

#### Installing on a Mac


• There are three things to install: the MTC program, the MTC Bridge, and the KNK Zing plug-in. These are contained within one file which can be downloaded here:

http://www.iloveknk.com/Support/Software/Make-The-Cut/MTC-Mac/

Before installing, <u>please read and follow instructions</u> regarding Apple's Gatekeeper software (scroll to *Mac Users*, *please note the following error*) at the following link:

http://knkusa.com/resources/

- After the download has completed, open the Downloads folder and launch the downloaded MTC dmg file.
- A blue window will open with instructions to use for installing the software and bridge. Watch the following
  video first so that you can better visualize what needs to be done.

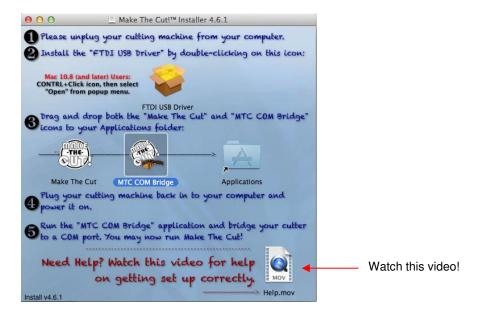

## 1.07 Connecting the KNK Zing and Zing Air to Your Computer

 Place the KNK on a sturdy horizontal surface. Connect the power cord to the back of the cutter and plug into a wall outlet or power strip. Turn on the power using the power switch on the top.

#### 1.07.1 Connecting on a Windows PC

(skip to Section 1.07.2 if you own a Mac)

- You have two options for connecting the Zing Air to your computer: Bluetooth or USB. The following
  sections present what steps are required for each type of connection. If you run into connectivity issues,
  please contact your KNK dealer first. If your dealer is unavailable, please contact KNK USA for assistance.
  - A. Connecting Using Windows Bluetooth
  - There are three situations for Bluetooth: (1) You know for sure your computer has Bluetooth, (2) You know for sure that your computer does not have Bluetooth, or (3) You're not sure. So refer to the appropriate section below:

#### My computer has Bluetooth available

- (1) Click on the **Show hidden icons** arrow on your Windows system tray.
- (2) Right click on the Bluetooth icon and select **Add Bluetooth Device**. If you do not have this option but, instead, see an option for "**Open My Bluetooth**", then select that and then skip to step (10). If you do not see the Bluetooth icon, go to the section: "I'm not sure if my computer has Bluetooth."
- (3) Check the option which says "My device is up and ready to be found." Click on Next.
- (4) If the Zing Air is found it will show up as **CUTTER**:





- (5) Highlight this device and click on Next.
- (6) The pairing options will appear. Select the one which says **Enter Device's Pairing Option** (or, if your computer is running XP, it will say **Use the Passkey found in the documentation).**
- (7) Type in 1234 and click on Next.
- (8) A message saying that the device has been successfully added should now appear.
- (9) Two COM Ports are assigned with a Bluetooth connection to the Zing Air: an outgoing port and an incoming port. Typically, the lower COM Port number is the one needed in MTC. When you reach the point of selecting the COM Port from the drop down list in MTC, select the lower number of the two COM Ports which will both read **Standard Serial over Bluetooth**. Refer to *Section 1.11* for further instructions and to test the communication. You are finished with this section and do not need to read Step (10).
- (10) Click on **Search for Devices**. When the Zing Air is found, it should be labeled as **CUTTER**. Double click on this icon and it will be automatically installed. You should now be able to open MTC and you will find the Bluetooth connection in the drop down list of **Serial Ports**, when you go to the cutting window.

#### My computer does not have Bluetooth available

- (1) A USB-Bluetooth adaptor came with your Zing Air. Plug this adaptor into a free USB port on your computer.
- (2) The device will be automatically installed in Windows. However, it may take about 30 60 seconds for the Bluetooth icon to appear in the Windows hidden icons. The Bluetooth icon looks like this:
- (3) Go to the prior section: My computer has Bluetooth available and proceed through the steps.

#### I'm not sure if my computer has Bluetooth

- (1) On your computer, click the **Start** button and then select **Devices and Printers**.
- (2) Click on Add a Device. If the Zing Air is found it will show up as CUTTER:



or



- (3) Note: it may take a short time for Windows to locate it, so be patient. If it is not located, then verify that the Zing Air is still powered on and is within 30 feet with no obstructions or within 10 feet if an interior wall separates the cutter from the computer. If the Zing Air is still not found, then close the window and go to the prior section: *My computer does not have Bluetooth available*.
- (4) Select the **CUTTER** icon and then click on **Next**.
- (5) A choice of three pairing options will appear. Select the second one: **Enter Device's Pairing Option** (or, if your computer is running XP, it will say **Use the passkey found in the document**).
- (6) Type in 1234 and then click on Next.
- (7) A message saying that the device has been successfully added should now appear.
- (8) Two COM Ports are assigned with a Bluetooth connection to the Zing Air: an outgoing port and an incoming port. Typically, the lower COM Port number is the one needed in MTC. When you reach the point of selecting the COM Port from the drop down list in MTC, select the lower number of the two COM Ports which will both read **Standard Serial over Bluetooth**. Refer to *Section 1.11* for further instructions and to test the communication.

#### **Problems**

• If your computer is not locating the Zing Air, verify that the Zing Air is still powered on, Bluetooth has been enabled, and the Zing Air is within 30 feet of your computer (with no obstructions) or within 10 feet if an interior wall separates the cutter from the computer.


• If you need to disconnect the Zing Air from Bluetooth, click on the Bluetooth icon on your task bar and select **Show Bluetooth Devices**. **Devices and Printers** will open and you can then select **Cutter** and then click on **Remove Device**.

## B. Connecting Using Windows - USB

- Connect the USB cable to the back of the cutter and into an available USB port on your computer. We
  do not recommend the use of a USB hub. However, if you have no other option, then the hub must be
  the type which is separately powered.
- Once the USB cable is connected, the Windows Hardware Manager will identify the USB connection.
   If the Windows Hardware Installation window pops open, proceed and accept all defaults.

### 1.07.2 Connecting on a Mac

- While it is possible to connect to a Mac using Bluetooth, it is highly recommended that USB be used instead. The Bluetooth connection on a Mac can result in erratic cutting and a need for adjusting a data throttle setting based on both the Mac itself, as well as the file being sent to cut. If you still wish to test Bluetooth on your Mac, then please refer to Appendix D for instructions.
- In the Applications folder, launch the MTC Bridge program. The following window will open. Under **COM1**, select the tty listing that says "usb serial":

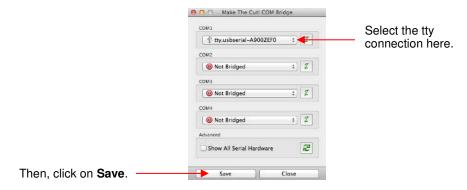

- Click on Save at the bottom before clicking on Close.
- Go to your **Applications** folder and hold the **Ctrl** key while clicking on the MTC icon. Choose **Open** from the drop-down menu.
- Enter the registration number you received when you registered the software.
- If you lose your registration number and you need to install MTC onto another computer, please go the same link where you first downloaded MTC and click on "**Recover Pin**."

## 1.08 Pinch Wheel Levers



- There are two pinch wheel levers, one on each side, just inside the end caps. These are used to raise and lower the three pinch wheels.
- Press down on the levers. The roller bar and pinch wheels will be raised. Note that both sides do not need
  to be raised at the same time, but you do need to have the wheels raised before inserting the cutting mat or
  your backed materials.
- After you insert the cutting mat or materials, flip the levers up to lower the pinch wheels onto the mat or
  material. Note that there are two black plastic inserts on either side of the pinch roller bar that need to be
  removed so that the roller bar will lower into the correct place.

• If you find that your levers are difficult to operate, please refer to Appendix B Troubleshooting FAQs.

## 1.09 Mat/Material Guides

- There are two mat/material guides at the front of the cutter (refer to the parts diagram in *Section 1.04*). They are not a requirement for use, but rather provided to make positioning of the inserted mat or material easier.
- At the time of this writing, both guides are moved to the far right when the Zings are packed. These guides should be repositioned with one on each side of the mat or backed material. When you unscrew a guide counter-clockwise, it will then freely slide left or right.
- If the blade carriage is preventing easy access to the guides, then turn off the Zing. Now you can manually slide the blade carriage to the left so that you can more comfortably access these guides.
- While the guides can be positioned anywhere, note that when you first turn on the Zing and the blade carriage comes to its home origin, that position marks the beginning of the 14" cutting range. Thus, you do not want to position your right guide too far to the left or you risk not having the full 14" range of cutting you might need.
- Position the right guide where you want it, turn clockwise to lock into place. When you insert the mat or
  material, slide it to the right to align with this guide. If you wish, you can move the left guide to just touch the
  left side of the mat or material. Again, it is not necessary to use the left one unless, for some reason, you
  wish to use the left side for initial alignment of the mat or material. But again, be careful about not
  attempting to cut too far to the left, as you may cause the blade carriage to hit the left side limit.

#### 1.10 Test Draw Shapes


• New owners tend to be eager to try out their cutters. It's also important to test your cutter to insure that data is being sent properly from your computer to the machine and everything is operating correctly. The following steps will allow you to do some testing with the test pen. But note that **the following steps are for drawing, not cutting**. Before inserting the blade holder into the KNK Zing, please read *Section 2.01*.

#### 1.10.1 Setup for Drawing


Landscape Versus Portrait: Which do you prefer?

- Based on your own past experience with MTC or other cutting programs and cutters, you may have a
  particular mode (landscape or portrait) that you are accustomed to using. There is no right or wrong mode,
  only the mode that works best for you; the mode that makes the most sense!
- Some people find it easier to work in one versus the other when visualizing where shapes will cut. For that reason, tutorials in this user manual will be presented in both modes so that you can use whichever one seems easier.
- In MTC, the orientation is set on the **Virtual Mat** tab on the **Main Bar**. The settings on this tab are presented in detail in *Section 3.04*. For now, just note the location of the **Mat Configuration** settings for **Landscape** and **Portrait**:


#### ♦ Landscape Mode

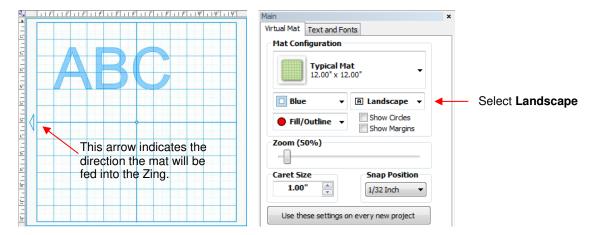


• In **Landscape** mode, the arrow on the virtual mat will point to the left. When you draw or cut out the "ABC" shown on the **Landscape Virtual Mat**, it will be drawn or cut top to bottom as you face the Zing:

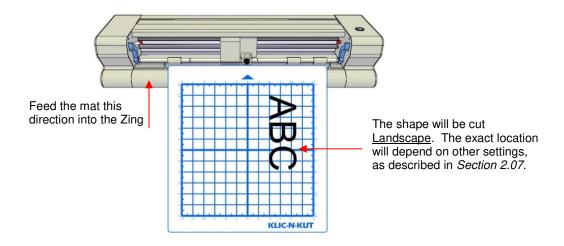

#### Portrait Mode

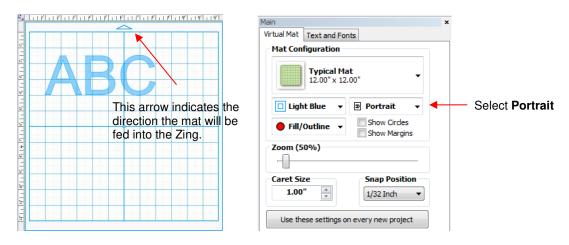


• In **Portrait** mode, the arrow on the virtual mat will point upwards. When you draw or cut out the "ABC" shown on the **Portrait Virtual Mat**, it will be drawn or cut <u>left to right</u> as you face the Zing:

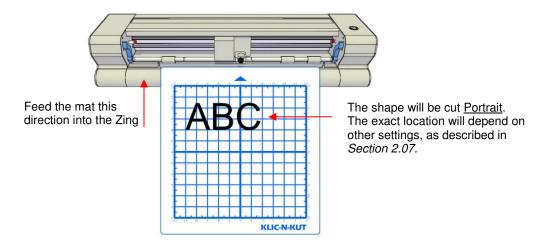


## 1.10.2 Drawing Your First Shape


- This first test will show you how the <u>Knife Point</u> mode works. This is a very useful setting because it is easy
  to know where your shapes will cut on your material, plus it economizes the use of your materials. Instead of
  cutting shapes where they are located on the <u>Virtual Mat</u>, the shapes will be moved and <u>cut where you set</u>
  the origin on the <u>material</u>, using the <u>blade tip</u> (not the laser light).
  - 1. Place an 8.5" x 11" sheet of paper on the mat, using any of the grid lines. Place the paper onto the mat like this:

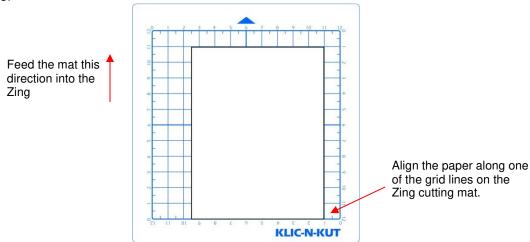

2. Insert the mat into the cutter, with the mat snug between the material guides. Slide the mat towards the back and use any of the horizontal markings at the front of the Zing to align the mat. Then lift the pinch levers to drop the pinch wheels onto the cutting mat. Most of the mat and the paper should now be behind the cutter, not in the front:





3. Before installing the test pen, make sure the pen will write by scribbling on scrap paper. Then loosen the front screw on the blade holder seat and insert the pen tool. Make sure the pen nib is <u>slightly above</u> the cutting surface so that it will not drag across the paper. Firmly tighten the screw. (Note: with the Zing turned off, you can manually slide the blade carriage to the left so that you can check pen or blade tip height, as necessary).

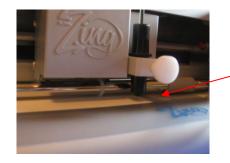


Raise the pen high enough for the tip of the pen to be above the paper. Then tighten the front screw.


4. Select either **Landscape** or **Portrait**, on the **Virtual Mat** tab, depending on your personal preference (as described at the beginning of this section):



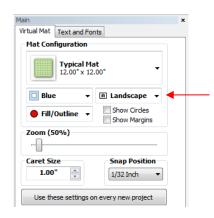


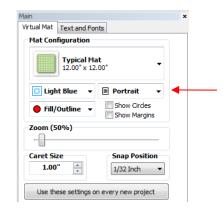


5. Before adding a shape to draw, double click in the gridded area on the screen to plant the **Caret**. This will determine where the shape will be imported:




6. Go to **File>Import>From Basic Shapes** and select the category called **Arrows**. Double click on any of the arrow shapes to add that shape to your screen. An arrow will help you better compare where a shape gets drawn versus how you see it on the screen.

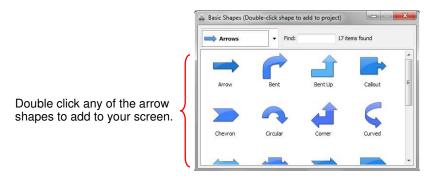

7. Now you will have an arrow on your virtual mat that looks like this:

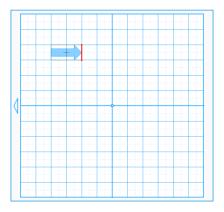


Landscape Virtual Mat

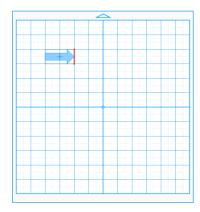

Portrait Virtual Mat

8. To open the cutting control window, go to **Cut Project With...>Klic-N-Kut Zing**. A new window will open asking which KNK Zing model you wish to use. Select the correct model and you may wish to uncheck the box so that it doesn't pop up every time you enter the cut window. (Don't worry, there's a way to get it back if you ever feel you'll need it. Refer to *Section 2.10*.)

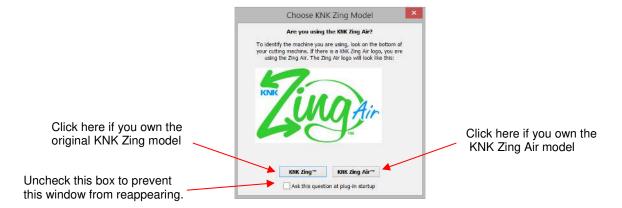

9. The cutting window will now open. It is covered, in detail, in *Sections 2.02-2.08*. But for the purposes of this quick tutorial, make the following changes to the **Speed**, **Force** and **Blade Offset** settings. To change a setting, hold the left mouse button and <u>drag the dial up or down with your mouse</u> or click on the dial once and then <u>use the arrow keys</u> on your keyboard to adjust the setting:



- 10. If, instead of seeing "Connected (COM X)", you see "Not Connected", then your computer is not identifying the Zing. Do the following:
  - ♦ Turn off your Zing. Unplug and reconnect the USB cable at both the Zing and the computer to make sure the cable is firmly plugged in.
  - ♦ Turn the Zing back on.

♦ Click on the Not Connected button, select Connection (), and select Refresh Ports. Repeat by going back to this window and then select the connection that says COMX (USB Serial Port). If there is no option that says USB Serial Port (as shown below), then refer to Appendix B – Communication Issues.




11. Next, set the origin by clicking on the Set Blade Origin button. The following window will open:




<u>IMPORTANT</u>: In **Knife Point** mode, you will use the tip of the pen (or tip of the blade) to set the origin, not the laser light (which is used in the **WYSIWYG** or **Print and Cut** modes.


11. Click on the arrow keys to move the pen to the bottom right corner of the paper. You do not have to be exactly on the corner. In fact, set the pen tip just a little ways in. Then click on **Finished** to set this new origin and close the **Set Blade Origin** window. More details about this window are presented in *Section 2.08*.

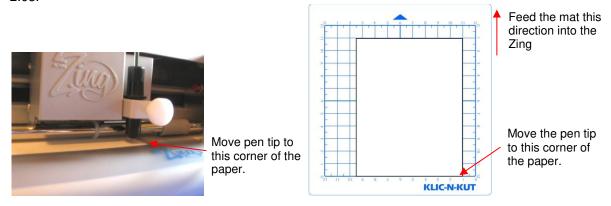

12. Click on **Cut Project** and <u>your arrow shape will be drawn at the new origin you set</u>. After the cut is complete, the cut window will close. Your arrow will be drawn as shown, with the direction related to whether you originally chose **Landscape** or **Portrait** for your virtual mat:

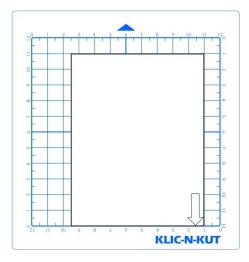

<u>Landscape Results</u>: The arrow is drawn at the origin and points downwards.

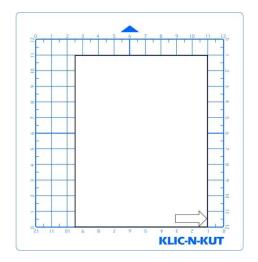

<u>Portrait Results:</u> The arrow is drawn at the origin and points to the right.

13. To draw again, return to the cut window and choose a different origin. Practice moving the origin to different locations. This is how Knife Point mode works. If you want the image to draw where you have it on the Virtual Mat, then you need to switch to WYSIWYG mode and use the laser to set the origin instead of the pen. Refer to Section 2.07 for more details on controlling where images will cut.

IMPORTANT: Please read Section 2.01 before cutting!

#### 1.11 Maintenance

Klic-N-Kut machines do not require any kind of lubrication or routine checks. However, here are a few things to keep in mind for successful operation of your cutter:

- Keep the pinch wheels clean. Depending on the adhesive being used on the cutting mat, it's possible for the
  pinch wheels to become sticky and pick up small pieces of cardstock or other material being cut. This can
  lead, in some cases, to the mat skewing or ruining materials during subsequent cuts. To clean the pinch
  wheels, use a lint-free cloth and an adhesive remover such as isopropyl alcohol or Un-Du to clean the pinch
  wheels thoroughly.
- Keep the grit shafts clean. Equally important as the pinch wheels, the grift shafts beneath the cutting mat
  should also be free of adhesive and tiny bits of material. They can be cleaned the same way as the pinch
  wheels. Note: Do not pour cleaner onto a grit shaft. Instead, dab some adhesive remover onto the lint-free
  cloth and then use the damp cloth to clean the shafts. You can also use tweezers to remove any material or
  adhesive that is stuck to a shaft.
- <u>Keep the cutting mat clean and sticky</u>. As mentioned in the *Section 1.05*, the cutting mat can be washed with soap and water to remove small invisible pieces of material which are reducing the tackiness of the cutting mat. After drying, you can add more repositionable adhesive, if needed.
- <u>Check your blade holder, as needed</u>. If suddenly you cannot get a clean cut, check the blade holder for any tiny slivers of material that may have been caught up by the blade and fed up inside the blade holder.
- The pinch wheels levers on the KNK Zing may need to be tightened from time to time. If the levers are difficult to operate, use a screwdriver to slightly tighten (clockwise only) the screws on the levers.
- If you move your cutter frequently, it is possible for the laser to shift slightly. Periodically, you may want to do a check of the print and cut accuracy to make sure the calibration is still precise. Refer to *Chapter 9*, if you plan to be using your Klic-N-Kut for print and cut applications.
- If you cut vinyl or other backed materials regularly, you may need to replace the cutting strip at some point.
   You will be able to tell based on seeing deep cuts in the strip and an inconsistency in the cutting. Contact KNK USA for information on obtaining a replacement.
- For any other questions or concerns about maintaining your KNK, please post at our user forum: <a href="http://knkusa.com/forums/">http://knkusa.com/forums/</a>

## 2. Cutting

#### 2.01 What You Need to Understand About Cutting

IMPORTANT: Please read all of 2.01!!!

## You Have To Make Mistakes

- The key to becoming successful at cutting is to do a lot of it! Those who shy away from using their Zing will never get to the stage of mastering it. It's very normal for new owners to be intimidated by their cutter, so remember the following key things:
  - ♦ You won't break your new ZING by cutting paper, vinyl, cardstock, rhinestone rubber, and other easy-to-cut materials. The worst thing that might *possibly* happen is that you'll break a blade. That's it! And the likelihood of even that happening is low.
  - You need to start cutting so that you'll make a lot of mistakes! We ALL do that. It's in making these mistakes that you start to learn. You realize that those mistakes didn't result in a broken cutter. Plus you'll stop making the same mistakes as you remember more of the things you need to check before every cut.
  - As you make fewer mistakes you begin to build confidence and you begin to have more cutting success! From there, you begin to experiment more and produce more. Thus, your best course of action is to just start cutting... a lot! But first, read the rest of this section.

## The Most Common Mistakes Made by New Owners

- We all make them and we all learn from them. So, please note the following most common mistakes and then <u>finish reading this entire Section 2.01</u> as the details behind these listed mistakes will be explained:
  - ♦ Too much blade is exposed on the blade holder
  - ♦ The blade tip is too close to the material
  - ♦ Too much force is being used for the material being cut
  - ♦ Forget to set the Blade Offset before cutting
  - ♦ Failure to do a test cut to make sure settings are optimal
  - Not practicing enough with the test pen and paper to know where shapes will cut

#### **Begin with Easy Materials and Easy Shapes**

You didn't begin your first driving lesson on the freeway. You probably started driving on a farm or in a parking lot. Then you progressed to the neighborhood and other low-traffic streets. Then you began driving on major streets and, finally, the freeway. Think of your cutting in the same way and don't start your first cuts with thick difficult materials or detailed cutting files! Instead, start cutting basic shapes from inexpensive materials or just scraps you have on hand. Work your way up to more difficult cuts after you master the easy ones.

## **Record Your Successes**

As you have successful cuts, take note of the settings you just used, such as cutting force, speed, blade
type, number of passes, brand of material, etc. There is a blank form at the end of this chapter that you can
print and use to record your results. There are also suggested settings for common materials at the end of
this chapter. Use these as starting guides but remember that your results may vary based on the many
factors which can affect cutting.


#### Use the Correct Blade for the Material You Are Cutting

- The Zing comes with a 45° blade (red cap) and a 60° blade (blue cap). An optional fabric blade (yellow cap) is also sold. Use the following as a guide for choosing the appropriate blade for the material you are cutting:
  - ♦ The 45° blade (red cap) should be used to cut vinyl, paper, most cardstock, thin plastic, iron-on transfer, and vellum.
  - ♦ The 60° blade (blue cap) should be used to cut chipboard, Grungeboard, stiffened felt, craft foam, rhinestone rubber, thicker craft plastic, self-adhesive magnet, and Shrinky Dink.
  - ♦ The fabric blade (yellow cap) should be used to cut all fabrics and unstiffened felt. It is also recommended by PhotoFrost for cutting their icing sheets.
- Additional recommendations are in the suggested settings table at the end of this chapter.

## Set the Blade Length To Match the Material Thickness



- The <u>blade length</u> is how much blade is exposed at the bottom of the blade holder. You want the blade length to match the thickness of the material for optimal cutting. It is controlled by rotating the top of the blade holder. Rotating clockwise extends the blade (longer blade length). Rotating counter-clockwise retracts the blade (shorter blade length).
- When setting the blade length, hold the blade holder up next to the material before pressing the material to the mat, so that you can more accurately set the length to match the thickness of the material. For really thin materials, like vinyl and thin paper, just the very tip of the blade will be protruding from the bottom of the blade holder. In fact, you should just barely be able to feel it with your fingertip and not be able to see it very well, if at all.
- A good way to test your blade length is to fold a piece of the material onto itself and then cut a line into the material by hand, as shown in the video linked in this section. Press firmly but not too hard, as more force will not determine if the blade is set to the right length. If the blade cannot cut through the material, you will need to extend the blade. If the blade cuts through the material and cuts into the next layer, you need to retract the blade. If the blade cuts through the material but does not cut into the layer below, you have the perfect length.
- Having the blade fully extended will <u>never</u> result in better cutting. In fact, it can cause skewing, tearing of the material, damage to the blade, and damage to the mat.
- When conducting the test cut, be sure to check your mat for cut lines after the test. You should be able to set the length to get clean cuts but with <u>no visible cuts into the mat</u>. If you do see cut lines in your mat, retract the blade length by turning the top of the blade holder ~1/4 of a turn counterclockwise. You do not need to remove the blade holder from the Zing. Repeat your test cut.




## Set the Blade Height Above the Material



• The <u>blade height</u> is the distance from the tip of the blade to the top of the material you are about to cut. When you insert the blade holder into the blade holder seat, it does not necessarily have to be positioned with the outer rim touching the blade holder seat. You have control over that height and can raise the blade holder up a little higher before locking it into place with the front screw on the blade holder seat.

- Adjust the blade height so that:
  - The blade tip will not be dragging across the material you are cutting when moving to the point to begin the cut.
  - The dropping of the blade will invoke more downward force... to a point! Thinner, easy-to-cut materials (such as paper and vinyl) can have the blade tip fairly close to the material. Denser materials, such as cardstock, chipboard and craft plastic, need the blade tip a little higher, but not too high:

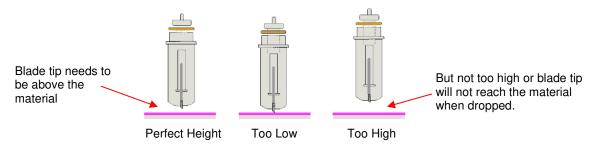

- There are several methods to use in making sure the blade tip is set at a consistent height from one cut to the next:
  - One recommended method for getting the same height set for all of your cuts is to use a spacer of some kind. Place the spacer on top of the material you are cutting. Loosen the front screw and insert the blade holder so that the tip of the blade is touching the top of the spacer. Now tighten the front screw and remove the spacer. This distance will provide the blade some "punch room" to give the extra force and more consistent cutting of your material. What to use for this spacer? For materials such as cardstock and fabric, try using 25 Post-It note sheets or 12 squares cut from cardstock. When cutting very thick materials, such as 0.03" chipboard, felt, or craft foam, use 13 Post It note sheets or 6 squares of cardstock instead.
  - An alternate method is to cut O rings to slip over the bottom of the blade holder and then allow the blade holder and O rings to sit on top of the blade holder seat. Use 1 ring for thin materials (paper and vinyl), 2 rings for cardstock, 3 rings for rhinestone template materials, 4 rings for thick chipboard, and so forth. Unlike the method above, you do not have the material itself lifting the blade holder position, so you need to keep increasing the number of O rings for thicker materials. These rings can be cut from cereal boxes with two glued together to create one ring. The cutting file for these is located here: http://www.iloveknk.com/FreeFiles/KNK/Important/

#### Adjust the Speed, Force, and Number of Passes Based on the Material and Shapes

• Using correct cut settings is equally important as the type of blade, blade length, and blade height. Refer to Sections 2.03 - 2.04 for details. Again, some suggested settings are located at the end of this chapter and settings for using the various Zing accessory tools are located at the end of Chapter 10.

## **Perform Test Cuts!**

• Use the test function in MTC to make test cuts. Do not proceed with your cut until the test cut is clean. When cutting intricate shapes, a test cut of an intricate image, such as a letter or a small portion of your rhinestone pattern, might be a better indicator of correct settings. Refer to Section 2.09.

#### **Know Where Your Images Will Cut**


Practice with the test pen until you know, with 100% confidence, where your images will be drawn. This is
important since you do not want to be guessing when you begin actually cutting with a blade. Refer to
Section 2.07 for details and videos on the options for controlling the locations of your cuts.

#### **Adjust Blade Offset If Needed**

 What is the blade offset? It is the horizontal distance from the center of the blade shaft to the tip of the blade. A pen or engraving tool has an offset of 0 because the tip is centered with the center of the pen/engraving tool shaft. But a blade is different:



• What happens if you set the Blade Offset to 0 when cutting? Or what if it's set too high?

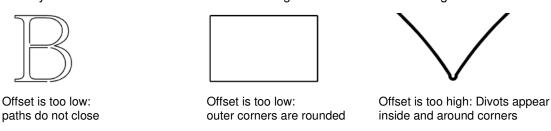

Refer to Section 2.06 for setting the Blade Offset.

## Keep the Cutting Mat Clean and Sticky

- Press your materials evenly to the mat. Think about using a brayer both before AND after cutting.
   Repressing the material after cutting can greatly aid in weeding the cut shapes from the waste.
- When necessary, tape thicker materials to the mat to keep them from slipping during the cut.
- If you cut a range of materials, you might need more than one mat so that you can use stickier mats for certain materials.

## **Don't Get Frustrated, Get Help!**


- Besides having your own Zing dealer as <u>your first line of contact</u>, there are user forums, message boards, and Yahoo groups where you can post questions and get answers from other users, dealers, and Make The Cut experts. Utilize these resources:
  - ♦ Zing Yahoo Group: <a href="http://groups.yahoo.com/group/KNK">http://groups.yahoo.com/group/KNK</a> Zing/
  - ♦ KNK Support Forum: <a href="http://knkusa.com/forums/">http://knkusa.com/forums/</a>
  - ♦ Make The Cut Yahoo Group: http://groups.yahoo.com/group/makethecut/

#### 2.02 Cut with Klic-N-Kut Zing and Zing Air

- Before accessing the Zing cutting window, you need to have at least one shape on the current page to cut. If
  you have no shapes, then attempting to access the cutting window will result in a popup message stating,
  "There is nothing inside the current project to cut!"
- To confirm what will cut, you can access the Cut Preview function in the following ways:
  - ♦ Click on the Cut Preview icon on the File Toolbar



- Press Ctrl+Shift+E
- Go to Cut Project With ... > Cut Preview.
- The cut preview will display the shapes that will be cut. Immediately invoking the function again will show the "material" with the cut shapes removed. This is also sometimes called the negative:



- The Cut with Klic-N-Kut Zing window can be accessed in the following ways:
  - Click on the Cut Project With icon on the File Toolbar



- $\Diamond$ Press Ctrl+Shift+C
- Go to Cut Project With...>Klic-N-Kut Zing...
- The following window will open asking which KNK Zing model you wish to use. Select the correct model and you may wish to uncheck the box so that it doesn't pop up every time you enter the cut window. (Don't worry, there's a way to get it back if you ever find you need to change. Refer to Section 2.10.)






- Refer to the Section numbers shown for instructions on each setting. The Cut Project button doesn't need
  its own section as it simply initiates the cut once you have made your other settings.
- <u>To change a setting that has a dial</u>, hold down the left mouse button and move your mouse up to increase the setting or down to decrease the setting. Alternatively, left click on the dial once and then use the up and down arrows on your keyboard to change the setting.
- The movement within the Zing logo can be toggled on and off by left clicking on the logo.

#### 2.03 Speed

• There are two **Speed** settings: **Cut** and **Up**:

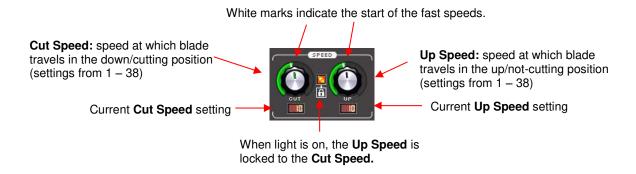

- The **Cut Speed** is the speed of the blade (or other installed tool) while it is in the "down" or cutting position. The Zing Air has 38 speed settings, with 9 of them being below 100mm/sec. This cutter was designed to handle a wide range of thicker, more difficult materials that will cut far more successfully with a slower cut.
  - The settings from 1 through 9 are the slow speeds and should be used when cutting dense difficult materials, such as chipboard, craft plastic, styrene, and balsa.
  - ♦ The setting from 10 through 20 are medium speeds and should be used for easy-to-cut materials, such as cardstock, vinyl, iron-on transfer, and rhinestone template material.
  - The settings above 20 are the fast speeds and should be used for engraving, embossing, and drawing.
- The **Up Speed** is the speed of the blade (or other installed tool) while it is in the "up" or non-cutting position. It has the same number and range of speeds as the **Cut Speed**. An **Up Speed** is in effect when:
  - The blade is travelling from the origin to the point where the cutting of a shape begins
  - ♦ The blade raises and moves to the next path or shape to cut
  - ♦ The blade is travelling back to the origin after the cut is completed.
- There is a small white line in the upper left corner of each dial indicating the transition between the slow speeds and the fast speeds. Also, the color of the bar outside the two dials is yellow when in a slow speed range and green when set in a high speed range:



• Between the Cut and Up dials is a light you can click to turn off and on. You'll note that there is a little lock symbol which is a label for the light, reminding you that when the light is on, the Cut Speed and the Up Speed will match. If you have the two speeds set at different levels, turning the light back on will automatically change the Up Speed to the same setting as the Cut Speed.

• Why would the Cut Speed and Up Speed ever need to be different? When cutting extremely dense materials at one of the slowest speeds, you will want to leave the Up Speed at a normal level, say 15, so that you aren't waiting unnecessarily for the blade to travel from the origin to the location to begin the cut. If the first shape is across the mat from the origin, the wait can seem endlessly long!

## 2.04 Force



- The cutting force (also called pressure) greatly affects the quality of the cut. If the force is too low, the
  material cannot be cut. If the force is too high, you will get bad cutting (even incomplete cutting at times) and
  tearing of the material. Use recommended starting forces for the material you are cutting and perform small
  test cuts before cutting. Make adjustments in order to get a clean test cut before proceeding with your larger
  cut.
- The cutting force ranges from 1 to 160 on the force scale. The maximum of 160 represents the 750g of cutting force on a Zing. Refer to the end of this chapter for recommended starting forces for various materials. Again, remember that a lot of factors can affect the force to use, so use the test cut as a guide and adjust, as needed.
- Dull blades will need more force than new blades, thus anticipate increasing the force over the life of the blade.
- When cutting materials that can use either blade, the 45 degree blade needs more force than the 60 degree blade, because of the extra contact with the material being cut.
- Materials that absorb moisture (such as cardstock, paper, fabric, and chipboard) will need more force (and
  possibly more than one pass) if they have been exposed to humidity. One tip is to blow dry these materials
  before cutting.
- For detailed information on cutting various materials and using accessory tools, refer to Chapter 10.

#### 2.05 Multicut




- The **Multicut** setting causes each individual path to be cut the set number of passes before the blade moves to the next path to cut. This is better than just repeating the entire cut as each repeated pass is cut with the blade held down throughout the repeated passes, resulting in cleaner cutting.
- Multicut is recommended in the following situations:
  - Cutting thicker denser materials, such as chipboard, where multiple passes allow the blade to progressively "carve" through the material
  - Cutting of certain fibrous materials, such as fabric, where a second pass will insure that all of the fibers have been cleanly cut.
  - Cutting intricate or detailed shapes (such as script titles) from certain materials, such as heavily textured cardstock, where a single pass may leave certain spots not cleanly cut.
  - Cutting rhinestone template material where a second pass results in much cleaner weeding of the cut circles.

## 2.06 Blade Offset



- The default **Blade Offset** of 0.25 should work well for the majority of your cutting with the included 45° red capped blade (for red capped blades purchased before November 2013, use 0.35). Use a **Blade Offset** of 0.75 for the included blue capped 60° blade. The Zing fabric blade should also use an offset of 0.75. If you use other brands of blade holders, you may need to experiment with the **Blade Offset** setting. In general, an offset of 0.30 is a good starting point for testing. Refer back to *Section 2.01* to note what happens when the setting is too high or too low.
- When drawing with pens or using other tools, such as the engraver and embosser, turn off the **Blade Offset** (set to 0) by clicking on the button beneath the current **Blade Offset** window:






Click again to automatically reset the **Blade Offset** to the last setting used.



- When Blade Offset is turned on, you'll notice that a small cut is made before the blade carriage moves the blade to begin cutting the first shape. This small correction cut sets the blade in the direction needed for the first path.
- Most of the time, the location of this small cut is not an issue because it is made in what will usually be a waste part of the material. However, for some applications, such as cutting a stencil, it may not be desirable to have this cut in the location it automatically chooses. In this case, you can either tape a small piece of scrap material on top of the place where the correction cut occurs to protect the material beneath, or you can add a tiny little line just below the border of the virtual mat. When you send the shapes to be cut, a popup message will warn you that there are shapes outside of the Virtual Mat. Click on Yes to continue to the cutting window. You can then place a tiny scrap of material in the appropriate location on the cutting mat.

#### **2.07 Cut Type**

- There are three modes in controlling where images will cut to the Zing. They are called:
  - Knife Point: Moves the shapes to cut at the origin you have set on the cutter itself. Use the <u>blade tip</u> to set the origin for cutting.
  - WYSIWYG: Cuts the shapes where they are positioned on the Virtual Mat. Use the <u>laser light</u> to set the origin- either at the corner of the cutting mat or the corner of the material (as described later in this section).
  - Print and Cut: Cuts shapes relative to registration marks printed on your printer. Refer to Chapter 9 for complete instructions on the print and cut process.






## **Knife Point**


# Video Video

- This is the mode recommended for most applications as it economizes the use of your cutting materials.
- Shapes can be located anywhere on the screen, including outside the Virtual Mat. The shapes will be
  moved and cut to where you set the origin on the material. The origin is set using the position of the blade
  tip.
- When more than one shape will be cut, the shape closest to the origin will be cut at the origin and any other shapes will be cut the distance and direction from that shape as positioned on the screen. The following figures show examples of where images will cut. Use the arrow on the Virtual Mat as a guide to the direction to insert the actual mat or material into your Zing.

## ♦ Knife Point – Landscape Mode

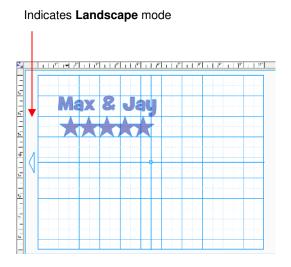


Location of shapes on the screen

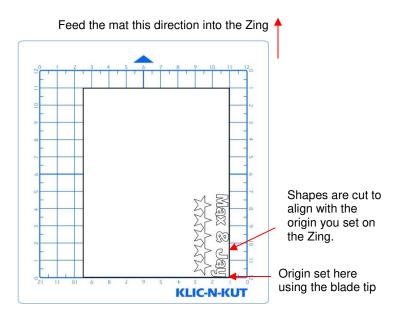


Where shapes are drawn or cut on material

## ♦ Knife Point – Portrait Mode

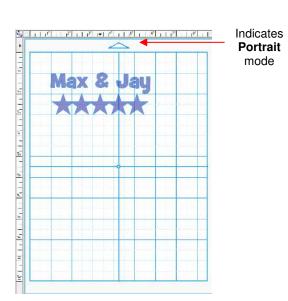


Location of shapes on the screen

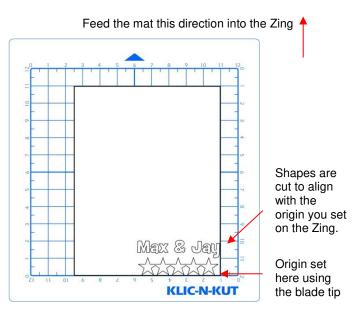

Where shapes are drawn or cut on material

- If you plan to use scraps of materials for cutting shapes, you will want to use the Knife Point mode:
  - Place several scraps (large enough for the shapes on your screen) on your mat in different locations, as shown below.
  - ♦ Insert the mat into the Zing and then set the origin at the lower right corner of one of the scraps and cut the currently selected shape.
  - ♦ Move the pen to the bottom right corner of the next scrap and set the origin there and cut the same shape (or another shape, depending on what you have on your **Virtual Mat**). Repeat for other scraps. Note the red "X"'s indicate where the origin would be set so as to not cut off the scrap:

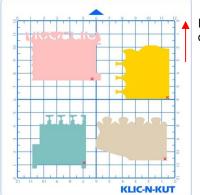

Feed the mat this direction into the Zing

#### **WYSIWYG**




- This is the mode recommended when you need to cut shapes in very specific locations on your material (such as the center front of a greeting card). The laser light is used to set the origin.
- Shapes are cut based on where they are located on the **Virtual Mat**. The mat dimensions should match either the ruled dimensions of the mat you are using or they should match the dimensions of the material you are cutting. These two situations are covered separately.

#### WYSIWYG - Virtual Mat Matches Ruled Grid on Actual Mat


- Create the typical mat that is sized 12" x 12" and uncheck the option to **Show Margins**. This will be a mat that matches the ruled dimensions of the Zing mat. You can use either **Portrait** or **Landscape** mode just remember to place your material on the mat in the correct orientation for feeding into the Zing.
- The origin is set using the <u>laser light</u>, not the blade tip. The laser light will automatically turn on when you go to the <u>Set Blade Origin</u> window. Direct the red dot of the laser light to the <u>bottom right corner of the ruled grid</u> (see below). Note that if you need absolute precision for the location of your cuts, it will be necessary to calibrate the <u>Laser Offset</u>, which is covered in Chapter 9.

#### ♦ WYSIWYG – Landscape Mode

#### Indicates Landscape mode

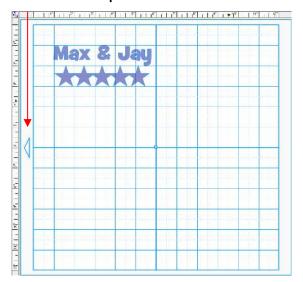


Location of shapes on the screen

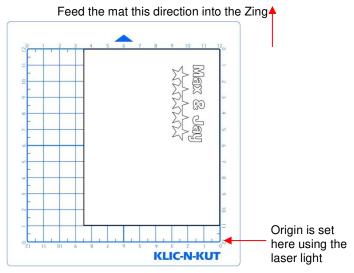


Where shapes are drawn or cut on material

#### WYSIWYG – Portrait Mode

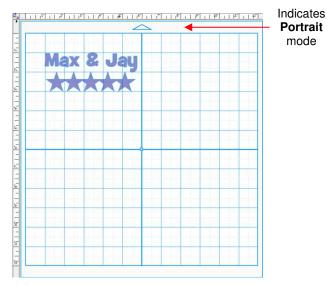

Location of shapes on the screen

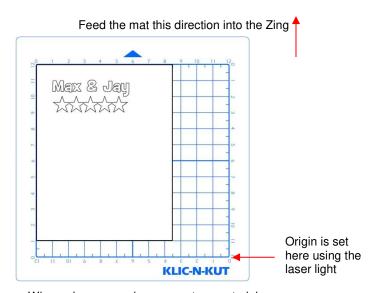


Where shapes are drawn or cut on material

## WYSIWYG - Virtual Mat Matches Material Dimensions

- Create a virtual mat that matches the material dimensions. For example, if you are cutting from an 8.5" x 11" sheet of cardstock, then create a Virtual Mat with those same dimensions. You can use either Portrait or Landscape mode just remember to place your material on the mat in the correct orientation for feeding into the Zing.
- The origin is set using the <u>laser light</u>, not the blade tip. The laser light will automatically turn on when you go to the **Set Blade Origin** window. Direct the red dot of the laser light to the <u>bottom right corner of your material</u> (see below). Note that if you need absolute precision for the location of your cuts, it will be necessary to calibrate the **Laser Offset**, which is covered in *Chapter 9*.


#### ♦ WYSIWYG – Landscape Mode

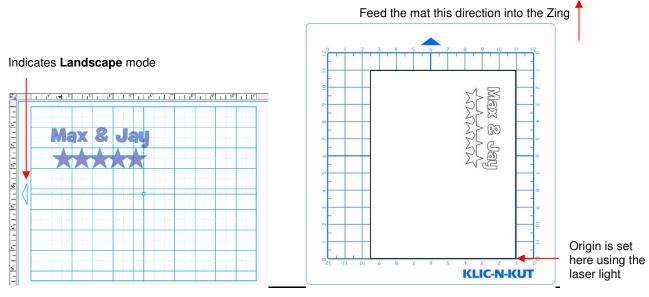

Location of shapes on the screen

Where shapes are drawn or cut on material

## ♦ WYSIWYG – Portrait Mode

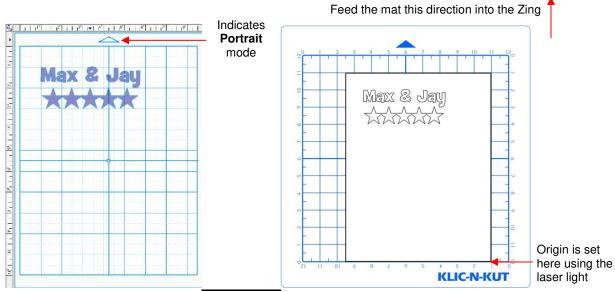

Location of shapes on the screen

Where shapes are drawn or cut on material


#### **Print and Cut**

- This is the mode recommended when you want to print images on your printer and then have the Zing cut them out.
- It is similar to WYSIWYG because shapes will be cut where they are located on the **Virtual Mat**. However, in the **Print and Cut** process, three printed registration marks are printed along with your images. The laser light is then set at each mark and the Zing will then cut out your shapes based on triangulation. This is far more precise than WYSIWYG because it takes into account not only any misalignment of your printout on the mat, but also any errors in the printing. Most printers do not print images precisely in the location on the paper as they are located on the screen.

- Note that raster images (.JPG, .BMP, .PNG etc.) will need to be pixel traced first so that cut lines are created. Refer to *Chapter 6* for tutorials on how to do the pixel tracing (also called vectorizing).
- Refer to Chapter 9 for tutorials on the print and cut process, including calibrating the laser.

#### 2.08 Set Blade Origin

• Clicking on the Set Blade Origin button opens the Set Blade Origin window:

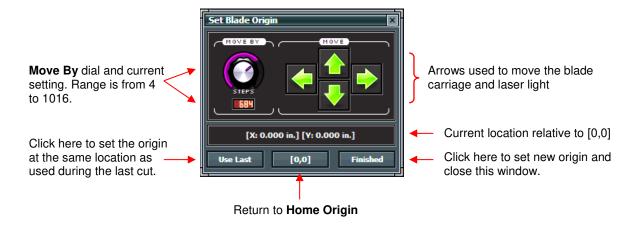

- Every time you turn on the Zing, the blade carriage will be moved to the same spot. This is called the **Home Origin** or **[0,0]**. Now, you can always use that spot to start your cuts and never set a new origin, however, it limits you, somewhat, in situations where you may be performing your test cut at that location but will need to move over to a new location to cut out your shapes. Also, you may want to cut shapes from several scraps of material and would like to place those scraps on your mat prior to cutting.
- The **Set Blade Origin** window allows you to move the blade carriage to a new location and define that location as the new origin for that cut:
  - Click on the green arrows to move the carriage left and right and the mat in and out of the Zing until the blade carriage is in the location you wish to use.
  - ♦ In **Knife Point** mode you will be setting the origin based on the location of the <u>blade tip</u> (or other tool tip).
  - ♦ In **WYSIWYG** or **Print and Cut** modes, you'll be using the laser light to set your origin.
  - Note that you can also use the arrow keys on your keyboard instead of clicking on the green arrows on the screen. This is actually a great alternative since you can then keep your eyes on the blade tip or the laser instead of constantly looking back at the screen to click in the correct spot.
- The Move By dial determines how far the blade carriage moves with each click of an arrow:
  - If you need to move the carriage quite a distance across the mat, then adjust that setting to a high number.
  - ◊ If you need to move the carriage less than an inch or so, then adjust to a much smaller setting.
  - If you need extreme precision such as when you are setting the origin for a **Print and Cut**, then once you are close to the location you need, reduce to the minimum setting of 4.
  - Note that when using the arrow keys on your keyboard, you can adjust the **Move By** dial by holding the **Ctrl** key and clicking on the up and down arrow keys.
- If you want the blade carriage to return to the **Home Origin**, then click on the **[0,0]** button and the blade carriage will immediate return to that location.
- If you want to use the same origin that was just used in your last cut, click on the **Use Last** button and the blade carriage will return to the same [X,Y] location previously set.

• Once the blade carriage (or laser dot) is in the location you need, click on the **Finished** button to set that location as the new origin and close that window.

#### 2.09 Connection Status and Test Cut Menu

- The Connection Status and Test Cut Menu button serves several functions:
  - ♦ The button will either read **Connected (Com X)** or **Not Connected** depending on whether or not the computer has identified a connection to the Zing:



Clicking on this button will open a menu:




- ♦ The laser can be turned on or off in this menu by choosing Toggle Laser On. Or, any time you are in the Cut with Klic-N-Kut Zing window, you can press F2 to toggle the laser. The laser will also be turned on when going to the Set Blade Origin window.
- The **Test Cut** options menu contains a list of ten possible shapes to use for your test cut. Performing a test cut is essential to make sure the cut settings, blade exposure, and blade tip height are correctly set before executing your actual cut. In some situations you will want to select a shape based on your actual shape. For example, cut the flower if you are going to be cutting a shape that has scallops. Or cut the rhinestone template if you will be cutting an actual rhinestone pattern to verify that you will get clean weeding of the circles.
- ♦ The Connection () menu opens with the following options:



#### 2.10 Updates, Presets, and Help

 The Updates and Help drop down menu is activated by clicking on the down arrow in the top right corner of the Cut with Klic-N-Kut Zing window:

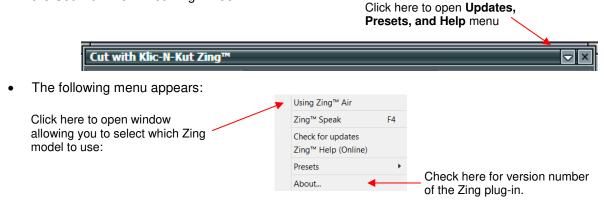

- In this menu, you can check for updates to the plug-in, access the on-line Zing user manual, switch Zing models, turn on Zing Speak, and check the current version number of the Zing plug-in installed.
- Presets are default settings (**Speed**, **Force**, **Multicut**, **Blade Offset** and **Cut Type**) you want to always use for a particular material or application:
- Enter the values you want to use in the **Cut with Klic-N-Kut Zing** window. For example, for thin smooth cardstock, you might choose to set the two **Speed** values at 10, **Force** at 85, **Multicut** at 1, **Blade Offset** at 0.25 and the **Cut Type** at **Knife Point**.
- Then access the **Presets** menu by clicking on the drop down arrow and selecting **Presets**:



• Select **Create Preset** and the following window will open where you can enter a name for your new **Preset** and any **Notes** you wish to have:



• After clicking on **Save**, the new **Preset** appears in the list:



 Clicking on a Preset in your list will then change the current settings in the Cut with Klic-N-Kut Zing window to the settings you saved and the Notes you entered will pop up:



• To delete a **Preset**, right click on the name in the list and a popup window will ask you to confirm if you wish to delete.


### 2.11 Important Checklist Before You Cut!

- Do you have your material on the mat and the mat inserted into the Zing? (Note: materials with a backing sheet, such as vinyl and iron-on transfer do not require a mat for cutting)
- Do you have the pinch wheel levers raised in the front (so that the pinch wheels are down)?
- Have you set the blade length based on the thickness of the material you are cutting?
- Do you have the blade holder firmly mounted in the blade holder seat and the blade tip at the correct height above the material?
- Have you set the Origin at the bottom right corner of your material (or wherever you need the origin to be)?
- Have you set the Force? And the Speed?
- Have you selected the correct Offset?


- Do you need to turn on Multi-cut for this material?
- Have you selected the Cut Type you wish to use? Do you know, with confidence, where your shapes are going to cut?

### 2.12 Resolution Calibration

- If you were to cut out any particular shape, for example, a 10" x 10" square, you might find that it actually measures 9-15/16" x 10-1/32". It will be <u>very close</u> to 10" x 10" but perhaps just slightly smaller or larger in either or both dimensions. Now this might be perfectly acceptable for the type of cutting you do. Therefore, it may not even be necessary to do this particular calibration. However, if you do want to make sure your shapes are cut precisely, the following procedure will allow you to calibrate your KNK.
- Note that this Resolution only applies to Knife Point and WYSIWYG cutting modes. For Print and Cut
  applications, Resolution is determined automatically based on where the registration marks are set with the
  laser light during the print and cut process.
- Begin by selecting the 12 x 12 Virtual Mat set to the orientation you prefer.
- Add a <u>large square</u> to the **Virtual Mat** (you will find one under **Basic Shapes** in the **Polygons** folder). Note
  that the larger the shape, the more accurate your calibration will be, thus it is highly recommended that you
  use, for example, a 10" x 10" rectangle. If needed, refer to *Section 3.13* for directions on resizing shapes.
- It is recommended that you use the test pen for drawing versus the blade. This will allow you to reuse the same sheet of paper for several tests, during the calibration process. You will also need a ruler.
- Click on the **Cut Project With** icon and, under **Cut Type**, choose **Knife Point**. Set the origin based on the pen nib and click on **Cut Project** to have the square drawn on the piece of paper.
- Slide the mat out but leave the paper on the mat. Note that regardless of having your Virtual Mat set to Landscape or Portrait, the Width of the square is the left-to-right dimension as you face the Zing. The Height of the square is the front to back dimension:

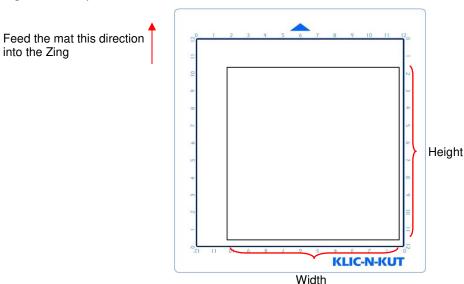

- Because the Zings are so very close to being perfectly accurate, only take note if the sides are slightly larger than 10" or slightly smaller than 10" because it will probably be so close that you cannot even measure the distance from 10" with a ruler! Instead, let's say the **Height** is just the tiniest bit over 10". Mark that side as being 10.01". Let's say the **Width** is less than 10", more so than the **Height** was below. Mark that side as 9.98". Now, if you feel you can measure accurately, with a ruler, then do so. But just estimating should work fine, too.
- Click on the **Cut Project With** icon again, and click on the tiny wrench icon. The Calibrate window will open where you can input your measurements. Note that if you used a square that was either larger or smaller than 10", then be sure to change those numbers on the left, as well as inputting the numbers on the right:

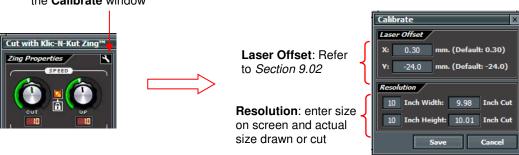

- Click on Save.
- Now, you'll want to repeat the drawing of the square and you can use the same paper as long as you move
  the origin to a new location and you make sure your new square will fit on the same sheet.
- After drawing the new square, again, align with a ruler to see how closely the square matches 10" x 10". If
  you overcorrected then go back and input a smaller correction. If you didn't correct by enough, then input a
  larger correction.

### 2.13 Zing Speak

### What is Zing Speak?



• **Zing Speak** is a feature in the KNK Zing plug-in, beginning with version 2.0. It allows you to communicate by voice with the computer to ask questions and control settings in the **Cut with Kic-N-Kut Zing** window.

### Why would I want to use Zing Speak?

- There are several situations in which Zing Speak is particular handy:
  - Print and cut applications where you are standing at the Zing, directing the laser dot to each registration mark
  - Test cutting materials in which you are making changes in the settings and executing cuts from the **Test** Cut menu. It's more convenient to be in front of the Zing the entire time versus going back and forth to the computer.
  - Calling up presets (material cut settings) you've already created and added to Make The Cut.
- It's also "just plain fun" to use! The vocabulary is rich in variations and you may find yourself hooked on using it!

### What do I need so that I can use Zing Speak?

- You will need:
  - ♦ KNK Zing with Make The Cut, of course! This is a Windows application only, but it will work with Windows XP, Vista, 7 and 8.
  - Desktop microphone or a headset with a microphone
  - Speakers either built-in speakers in your computer or accessory speakers plugged into your computer.
  - XP owners you will probably need to install Speech SDK51. It is installed with Microsoft Office. But if you cannot get Zing Speak to initiate, download and install again from this link:

http://www.microsoft.com/en-us/download/details.aspx?id=10121

### How do I install Zing Speak?

- Zing Speak is a part of the KNK Zing plug-in 2.0. Just download and install this plugin.
- Some users may find it necessary to adjust certain settings in Windows to get the correct headset/microphone recognized and working. Refer to this tutorial for more details:


 $\frac{\text{http://www.iloveknk.com/Support/Tutorials/Make-The-CutSupport/Tutorials/Setup-Headset-Microphone-for-Zing-Speak.pdf}$ 

### How do I initiate Zing Speak?

 When you enter the Cut with Kic-N-Kut Zing window, press F4 or click on the down arrow in the top right corner:



The following window will open:

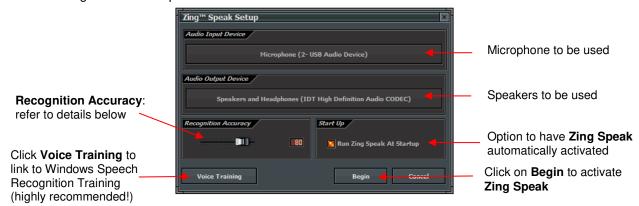

- Check what defaults are set for the **Audio Input** and **Audio Output** devices. If they are not correct, then go to Windows Control Panel and click on **Sound**. Defaults can be changed there.
- The **Recognition Accuracy** is a value the speech engine sends back as to how confident it is in what you said. The default is set at 80%. So it will execute the command if it is at least 80% confident. So, if you set it at 1%, then it will just execute most any command, no matter how confident it is. A setting of 100% means it will never make a mistake, but you have to speak perfectly.
- You may want to mark the option to Run Zing Speak at Startup. Since Zing Speak only works when the
  Cut with Klic-N-Kut Zing window is open, it saves time to have it automatically switch on each time you're
  ready to cut. Even when activated, you still have the option to change settings using your mouse or
  keyboard.
- If this is the first time you are using Windows voice recognition software on your Zing, it is highly recommend that you go through the **Voice Training**. This is an easy process of reading of a series of sentences so that your computer will learn how you pronounce certain words. You may want to also do a second session and you will see the option to do so, after you finish the first one. This definitely improves the recognition of commands when using **Zing Speak**.

### How do I use Zing Speak?

- Once you have completed the Voice Training, you are ready to being using Zing Speak! You may ask
  questions about settings, change your settings, set the origin, turn on/off the laser, perform a test cut, call up
  a preset, check your connection, and execute a cut.
- The available commands have been written to allow for variances. For example, when inquiring about the current force, you can ask in any of the following ways:
  - ♦ What is force?
  - ♦ What is the current force?
  - ♦ What is my current force?
  - ♦ Please, what is my force?
  - ... and other similar variations
- Similarly, when changing a setting, there are a number of different ways to instruct the software, such as:
  - ♦ Set force to 80
  - ♦ Please set the force to 80
  - ♦ Turn the force to 80
  - ♦ Force to 80
  - ♦ Go ahead and set the force to 80
  - ♦ Could you set the force to 80
  - ... and other similar variations
- Appendix C contains a *Quick Reference* to use as you learn **Zing Speak**. It shows one sample for every inquiry or command available.
- A more complete, but optional Vocabulary Guide of available words and terms is available to download here:

#### http://www.iloveknk.com/Support/Tutorials/Make-The-Cut/

You may never even need to use the complete Vocabulary Guide. If you do download the file, please do not be intimidated by the extent of the list. The purpose of such an extensive vocabulary is to simply cover the many ways users can state the same thing. For example, you may prefer to use the verb "turn" and not "set". That's fine! You may prefer to say "What's my pressure? instead of "What's the force?" Again, that's perfectly acceptable. A big thank you to Andy for providing us so many alternatives!

### What else do I need to know?

#### **Presets**

• The settings for presets can be adjusted using **Zing Speak**, but to save a new one, you'll need to manually go to the drop down menu at the top of the **Cut with KNK Zing** window or press **F5** and then enter the name of the preset. From that point, however, you can use **Zing Speak** to pull up the settings for that preset by saying "Use Preset <name of preset>" or "Please use Preset <name of preset>" (and other variations).

### Set Blade Origin

As shown in the Quick Reference, there are different ways to set the Steps (Move by setting). You can specify an exact number of Steps from the limits of 4 to 1016 (e.g. Set Steps 50) or, if you need to set it to the lowest or highest limit, then just say "Set Steps Minimum" or "Set Steps Maximum." As with other functions, you can also use other terms, such as smallest and largest. Again, you'll adapt whichever terms are easiest for you to remember.

• When moving the blade carriage you can either start with the word "Move", as in "Move 7 left" (to move 7 steps to the left) or just say "7 left." When moving forward or back, there are a number of alternatives, such as "front", "forward", "up", "back", "backwards", "down", etc. Note that these same commands are also used when performing a print and cut application.

### Disabling

• Sometimes you may wish to leave the Cut with KNK Zing window open, but prefer to not have Zing Speak running. There are a number of ways to have Zing Speak temporarily shut off, such as saying "Ignore me" or "Pay no attention to me". There will be a confirmation and then Zing Speak will wait for reactivation using a phrase like, "Pay attention to me." You can also turn off Zing Speak with several different phrases. Again, be sure to check the Vocabulary Guide for your choices.

# **Settings Form for Cutting Materials**

Material Type	Material Brand or Source	Blade	<u>Force</u>	Speed	Blade Offset	# Passes	<u>Ht</u>	Other Comments

<sup>1 © 2009 - 2014</sup> Sandy McCauley, All Rights Reserved

## Suggested Cut Settings for Various Materials on KNK Zing / Zing Air

**IMPORTANT**: These settings should be used for the <u>initial test cut</u>. Adjustments may be necessary based on <u>the condition of the blade</u>, <u>variations</u> in the material, <u>humidity</u>, condition of the <u>cutting mat</u>, blade tip height, etc.

Material Type	Material Brand or Source	Blade	Force	Speed	Speed (Cut/Up)		Blade Ht*	Other Comments
				Zing	Zing Air			
Acetate	Grafix - 0.005"	Red	60	10/10	15/15	1	25	
Aluminum	Lipton Tea can	Red	130- 140	8/10	9/15	1	13	Flatten with a brayer and tape to mat (all the way around)
Balsa	1/16" from Michael's	Blue	80-90	8/10	9/15	2	6	Tape to mat; avoid thin parts; splinters easily; use 6 Post It notes for ht; may want to decrease offset
Balsa	1/32" from Michael's	Blue	80-90	8/10	9/15	2	6	Tape to mat; may want to decrease offset
Basswood	1/16" from Hobby Lobby	Blue	160	8/10	9/15	6	13	Use 13 Post It Notes for blade tip height; tape to mat
Candle Wax	Stockmar wax sheets - 0.05"	Blue	5	9/10	11/15	1	25	Avoid having wheels over wax, placed wax in freezer for a few minutes after cutting and before weeding
Cardstock	American Crafts - 80 lb (218g)- Textured	Red	75-95	10/10	15/15	1	25	
Cardstock	Bazzill - Basics	Red	75-95	10/10	15/15	1	25	
Cardstock	Bazzill - Card Shoppe	Red	120- 140	10/10	15/15	1	25	or Force of 100 and 2 passes
Cardstock	Bazzill - Prismatics	Red	40-60	10/10	15/15	1	25	Very sensitive to blade length and excess force
Cardstock	Bazzill - Swiss Dots	Red	85- 105	10/10	15/15	1	25	
Cardstock	Bazzill - Two Scoops Paper	Red	80- 100	9/10	11/15	1 or 2	25	Use 2 passes on complex shapes
Cardstock	Bazzill - various textures	Red	70-95	10/10	15/15	1 or 2	25	Can vary greatly based on texture and color
Cardstock	DCWV - Textured Brights	Red	65-85	10/10	15/15	1	25	Varies with color
Cardstock	Doodlebug - Chenille texture	Red	95- 110	9/10	11/15	2	25	
Cardstock	Doodlebug - Crushed Velvet texture	Red	80- 100	9/10	11/15	2	25	Facedown on mat; mirror shapes before cutting
Cardstock	Georgia Pacific 110 lb (298g) white	Red	65-85	10/10	15/15	1	25	
Cardstock	Hammermill – Cover	Red	50-70	10/10	15/15	1	25	Doesn't cut as clean as others
Cardstock	Neenah - 110 lb (298g) white	Red	100- 120	10/10	15/15	2	25	or Force of 140 and 1 pass
Cardstock	Neenah - 80 lb (218g) white	Red	50-70	10/10	15/15	1	25	

<sup>\*</sup>Number of Post-It notes used to set blade tip distance from material © 2009 - 2014 Sandy McCauley, All Rights Reserved

Material Type	Material Brand or Source	Blade	Force	Speed	(Cut/Up)	# of Passes	Blade Ht*	Other Comments
				Zing	Zing Air			
Cardstock	Paper Studio - smooth finish	Red	70-90	10/10	15/15	1	25	Tested white, black, and maroon
Cardstock	Paper Studio - textured finish	Red	100-120	10/10	15/15	1	25	Tested white & black; cuts better w/ texture down
Cardstock	Prism	Red	70-90	10/10	15/15	1	25	Colors tested: Cream Puff and Brilliant White
Cardstock	Recollections	Red	55-70	10/10	15/15	1	25	Varies with color
Cardstock	Stampin Up - white	Red	80-100	10/10	15/15	1	25	Other colors may need more force
Cardstock	Wausau AstroBrights - 65lb (177g) Sticky Cardstock	Red	70-90	10/10	15/15	1	25	Do not cut through backing sheet
Cardstock	Wausau Creative Collection - 65lb (177g)	Red	65-75	10/10	15/15	1	25	Force varied with color
Cardstock	We R Memory Keepers - textured	Red	25-45	10/10	15/15	1	25	Facedown on mat; mirror shapes before cutting
Cardstock	Coordinations	Red	85-100	10/10	15/15	1	25	Varies with color
Cardstock	WorldWin Cutmates (knkusa.com)	Red	60-70	10/10	15/15	1	25	Varies with color
Cardstock	WorldWin Texttured - Red Twill (Paper Mill Store)	Red	65-80	10/10	15/15	1	25	Cuts beautifully!
Cardstock	X-Press It - 250gm (~92 lb equivalent)	Red	30-50	10/10	15/15	1	25	Cuts beautifully!
Chalkboard Cardstock	DCWY Chalkboard Stock	Red	75	10/10	15/15	1	25	Tested color black
Chipboard	0.02" white	Red	140	9/10	11/15	1	25	May need 2 passes on small detail
Chipboard	0.03" (knkusa.com)	Blue	140	9/10	11/15	1 or 2	13	Use 2 passes on detailed images
Chipboard	Cereal Box	Blue	110-130	9/10	11/15	1 or 2	25	May need 2 passes on small detail
Chipboard	Grafix Medium Wt - natural	Blue	140	7/10	7/15	4	13	Taped to mat.
Clear Sheet	Heartfelt Creations "Clear Cardstock"	Red	130	9/10	11/15	1	25	Taped to Mat
Coffee Filter	two ordinary brands tested	Red	15-20	9/10	11/15	1	25	Use very little blade exposure
Contact Paper	Clear, removable from Target	Red	10-20	10/10	15/15	1	25	
Craft Plastic	0.015" PETG from Dick Blick	Red	150	9/10	11/15	2	25	Called Dura-lar clear plastic at Dick Blick
Craft Plastic	Clear Scraps	Blue	160	9/10	11/15	2	13	Taped to Mat
Craft Plastic / PETG	Grafix 0.02"	Red	160	8/10	9/15	4	13	Taped to Mat
Double Sided Adhesive Sheets	Cut Bond Create	Red	70-80	10/10	15/15	1	25	

<sup>\*</sup> Number of Post-It notes used to set blade tip distance from material © 2009 - 2014 Sandy McCauley, All Rights Reserved

Material Type	Material Brand or Source	Blade	Force	Speed	(Cut/Up)	# of Passes	Blade Ht*	Other Comments
				Zing	Zing Air			
Double Sided Adhesive Sheets	Sookwang	Red	40-50	10/10	15/15	1	25	
Double Sided Adhesive Sheets	Stampin Up - #120805 (Sizzix brand)	Red	30-40	10/10	15/15	1	25	
Double Sided Adhesive Sheets	Thermo Web Peel n Stick	Red	45-55	10/10	15/15	1	25	Tape to mat
Duralar	0.005" (digitalcuttersplus.com)	Red	90-100	10/10	15/15	1	25	
Fabric - Denim	Denim - with and without stabilizer tested	Yellow	150	9/10	11/15	4	18	Tape to mat if no Heat n Bond is applied
Fabric - Fleece	With Heat n Bond applied	Yellow	160	8/10	9/15	3 or 4	13	
Fabric - summer twill	No stabilizer used	Yellow	140-150	9/10	11/15	2	25	Taped to a very sticky mat
Fabric - summer twill	With freezer paper applied	Yellow	125-135	9/10	11/15	1 or 2	25	
Fabric - summer twill	With Heat n Bond applied	Yellow	100-110	9/10	11/15	1 or 2	25	May need 2 passes on small detail
Fabric - thin cotton	Type used for quilting - no stabilizer	Yellow	90-110	10/10	15/15	2	25	Pressed to extra-sticky mat; varies with fabric
Fabric - thin cotton	Type used for quilting - with Heat n' Bond	Yellow	65-90	9/10	11/15	1 or 2	25	Varies with fabric
Fabric - wool	Applied freezer paper	Yellow	150-160	9/10	11/15	3	13	
Faux Rhinestone - thicker	Buckle Boutique	Blue	60-70	9/10	11/15	3	13	Right side down to mat; may need to pull shape away from waste
Faux Rhinestone - thinner	Buckle Boutique	Blue	60-70	9/10	11/15	4	13	Right side down to mat
Felt - Soft	Michael's (NOT Eco-fi avoid that!)	Yellow	75-85	9/10	11/15	2	13	Heat N Bond applied
Felt - stiffened	~1/16" from Michael's (NOT Eco-fi avoid that!)	Blue	125-135	9/10	11/15	3	13	Taped to a sticky mat
Foam	Fun Foam from Michael's	Blue	5-10	9/10	11/15	2	13	
Foil Paper	Recollections	Red	70-90	10/10	15/15	1	25	Place upside on mat; mirror images
Frisket Film	Grafix - 0.002"	Red	15	9/10	11/15	1	25	Treat like vinyl: tiny blade exposure, only cut thru film
Glimmer Paper	Stampin Up - #124005	Red	125-135	9/10	11/15	1	25	Taped to Mat
Glitter Paper	American Crafts POW	Red	70-90	10/10	15/15	1	25	May need to tape to mat
Glitter Paper	Recollections Signature	Blue	110-130	9/10	11/15	2	25	Tape to a sticky mat upside down; mirror images
Glitterflex Ultra	knkusa.com	Red	30-40	10/10	15/15	1	25	Cut dull side up: mirror shapes!
Grungeboard	Tim Holtz product	Blue	110-120	9/10	11/15	2	13	Taped to Mat

<sup>\*</sup> Number of Post-It notes used to set blade tip distance from material © 2009 - 2014 Sandy McCauley, All Rights Reserved

Material Type	Material Brand or Source	Blade	Force	Speed	(Cut/Up)	# of Passes	Blade Ht*	Other Comments
				Zing	Zing Air			
Icing Sheets	Cut-N-Frost by PhotoFrost	Yellow	20-45	10/10	15/15	1 or 2	25	Thin sheet version not recommended
Iron-on Transfer	knkusa.com	Red	20-40	10/10	15/15	1	25	Cut dull side up: mirror shapes! Force will vary with brand.
Iron-on Transfer	Easy Weed	Red	10-15	10/10	15/15	1	25	
Leather	Bookbinding quality	Red	90-100	10/10	15/15	2	25	
Lutradur - Heavy Wt	ctpub.com	Red	50-60	9/10	11/15	2	25	Doesn't handle very thin parts: use light wt Lutradur for intricate shapes
Lutradur - Light Wt	ctpub.com	Red	50-60	10/10	15/15	1	25	
Magnet - Printable	0.015" from knkusa.com	Blue	50-60	9/10	11/15	2	25	Taped to Mat
Magnet - Printable	20 mil (0.02")	Blue	140-150	9/10	11/15	2	25	
Magnetic Material	knkusa.com, 0.035"	Blue	150-160	9/10	11/15	2	13	Taped to Mat, magnet side up
Masking Tape	Blue painters tape	Red	7	9/10	11/15	1	25	Very sensitive to blade length and excess force
Masking Tape	Green Frog tape	Red	5	8/10	9/15	1	25	Very sensitive to blade length and excess force
Masking Tape	Purple painters tape	Red	5	8/10	9/15	1	25	Very sensitive to blade length and excess force
Mat Board	Black - Hobby Lobby	Blue	140-150	7/10	7/15	3 or 4	13	Tape to mat; Colored side down
Modeling Film	Clearly for Art: black and white	Red	130	9/10	11/15	1	25	Taped to Mat
Modeling Film	Clearly for Art: clear	Red	140	9/10	11/15	2	25	Taped to Mat
Mylar	Shimmer Sheetz (tested black and pink marble)	Red	85	10/10	15/15	1	25	Taped to Mat
Mylar - 0.005"	Tapplastics.com	Red	90	10/10	15/15	1	25	
Mylar - 0.007"	Grafix Clear Lay	Red	100	9/10	11/15	2	25	
Mylar - 0.010"	stencilease.com	Red	160	8/10	9/15	3	25	Sticky mat plus taped to mat.
Paper - Copy/Printer	20 lb (75g) Multi-purpose	Red	20-40	10/10	15/15	1	25	Set blade to minimal exposure
Photo Paper	HP Advanced - Glossy	Red	100-110	10/10	15/15	1	25	
PhotoFrost Icing Sheet - Thick	PhotoFrost	Yellow	20-45	10/10	15/15	1 or 2	25	Thin sheet version not recommended
Posterboard	Grocery Store	Red	100-120	10/10	15/15	1	25	
Posterboard	6 Ply Pacon in various colors	Red	115-130	9/10	11/15	2	25	
Rhinestone Template	KNK Rock-it from knkusa.com	Blue	75-95	10/10	15/15	2	25	Cut on sheet - use sticky mat to weed circles, if needed

<sup>\*</sup> Number of Post-It notes used to set blade tip distance from material © 2009 - 2014 Sandy McCauley, All Rights Reserved

Material Type	Material Brand or Source	Blade	Force	Speed	(Cut/Up)	# of Passes	Blade Ht*	Other Comments
				Zing	Zing Air			
Rhinestone Templatel	Green from knkusa.com	Blue	80-100	10/10	15/15	2	25	Peel off backing,place sticky side onto mat
Shrink Film	Grafix - clear	Red	130	10/10	15/15	2	25	Taped to mat
Shrinky Dink	Frosted Ruff N' Ready	Red	130	10/10	15/15	1	25	Taped to mat
Stamp Material	Clear rubber sold by Silhouette	Red	30	8/10	9/15	1	25	Used the special mat sold by Silhouette for cutting their stamp mat'l
Stencil Board	Dark –heavy resin	Red	110-120	9/10	11/15	2	25	Tape to mat; this is the type that has a pungent smell
Stencil Board	Light –minimal resin	Red	40-50	9/10	11/15	1	25	Tape to mat; this is the type that has no smell
Stencil Plastic	Show-Offs	Red	150	8/10	9/15	2 or 3	25	Side with clear sheet down tape to mat
Sticky Flock	The Decal World	Red	70-80	10/10	15/15	1	25	
Styrene	Lowes blank signs: pink & green, ~0.027"	Red	150	8/10	9/15	2	25	Taped to Mat
Styrene	www.knkusa.com, white, ~0.02"	Red	140	9/10	11/15	2	25	Taped to Mat
Sugar Sheets	Wilton	Red	40	9/10	11/15	1	25	Used margarine to adhere sheet to non-sticky mat
Transparency Film	HP (from Office Max)	Red	70	10/10	15/15	1	25	
Vellum	digitalcuttersplus.com	Red	35-45	10/10	15/15	1	25	
Vellum	Heavy	Red	80-90	10/10	15/15	1	25	
Vellum	Medium wt with texture	Red	70-80	10/10	15/15	1	25	
Vellum	Stampin Up - #101856	Red	35-45	10/10	15/15	1	25	
Vellum - heavy	WorldWin Colormates - 48lb (132g)	Red	90-100	10/10	15/15	1	25	
Vellum - thin	WorldWin Colormates	Red	20-30	10/10	15/15	1	25	
Vinyl	knkusa.com	Red	5-15	10/10	15/15	1	25	
Vinyl - Cling	digitalcuttersplus.com	Red	35-45	10/10	15/15	1	25	
Vinyl - printable	knkusa.com	Red	15-25	10/10	15/15	1	25	
Window Sheets	Stampin Up - #114323	Red	130	9/10	11/15	1	25	Taped to Mat
Wood Veneer	0.015" from cardsofwood.com	Red	120	9/10	11/15	2	25	walnut and oak were tested; taped to mat
Yupo Synthetic Paper	dickblick.com, 144lb (390g)	Red	135-145	9/10	11/15	2	25	
Yupo Synthetic Paper	dickblick.com, 74lb (199g)	Red	60-70	10/10	15/15	1	25	


<sup>\*</sup> Number of Post-It notes used to set blade tip distance from material © 2009 - 2014 Sandy McCauley, All Rights Reserved

### 3. MTC Basics

This chapter begins the Make The Cut User Manual and is based on Version 4.6.1. As noted on the first page, this is meant to be an online interactive manual. Refer back to that page for features to use while reading online. It is highly recommended that you do <u>not</u> print this entire manual. It is updated frequently as additions and changes are made to the software. Also, hyperlinks to new online videos are added with each update. These are provided to enhance your learning experience. Wherever you see a large green "Video" icon, click on it to automatically link to and open a video related to the topic that follows:

### 3.01 Main MTC Screen

Below is a screen shot of the main screen in MTC identifying toolbars, bars, and other important elements on the screen. Note the specific names of the items shown as they will be referenced throughout this user manual:

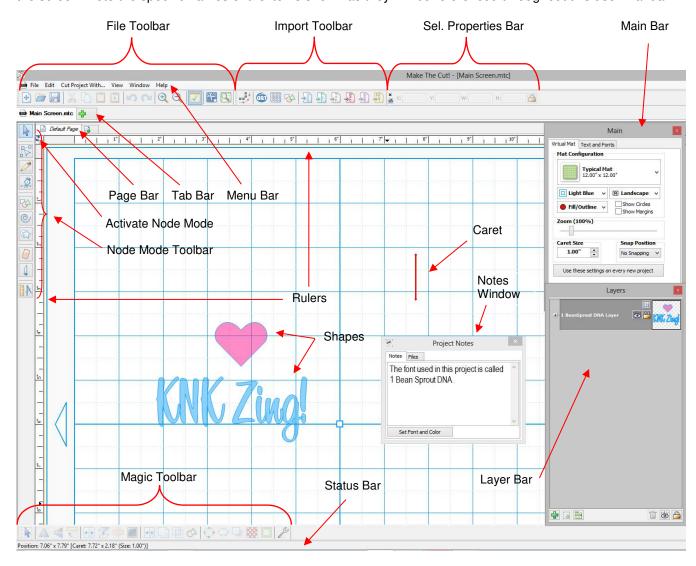

- Shown above are four Toolbars, seven Bars, one Window, two Rulers, two Shapes, and a Caret.
- Some of the elements shown, such as the Rulers, Notes Window, as well as some of the Toolbars and Bars, can be turned on or off by going to View on the Menu Bar.
- Hovering your mouse over any of the screen icons will pop up the icon's name and/or function and shortcut key. Identification of these icons is also presented in *Sections 3.02*, *3.03*, and *7.06*.


- Most of the bars and toolbars may be moved to different locations on the screen. Hold down the left mouse button on the gray dots along the left side of the bar or toolbar and drag. To position these bars and toolbars vertically, drag to the left or right edge of the screen.
- Shapes are the objects or images that you will be adding to your projects. They can be created from scratch or imported from other sources. As you will see throughout sections in this user manual, you have many options and resources available to you!
- The **Caret** indicates where an imported or pasted shape will be placed and the height of that shape. To move the **Caret**, double click at any desired location on the screen. The size of the **Caret** can be changed on the **Virtual Mat** tab (refer to *Section 3.04*).
- The **Notes Window** (also called **Project Notes**) is opened from **View** on the **Menu Bar**. This is used to provide information such as instructions or Terms of Use, and to attach files. Refer to *Section 8.15*.
- There is also a *Lettering Delights* window that can be opened from **View** on the **Menu Bar**. When you first open MTC, a popup may ask you if you want to open this window. For details about the Lettering Delights function, refer to the last part of *Section 4.07*.
- Not all of the functions in MTC appear as icons. Thus, check the subheadings within the *Table of Contents* to find more functions to use in designing your cutting files.

### 3.02 Toolbars

• There are four toolbars in MTC: **File**, **Import**, **Magic**, **and Node Mode**. In this section, only the individual icons will be identified. To learn more about using the functions, refer to the user manual sections indicated under the labels.


### File Toolbar

 The File Toolbar, by default, is located at the top left of the screen. It can be turned on and off under View on the Menu Bar.

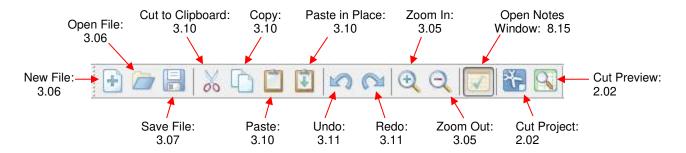


### **Import Toolbar**

Use the Import Toolbar to import the following file types:

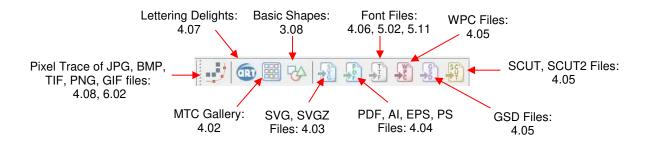

### **Magic Toolbar**

The Magic Toolbar contains the functions that are used in editing and designing:

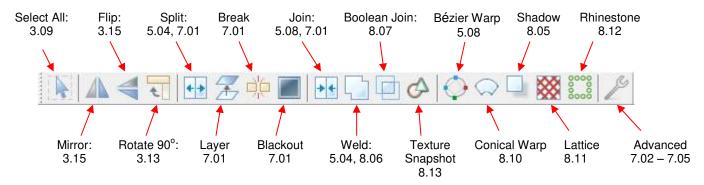

### **Node Mode Toolbar**


• The **Node Mode Toolbar** contains the functions used in editing paths and nodes in vector images. You may never find it necessary to use these tools. But if you need the ability to modify images at the most basic level, the tools are available and powerful in their functionality. Refer to *Section 7.06* for identification of the individual icons and how to use them.

### 3.03 Bars

There are seven bars in MTC, presented below. In this section, only the individual icons will be identified. To learn more about using the functions, refer to the user manual sections as indicated.

### Menu Bar

 Like most Windows applications, the Menu Bar in MTC provides access to most of the functions in the software. The following text boxes indicate the primary functions found in each of the Menu Bar choices:

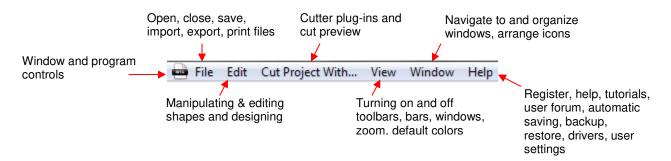


### Sel. Properties Bar

• The Select Properties Bar displays the location and size of the current selected shape or shapes:



### Main Bar

• The Main Bar has two tabs: Virtual Mat and Text and Fonts. The Virtual Mat tab allows you to set the size and visual appearance of the mat, as well as orientation, the appearance of shapes, snapping to grid, and Caret size. Refer to Section 3.04. The Text and Fonts tab allows you to select a font, open a new font, and type text. Refer to Section 5.02.




### **Layer Bar**

• The **Layer Bar** is one of the most important functions to understand in MTC. It is used to organize shapes into layers for visual display, easier manipulation, and selecting which shapes to print or cut. All shapes on a layer may be re-colored, hidden from view, locked, deleted, and moved up or down. Refer to *Section 3.12* for details on using the **Layer Bar**.




### Tab Bar

• In MTC, opened files are also called **Projects**. The **Tab Bar** shows all of the currently open projects. Under **Windows** on the **Menu Bar**, you can choose how to view opened projects, with similar display options found in other Windows programs (such as **Cascade**, **Tile Horizontal**, **Tile Vertical**, etc.).



• Right click on any **Project** name on the **Tab Bar** and a menu of options will appear. This screenshot indicates the user manual sections where this will again be referenced:

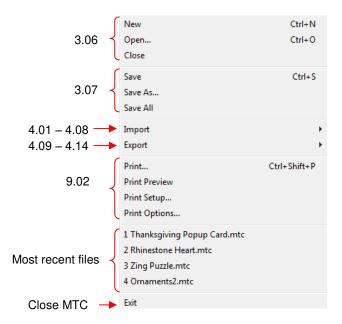


### Page Bar

• The **Page Bar** allows you to move shapes or layers to individual pages within the same project file. Each page will have its own tab and the pages can be renamed or deleted, as desired.



Right click on any Page name on the Page Bar and a menu of options will appear:

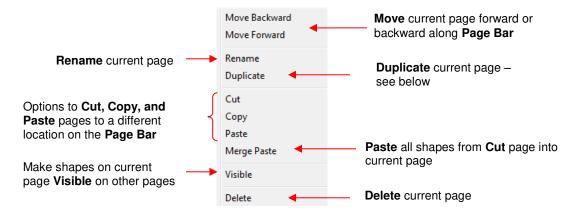


• When you select the **Duplicate** option, it will make a copy of the current page, giving it the same name with an asterisk added. The new duplicated page will be located to the immediate right of the original:



### **Status Bar**

- The **Status Bar,** at the bottom of the screen, provides different sets of information, depending on where your mouse cursor is positioned:
  - If you have your cursor on the main open part of the screen, the **Status Bar** shows the location of the mouse cursor, the location and size of the **Caret**, and which **Scroll Locks** are currently activated:



If you hover your mouse over one of the icons on a bar or toolbar or if you open one of the drop-down menus from the **Menu Bar**, the **Status Bar** typically provides additional information about the purpose of that icon or menu choice. For example, resting the mouse over the **Break** icon, causes the **Status Bar** to display the following:

Break apart a selected group of shapes to its basic elements


### 3.04 Virtual Mat

Virtual Mat Settings: Video


Creating a Custom Virtual Mat: Video




- The Virtual Mat serves as a design area for the software, as well as to indicate, in some cutting modes, where the shapes will be cut.
- To change the appearance of the mat, click on the Virtual Mat tab on the Main Bar:

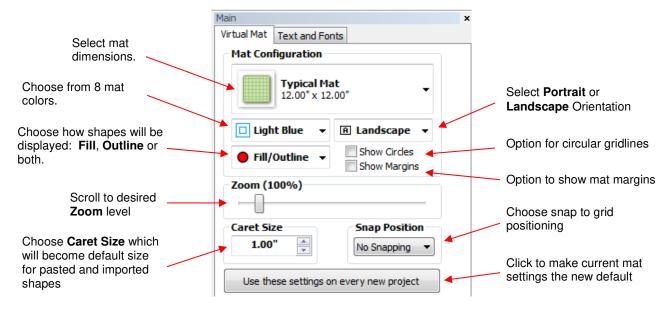

You also have the option to create your own custom mat sizes to add to the drop down list. Select Custom Mat from the drop down menu and the following window will open:

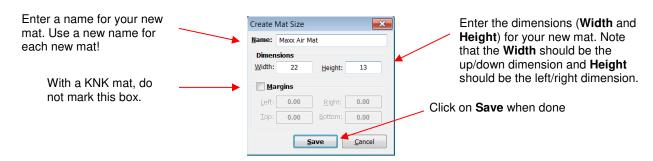

Important: Always set the longer dimension of your cutting mat as the Width. For example, in the above screenshot, a Width of 22" and a Height of 13" are entered and the mat configuration will look like the following, depending on whether you then set orientation to Portrait or Landscape:

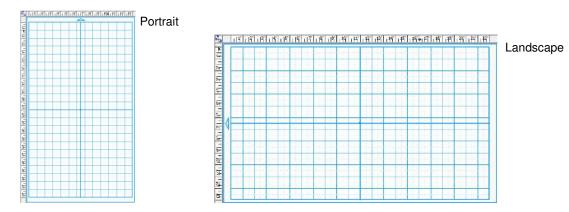

- Use a unique name for any custom mats you create. Repeating the same name, if you have the same dimensions, but a reversal of the W and H can cause the original mat to appear, even when selecting the newer version.
- If you wish to delete a custom mat from the drop-down menu, select it and then press the **Delete** key or just right click on the mat name and an option to delete will open. If you saved a file with a custom mat and then share the file with another MTC owner, your mat will be added to his/her drop-down menu in MTC.
- At the time of this writing, there is no metric option for the Virtual Mat or rulers. Here is a video link for a work-around solution: Video

### 3.05 Zooming and Panning

- Any of the following methods will allow you to zoom in and out in 10% increments from 20% to 1000%:
  - Hold down the Ctrl key while rolling the mouse wheel. The zoom will center on where the mouse cursor is currently located on the screen.
  - Scroll the Zoom setting on the Virtual Mat tab on the Main Bar
  - Press the + and buttons on the keyboard
  - Click on the **Zoom In** and **Zoom Out** buttons on the **File Toolbar**.



- Another way to zoom in and out is to use one of 4 shortcut keys (also available under View>Zoom To):
- 1 (or press the middle button on the mouse): Zoom to 100%  $\Diamond$ 
  - 2: Zoom to 20%
  - 3: Zoom to center of current-selected shapes using current zoom level
  - 4: Zoom to 300%
  - **5 0**: Zoom to 500%, 600%, etc. to 1000%
  - Ctrl+3 Zoom to Virtual Mat
  - Ctrl+4 Zoom to all shapes on screen
- To move the workspace up and down, roll the mouse wheel.
- To pan, press the **Spacebar** while dragging the left mouse button.

### 3.06 Opening MTC Files

### 3.06.1 Opening a New File/Project

- When you launch MTC, a new blank **Virtual Mat** will appear with a new blank project opened. At any time, another new project can be opened, in a new window, using any of the following:
  - ♦ Click the "+" icon on the **Tab** bar



- A Right click on a project tab on the **Tab Bar** and select **New** from the menu
- ♦ Click on the **New** icon on the **File** toolbar



- ♦ Press Ctrl+N
- Go to File>New.

### 3.06.2 Opening an Existing MTC File


- An existing file can be opened into MTC by using any of the following:
  - Olick on the Open icon on the File toolbar



- ♦ Right click on a project tab on the **Tab Bar** and select **Open** from the menu
- ♦ Press Ctrl+O
- ♦ Go to File>Open
- Double click an MTC file in Windows Explorer (refer to Section 3.06.3 for instructions on installing and using the MTC File Viewer)
- Double click an MTC file attached to an email
- Orag and drop an MTC file into a running instance of MTC
- ♦ Import from **MTC Gallery** (refer to *Section 4.02*).
- In all cases, a window will open where you can browse to locate the file you wish to open:



- There is also a **Basic Shapes** library available (Refer to *Section 3.08*). Plus other file formats (such as .svg, .eps, and .ai) may be imported into MTC. Refer to *Sections 4.01-4.08*.
- As you open new projects or existing files, the **Tab Bar** will show each project:



- Click on any of the tabs and that project window will be displayed. You can scroll/tab through the projects using any of the following:
  - ♦ Press Ctrl+F6
  - ♦ Press Ctrl-Tab
  - ♦ Go to Window>Next Window.
- All of the projects can be displayed at once, in separate windows, by choosing one of the various options under Window on the Menu Bar.

### 3.06.3 Previewing Thumbnails for Existing MTC Files

A downloadable application is available for viewing thumbnails of .mtc files in Windows Explorer or when
you go to File>Open within MTC. Note that it will only work with Windows Vista, 7, and 8:

#### Make The Cut! File Viewer

After downloading and installing the file, you will need to also clear your thumbnail cache in Windows. To do
this, click on the Windows Start button and then go to:

### All Programs>Accessories>System Tools>Disk Cleanup

(In Windows 8, go to Control Panel>Administrative Tools>Disk Cleanup)

The following window will appear, if you have more than one drive on your computer, and you'll want to
make sure it shows your c drive. Then click on OK:




• After several minutes, a new window will open. Scroll down in the menu of this window and make sure **Thumbnails** is checked and then click on **OK** at the bottom of the window:



- You will be asked if you wish to permanently delete these files. Click on Yes. After this is completed, you'll
  want to restart Windows.
- After Windows has resumed, open Windows Explorer and go to a folder which has MTC files. New thumbnails will now be created and it may take several minutes if you have hundreds of MTC files contained within that folder. A few features to note about these thumbnails:



 For files with multiple pages, you will be able to preview thumbnails of each page. First locate and click on the Show the Preview Pane icon to open the rightmost pane in Windows. Then use the Next Page and Previous Page buttons to navigate through the file:

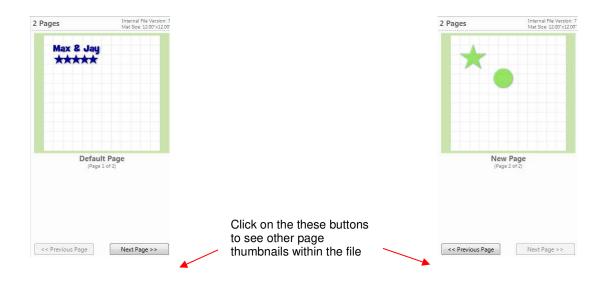

- Zipped files will not show thumbnails of the file contents. Thus, you will need to extract zipped files first in
  order to have these thumbnails.
- Hidden layers will not appear in the thumbnails. So, before saving your files, you may wish to make all layers visible. Refer to *Section 3.12*.

### 3.07 Saving MTC Files


- A file can be saved in MTC format by using any of the following:
  - ♦ Click on the Save icon on the File toolbar



- Right click on the project tab on the Tab bar and select Save or Save As from the menu
- ♦ Press Ctrl+S
- ♦ Go to File>Save or File>Save As.
- If you've made changes and wish to save under a different file name, choose File>Save As. Name the file, choose a location, and click on Save.
- If you wish to save all of your open projects, go to **File>Save All** or right click on a project tab on the **Tab Bar** and select **Save All** from the menu. The various windows in which you've made changes will then open, in sequence, with the option to save the changes or not or cancel the saving process for that file.
- You can also turn on an auto-saving option by going to Help>Advanced>Advanced Settings. The setting is located under Automatic Project Saving. Check the box next to Enable Automatic Saving.



• This is a very good idea when doing extensive designing or editing of files. It's not unusual for graphic programs to occasionally crash or the possibility of a sudden power outage to occur. Once you check the box, the following settings window will open:



To change the save settings, uncheck the Enable Automatic Saving box and then recheck the box so that
the Automatic Save Settings window will reopen and changes can then be made.


### 3.08 Opening Basic Shapes



- MTC has a rich selection of basic shapes available. To access the Basic Shapes library use one of the following:
  - ♦ Click on the Import Basic Shapes icon on the Import Toolbar or on the Node Mode Toolbar



- ♦ Press Ctrl+Shift+B
- ♦ Go to File>Import>From Basic Shapes
- You may then select one of the predefined categories and all shapes within that category will be displayed.
   Double click on a shape to import it directly onto the screen at the same height and same location as the Caret.

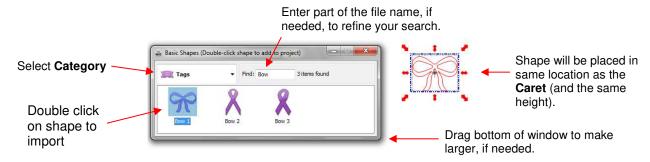


- Note that one of the categories, after you get it set up, is labeled "Your Shapes" which allows you to assign shapes to that category for quick access. If you have a shape that is repeatedly being used, then saving it to the **Basic Shapes** menu will save time in the future. Refer to Section 4.10.
- The **Basic Shapes** library can also be accessed from the **Node Mode** toolbar. Using this access, versus the ways described above, will allow you to drag your mouse freely to set the height and width of the shape, as well as flip it. Refer to *Section 7.07*.

#### 3.09 Selecting, Moving, and Deleting Shapes

### Selecting

• To select a shape, click anywhere within the bounding area or bounding box, which is indicated by the rectangle appearing around the shape:

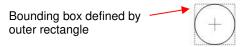

- There are several ways to select more than one shape:
  - Select the first shape and hold down the **Shift** key while clicking on additional shapes. Note that as your mouse moves over a shape, a red outline will appear. This makes it easier to select a shape which is overlapping other shapes. If you are having difficulty selecting a particular shape, you may need to hide other shapes around it. Refer to *Section 3.12*.
  - Hold down the left mouse button and drag your mouse to form an "imaginary box" around the images you want selected. Always make sure you start clearly outside the boundaries of the images you want to select. If part of the shape is outside the selection of that shape, it won't be selected. This method of selection is referred to as a marquee-select throughout this manual.
  - ♦ If all of the shapes are on the same layer, click on the thumbnail for that layer. Refer to Section 3.12.


- The **Caret** will disappear while you have a shape (or shapes) selected but will reappear in the upper right corner of the last selected shape, once unselected.
- If you wish to select all of the shapes on the screen, there are several options:
  - ♦ Press Ctrl+A
  - A Right click on the screen and choose **Select All** from the menu
  - Click on the **Select All** button on the **Magic Toolbar**.




- ♦ Go to Edit>Select All.
- To scroll through shapes, forward (or in reverse), use any of the following:
  - ♦ Right click on the screen and choose **Next Shape** (or choose **Previous Shape**)
  - ♦ Press Shift+Tab (or press Shift+Esc)
  - ♦ Go to Edit>Next Shape (or go to Edit>Previous Shape).
- To unselect all shapes, use one of the following two ways:
  - ♦ "Click away" click anywhere else on the screen and the shapes will be de-selected
  - ♦ Press the Esc key
  - ♦ Go to Edit>Select None.

### **Moving**

- To move a selected shape, hold down the left mouse button anywhere within the bounding area and drag to another location.
- You can also move a selected shape in small increments by pressing the arrow keys on the keyboard.
   Further, if you hold down the Ctrl key while pressing these arrows keys, the shape will move in larger increments with each keystroke.
- With a shape selected, the **Sel. Properties Bar** indicates the exact location of the top left corner of the bounding area of your shape under **X**: and **Y**: (Note that the 0,0 location is at the top left corner of the gridded part of the mat). You can enter values into either or both of the **X**: and **Y**: windows to move the shape to a new location.
  - X,Y location of top left corner of selected shape



You can also use the Rulers to identify where a shape is located, as well as the dimensions of the shape. In this case, small black arrows on the Rulers show the current location of the mouse cursor. Thus, if you want to know, for example, the center location of a shape, place your mouse on the center icon of the shape:

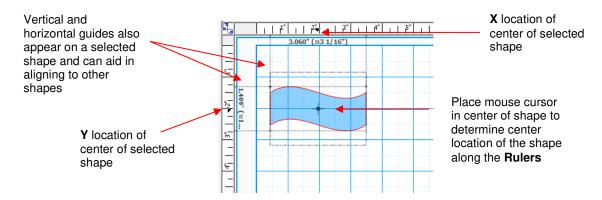

### **Deleting**


- To delete a selected shape, use any of the following options:
  - Press the **Delete** key
  - Press Ctrl-X
  - Right click on the screen and choose **Delete** from the menu
  - Go to **Edit>Delete**.
  - Located the shape on the layer to which it is assigned and click on the **Delete Shape** icon:



- To delete all of the shapes in the current project, use any of the following options:
  - Right click on the screen and choose **Delete All** from the menu
  - Press Shift+Delete
  - Go to Edit>Delete All.
- You can also delete a layer of shapes at one time from the Layer Bar. Refer to Section 3.12.
- To delete all of the tiny shapes not wanted in your project, use any of the following to access the **Delete by** Area option:
  - Right click on the screen and choose Delete By Area from the menu
  - Press Ctrl-Shift-R
  - Go to Edit>Delete by Area.
- The **Delete by Area** window allows you to select the size, by area, of objects you wish to delete from the project. As you scroll to increase the size, you will see the shapes begin to disappear from the project.

When the desired shapes are removed, click on Apply:





### 3.10 Cutting, Copying, Pasting, Duplicating

### 3.10.1 Cutting to the Clipboard

- To cut shapes to the clipboard, first select the shape or shapes and then use any of the following:
  - Click on the Cut to Clipboard icon located on the File Toolbar



- Right click on the screen and select Cut
- $\Diamond$ Press Ctrl+X
- Go to Edit>Cut.

### 3.10.2 Copying Shapes and Copying to the Clipboard



- A quick way to make a copy of any selected shape(s), is to hold both the **Ctrl** and the **Shift** keys and then drag the selected shape(s) with your mouse.
- To copy shapes to the clipboard, first select the shape or shapes and then use any of the following:
  - ♦ Click on the Copy to Clipboard icon located on the File Toolbar



- ♦ Right click on the screen and select Copy
- ♦ Press Ctrl+C
- ♦ Go to Edit>Copy.
- To make multiple copies, refer to the **Duplicate** function described later in this section.

### 3.10.3 Pasting from the Clipboard

- The **Paste from Clipboard** function in MTC works a little differently from most Windows programs. When you select **Paste**, the shape on the clipboard will be placed at the **Caret**'s location and sized the same, in height, as the **Caret**. If **Paste in Place** is used instead, then the pasted shape will be the same size as the original and placed in the location of the original (at the time the **Copy** was applied).
- To **Paste** shapes from the clipboard, use any of the following:




- ♦ Click on the **Paste from Clipboard** icon located on the **File Toolbar**
- ♦ Right click on the screen and select Paste
- ♦ Press Ctrl+V
- ♦ Go to Edit>Paste.
- To Paste in Place shapes from the clipboard, use any of the following:



- ♦ Click on the **Paste in Place** icon located on the **File Toolbar**
- A Right click on the screen and select Paste in Place
- ♦ Press Ctrl+Shift+V
- ♦ Go to Edit>Paste in Place.
- Note that once you press **Paste in Paste**, you'll see a darkening of the original image (if you haven't moved the original image since invoking the **Copy**).

### 3.10.4 Duplicating - Duplicate

- The **Duplicate** function allows you to make multiple copies of a shape aligned in rows and/or columns, with the spacing you desire. To access **Duplicate**, first select the shape(s) and then use any of the following:
  - ♦ Right click on the screen and select **Duplicate>Duplicate**
  - ♦ Press Ctrl+D
  - ♦ Go to Edit>Duplicate>Duplicate.
- To fill your grid with images, move the selected shape(s) to the top left corner of the gridded part of the Virtual Mat. With the shape(s) still selected, use Ctrl-D (or other options above) to open the Duplicate Shape window. Enter the totals desired in each Row and in each Column, plus the Spacing. Click on OK to accept.

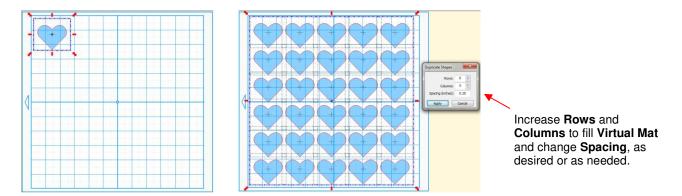


• To create a single row of repeats, set the **Rows** value to 1. For a single column of repeats, set the **Columns** value to 1. To overlap the repeats, enter a negative number under **Spacing**. Refer to *Section* 8.06 for a tutorial on how this function can be used to create a border.

### 3.10.5 Duplicating - Nested Duplicate


- The **Nested Duplicate** function allows you to make multiple outlines or inlines, with the spacing you desire. To access **Nested Duplicate**, first select the shape(s) and then use either of the following:
  - ♦ Right click on the screen and select **Duplicate>Nested Duplicate**
  - ♦ Go to Edit>Duplicate>Nested Duplicate.

### **Outlines and Inlines**


• In the first example, a scalloped circle is selected and the **Nested Duplicate** function accessed. The following window opens with defaults settings shown: and settings are made to create 4 outset repeats of the scalloped circle, each 1 mm apart:

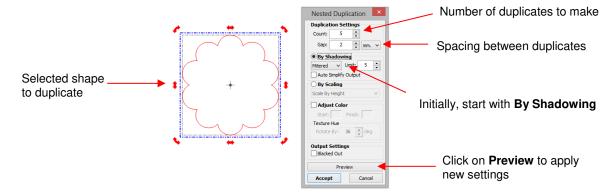

• It is desired to have a total of 6 nested shapes, so 5 is entered as the **Dupe Count** (duplicates to be added). The spacing is changed to 2 mm and the **Shadow Setting** set to **Mitered.** Before accepting, click on the **Preview** button to see the duplicates:

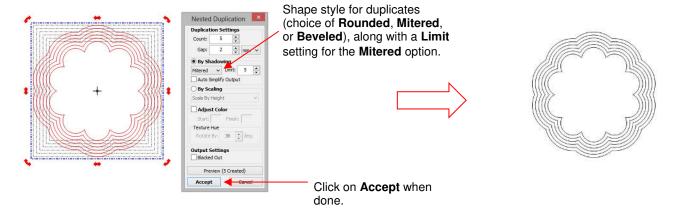

• In order to create in-lines, instead of outlines, enter a negative number for **Dupe Gap**:

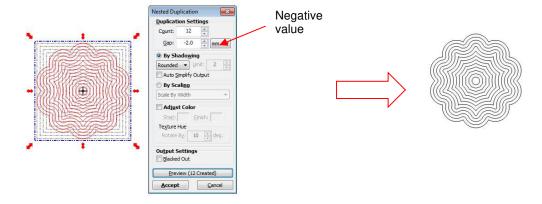


#### Shadowing Versus Scaling

- There are three options for how shapes can be duplicated in **Nested Duplicate**:
  - Shadowing: duplicate paths will always be the same distance from the prior duplicate and may need to change shape in order to do so. This is evident in the prior example with the flower where both the outlines and the inlines changed shaped the further they were duplicated from the original. This is not the case with basic shapes, such as circles or polygons:



Scaling by Width: duplicate paths stay scaled to the original and the width will be changed according to the gap selected. The resulting height may result in a different gap from one duplicate to the next. The flower again demonstrates the difference quite clearly. A circle will not be any different. However, notice how the rectangle responds in order to keep the same aspect ratio between the height and the width:








Scaling by Height: is basically the same as Scaling by Width. Again, the circle is no different and the flower, being symmetrical doesn't vary from the Scaling by Width option. But the rectangle is quite different:



### **Adjust Color**

 There's also the option to create a color gradient using the Adjust Color option. On the Virtual Mat, turn on Fill and then enter a Start and Finish color to create something like this:

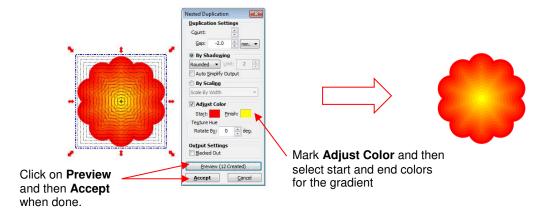

• The **Texture Hue** setting can be used to apply a color gradient on nested duplicates containing a texture. Refer to *Section 8.13* for an example.


### 3.10.6 Duplicating - Rotated Duplicate

# Wideo


- The **Rotated Duplicate** function allows you to make duplicates arranged in a circle or partial circle pattern. To access **Rotated Duplicate**, first select the shape(s) and then use either of the following:
  - ♦ Right click on the screen and select **Duplicate>Rotated Duplicate**
  - ♦ Go to Edit>Duplicate>Rotated Duplicate.
- To illustrate how this works, start with a small circle from **Basic Shapes**. Select it and then activate the **Rotated Duplicate** function using either of the methods just mentioned. The following window opens:




• To create a semicircle of, for example, 10 shapes increase the **Dupe Count** to 9. Then click on the small sigma icon which will then change the setting inside the **Rotate By** window so that a perfect semicircular pattern of equally-spaced shapes is created:

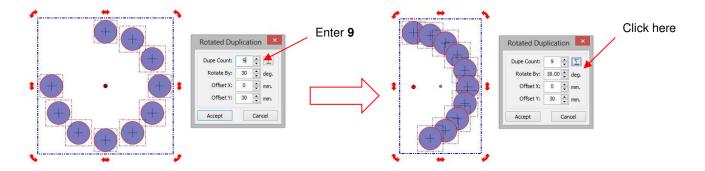

• If you want the shapes in a full circle, double the **Rotate By** setting. In this case, you would enter 36 deg (2 x 18). If you then want to overlap the circles, decrease the **Offset Y** to located them closer to the center:

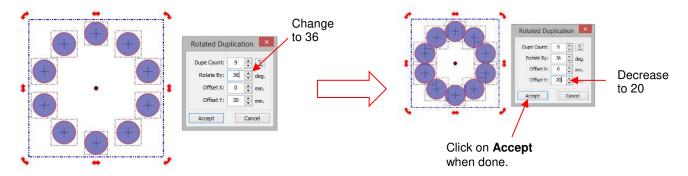

• The **Offset X** value will move each shape that distance in the X direction. Note how an increasing value of X affects the arrow shape in this duplication:

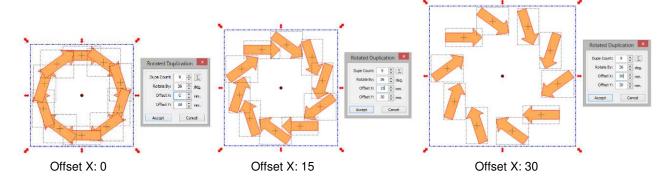

• The designing possibilities are unlimited with this magnificent feature! Be sure to watch the video linked at the beginning of this section.

### 3.11 Undo/Redo

### <u>Undo</u>

- As with most Windows applications, there is an **Undo** function to reverse the most recent steps performed.
   You can use any of the following to execute the **Undo** function:
  - ♦ Click on the **Undo** icon on the **File Toolbar**



- ♦ Press Ctrl-Z
- ♦ Go to Edit>Undo.
- If you are experiencing software crashes due to memory limitations, two solutions are available:

- ♦ Go to Edit>Clear Undo History.
- ♦ Limit the number of **Undo/Redo** steps stored in memory. To do this:
  - Go to Help>Advanced>Advanced Settings. Under Undo/Redo Buffer Size, check the box next to Limit Undo/Redo Size:



> Upon checking this box, the following window will open:



- > Enter the maximum number of steps to be saved. You will then need to save any current files and close/reopen them for the change to take effect.
- If you wish to change this setting, you will need to uncheck the **Limit Undo/Redo Size** box and then check it again to bring up the settings window.

### Redo

- As with most Windows applications, there is also a **Redo** function in case you **Undo** too many steps or simply change your mind. You can use any of the following to execute the **Redo** function:
  - Olick on the Redo icon on the File Toolbar




- ♦ Press Ctrl-Y
- ♦ Go to Edit>Redo.

#### 3.12 Layer Bar

Part 1: Video Part 2: Video Part 3: Video

- The Layer Bar (or Layer Properties Bar) is used to assign or group shapes into separate layers to better organize your file, more easily apply changes to a group of shapes, select one shape or a layer of shapes on the screen, and to control what is sent to the cutter or printer. This bar can be turned on and off under View on the Menu Bar. Most likely, you will want to have this bar showing at all times.
- You do not have to worry about adding shapes to the Layer Bar. They will be automatically assigned to the
  current layer or a new layer as you add them. You will want to learn how to move shapes to new layers or
  combine shapes into the same layer, depending on the circumstances.
- Here are a few examples of when you would want to have shapes on different layers:
  - Paper piecing or shadowed shape projects where some shapes will be cut from one color and other shapes from another color (or a number of other colors).
  - Fold-up projects (boxes, envelopes, popup cards, etc.) where the fold lines will need to have different settings and/or different tools used than your cut lines.
  - Print and cut projects where you may need to send certain layers to be printed but other layers to be cut.
  - Ahinestone template projects where you need to cut two different templates, such as a fill that will be done in one color of rhinestones and an outline in another color.
- Other benefits of assigning shapes to layers include:


- Ability to select, with one click of the mouse, all shapes assigned to a layer without selecting other shapes
- Ability to hide or lock layers so that the shapes on that layer are not inadvertently selected, moved, resized, etc.
- Ability to change the color, line style, and/or texture on all of the shapes assigned to a particular layer.
- The following screenshot will be used to show how the Layers bar functions can be applied:

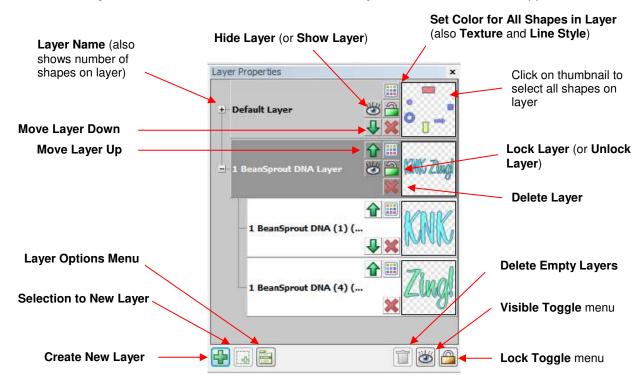


- On the right side of the **Layer Bar**, each layer has a preview or thumbnail showing the shapes assigned to that layer. Click on that thumbnail and all shapes on that layer will be selected. If you wish to add the shapes from another layer, hold the **Shift** key and click on the other thumbnail.
- To the left of each **Layer Name**, there is a small "+" sign. Click on it and the "+" will turn to a "-" and that layer will open to reveal each individual shape assigned to that layer.
- Double click a layer name and you can change the name of that layer. Rest your mouse cursor over a layer name and the number of shapes in that layer will appear.
- Hide and unhide layers by clicking on the eye icons (Hide Layer and Show Layer ). A hidden layer will display the shapes in pale versions of their actual colors and will also prevent any movement or resizing, etc. of those shapes. Also, any shapes that are hidden will not be sent to your cutter or to your printer.
- Change the order of layers using the arrow icons (**Move Layer Down** and **Move Layer Up** ). Shapes assigned to a higher layer will appear to be on top of the shapes assigned to a lower layer. This is a useful feature for displaying how a paper piecing project will look when completed.
- Lock and unlock layers by clicking on the lock icon (**Lock Layer** and **Unlock Layer**). A locked layer prevents the shapes in that layer from inadvertently being moved or resized. It also allows the shape to be displayed without an outer bounding box.
- Change the **Color**, **Texture**, and/or **Line Style** for all shapes assigned to a particular layer by clicking on the color palette icon (**Set Color for All Shapes** ).



- Delete a layer (and all shapes assigned to that particular layer) by clicking on the **Delete Layer** icon.
- Individual shapes are also assigned to their own layers within a layer. Notice below how the words "KNK" and "Zing" are individual layers within the **Default Layer** which displays both words together. Some of the same functions used for layers are available to be applied to the individual shapes within a layer.

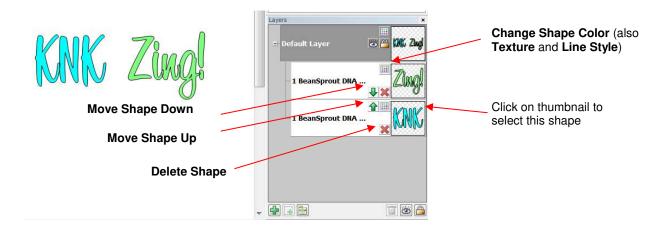


- When starting a new project, shapes will automatically be assigned to a **Default** layer. To move a shape to a new layer, select it and then click on the **Selection to New Layer** icon.
- Any new shapes that are created will automatically be assigned to the currently selected layer (with the exception of a few situations). To create a new empty layer, click on the **Create New Layer** icon.
- When adding text, a new layer will be created and the name of the layer will be the font used for that text (as shown above where the font used for *KNK Zing* is called 1 Bean Sprout DNA).
- To completely remove a layer from being displayed, but at the same time not delete the layer, move the layer to its own page, using the **Layer Options Menu** at the bottom of the **Layer Bar**.
- Click on the Delete Empty Layers icon to delete any layers that contain no shapes.
- Click on the Visible Toggle menu to offer options to Show All layers, Hide All layers or Toggle Visible which will reverse the current hide/show status of all layers (i.e. hide layers currently visible and unhide layers that are currently not visible).
- Click on the Lock Toggle menu to offer options to Lock All layers, Unlock All layers or Toggle Lock which reverses the current lock/unlock status of all layers (i.e. unlock layers currently locked and lock layers that are currently unlocked).
- Right click on a **Layer Name** or right click on the layer's thumbnail (or select the layer and then click on the **Layer Options Menu** icon and the following menu will open:

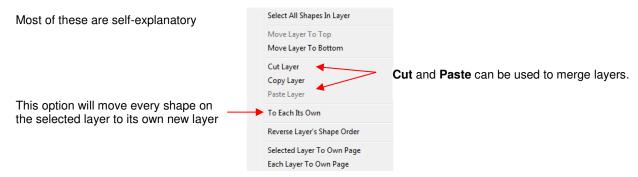

 To merge two layers, click on the thumbnail for one of the layers. Hold the Shift key and click on the thumbnail for the other layer, adding those shapes to the selection. Then immediately click on the Selection to New Layer icon. This will create a new layer containing all of the shapes from those two layers.

### 3.13 Resizing, Rotating, Slanting, and Warping


- The **Resizing**, **Rotating**, **Slanting** and **Warping** functions are presented together because all four can be readily applied to any selected shape.
- When you first select a shape, you will notice that the bounding box has double headed arrows at the four corners and in the center along each of the four sides. A double click inside the bounding area of the shape will change those icons to other choices, resulting in three different modes:

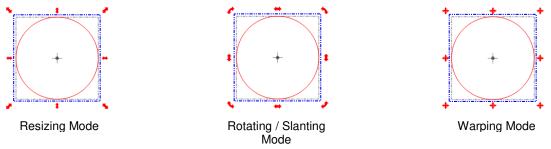


#### 3.13.1 Resizing



- With the shape selected, use your mouse to drag any corner of the shape to resize proportionately.
   Dragging the double-sided arrow on one of the four sides will allow you to resize either vertically or horizontally while leaving the other dimension constant.
- Depending on the current setting for **Snap Position** on the **Virtual Mat**, the resizing will occur in increments matching that setting. To freely resize the shape, change **Snap Position** to **No Snapping**.
- If you wish to release the aspect ratio while dragging a corner, press the **Ctrl** key while dragging. This allows the height or width of the shape to be freely changed without changing the other dimension.
- If you need to make the shape an exact size, then enter the dimension in the W or H box in the Sel.
   Properties Bar. The lock icon can be toggled depending on whether or not you want to hold the aspect ratio constant:




Dimensions can also be entered in mm or cm as long as those units are entered along with the value:



- At this time, it is not possible to display these settings in metric. If you need to know the W and H of a particular shape in either cm or mm, please refer to Section 7.08.
- Percentages can also be used in the dimension settings. For example, if you want to double the size of a shape, you can enter 200%:



- Percentages can also be entered with an "R" added to calculate the reciprocal. For example, entering "200%R" will result in the size being halved. Entering 300%R will make the resulting size 1/3, etc.
- Fractions may also be entered with a space between the number and the fraction. For example, 6.5 could be entered as 6 ½:




• In versions of MTC prior to 4.5.2, resizing a textured shape requires holding the **Shift** key while dragging a corner. This will resize the texture as well as the shape.


### 3.13.2 Rotating and Slanting



• With the shape selected, dragging any of the four corners will allow free rotation of the shape. The shape will be temporarily locked at its center and will rotate around that center. As you rotate, the angle of rotation appears at the bottom of the screen:




- If you hold the **Shift** key while dragging one of the four corners, the shape will be pinned in the diagonally opposite corner and will rotate around that corner. If you hold the **Ctrl** key while dragging one of the four corners, the shape will rotate in 15° increments. **Ctrl+Shift+Rotate** will rotate around the opposite corner in 15° increments.
- If you need to rotate in increments other than 15°, go to Help>Advanced>Advanced Settings and change the default to the desired increment (from 1 to 180°):



- A selected shape can also be rotated exactly 90° clockwise, by using any of the following:
  - ♦ Click on the Rotate 90° Clockwise icon on the Magic Toolbar



- ♦ Press Ctrl+G
- ♦ Go to Edit>Shape Magic>Rotate 90°.
- If you drag one of the double headed arrows along a side, versus a corner, you can slant the shape instead of rotating it:

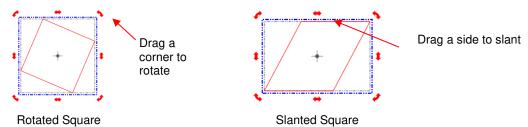

Note that if you are using an earlier version of MTC, then refer to these two videos:

Rotating raster images in MTC 4.2 or earlier:






### **3.13.3 Warping**

• In the warping mode, shapes can be transformed dramatically by dragging the "+" handles at the corners. Dragging along the sides results in the same effects as slanting above, but can be combined with the dragging of corners to create many different variations on the original shape:



Holding the Shift key or the Ctrl Key while dragging a corner allows the warping to extend even further!



Note: throughout this user manual, screen shots of shapes will sometimes appear without the gridlines of
the virtual mat in the background and without the bounding boxes around the shape(s). This was done to
make the images appear clearer and less cluttered.

### 3.14 Changing Color, Texture, and Line Style


- There are three ways to access the functions for changing the **Color**, **Texture** or **Line Style** of a selected shape:
  - ♦ Right click on the screen and select **Change Color/Texture/Line**
  - On the Layer Bar, open the layer, locate the shape, and click on the Change Shape Color icon



Press Ctrl+Shift+U (Color), Ctrl-Shift+O (Texture), Ctrl+Shift+Y (Line Style)

#### **Changing Color**


• In the Color window, you can click on any of the Basic colors or create a custom color.

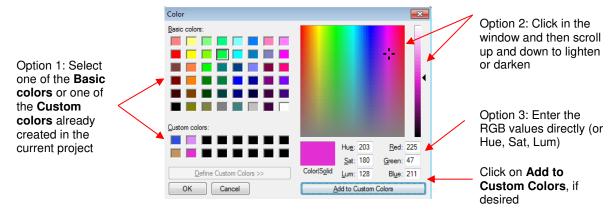


Note that a new Custom Color will only be saved and available in the current project.

#### **Changing Texture**

• Instead of using a solid color, you can also fill shapes with textures, which are typically raster files, such as .bmp, .jpg, .png, imported into MTC. When you access the **Change Texture** function, the window which opens will depend on whether or not you already have a texture available from another shape in your project. If you do not, then when you go to **Change Texture**, the **Open Image for Texturizing** window will open and you can browse your computer to open a texture file, scan one into MTC, or paste one from Windows Clipboard:

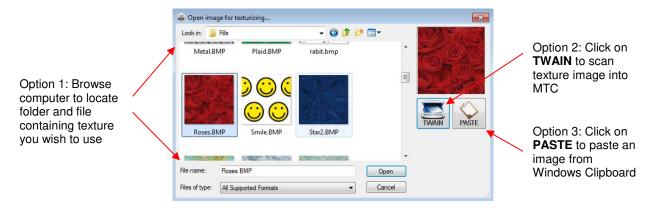


- After importing this first texture, or if there was already a texture open in your current project, then the **Choose Texture** window opens. In this window, you have options to:
  - ♦ Tile the **Texture** (fill a shape with a modified version of the texture)
  - Vertically or horizontally flip the texture
  - Offset or move the texture within the shape
  - Adjust the color and brightness of the texture
  - Resize the texture with or without resizing the shape

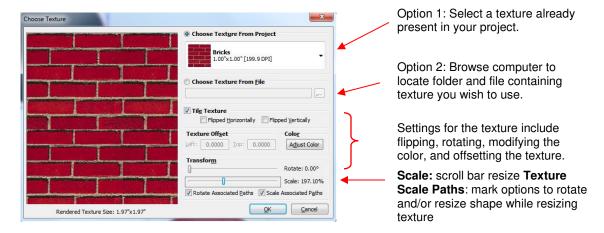


After clicking on OK, your selected shape will fill with the texture chosen. Here are two examples:



• These are two examples where the shape was filled without scaling down the texture. In this next example, the text "PENGUIN" was created and then the texture imported is the following penguin image:

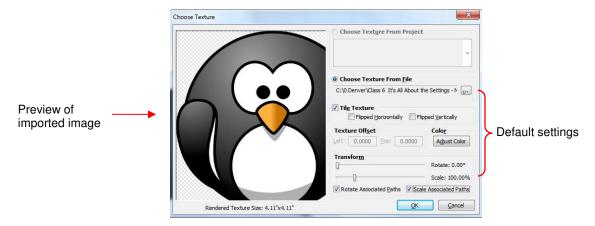

• To create a repeating pattern of the penguin, at a much smaller size and with other customizations, the following changes are made in the **Change Textures** window:

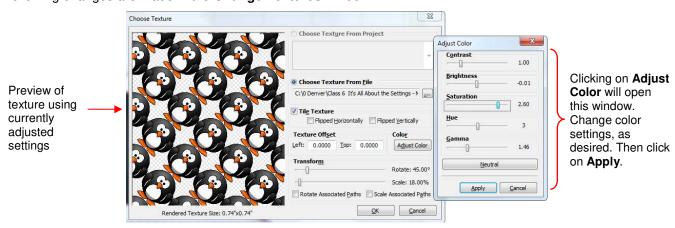

Check **Tile Texture** box, adjust **Rotate** to 45 degrees and **Scale** to 18%, and then click **Adjust Color**.

• After clicking on **OK**, the shape fills with the new customized texture:



#### Removing a Texture

 If you wish to delete the texture from a shape, right click on the shape and select Change Color/Texture/Line and then select Remove Textures.

#### **Changing Line Style**



The Choose Line Style window allows you to create dashed lines instead of solid lines, as needed. Similar
to Choose Texture, the Choose Line Style provides the option to create a new style or you can pick a
Line Style already in use in your current project:




After clicking on OK, your selected shape will appear with the line style you have chosen. Here are two
examples:



#### 3.15 Other Shape Manipulations

#### **Alignment**

- There are eleven functions used to align shapes with one another. After selecting two or more shapes, these functions can be accessed using any of the following:
  - ♦ Right click on the screen and select Align and Space>Align>
  - ♦ Go to Edit>Align and Space>Align>.
- For some of the functions there are shortcut keys and these are indicated in the detailed subsections below.
- The following three shapes, in their current relative positions, will be used to illustrate what happens when each alignment function is applied:

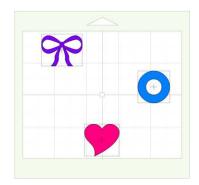

#### **Center Alignment**


- There are three different centering functions. Again, with the shapes selected, right click and go to Align and Space>Align>:
  - ♦ **Vertical Center** (press **V**) aligns shapes vertically and positioned to the average vertical center of the group.
  - ♦ Horizontal Center (press H) aligns shapes horizontally and positioned to the average horizontal center of the group.
  - ♦ Stack (press S) aligns shapes to be horizontally and vertically centered with one another.








Horizontal Center (H)

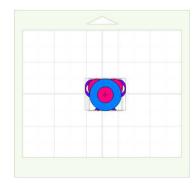


Stack (S)


#### **Outer Alignment**

- There are four different alignment functions used to align shapes to the outside edges. Again, with the shapes selected, right click and go to Align and Space>Align>:
  - A Right (press R) aligns shapes along their right sides and positioned to the rightmost shape of the group.
  - ♦ **Left** (press **L**) aligns shapes along their left sides and positioned to the leftmost shape of the group.
  - ♦ **Top** (press **T**) aligns shapes along their top sides and positioned to the uppermost shape of the group.
  - ♦ Bottom (press B) aligns shapes along their bottom sides and positioned to the lowermost shape of the group.

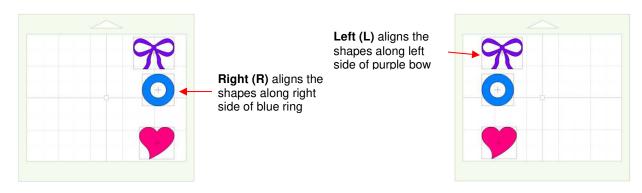

**Top (T)** aligns the shapes along top edge of purple bow

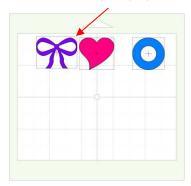


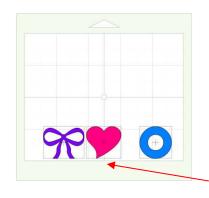


**Bottom (B)** aligns the shapes along bottom edge of pink heart

## **Edge Alignment**


- There are four additional alignment functions used to align shapes in a slightly different way. Again, with the shapes selected, right click and go to **Align and Space>Align>**:
  - ♦ **Edge Left** aligns shapes along the left edge of the rightmost shape of the group.
  - Edge Right aligns shapes along their right side of the leftmost shape of the group.
  - ♦ Edge Top aligns shapes along their bottom edge of the uppermost shape of the group.
  - ♦ **Edge Bottom** aligns shapes along their top edge of the lowermost shape of the group.

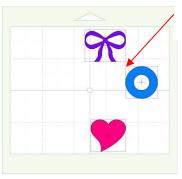

**Edge Left** aligns the shapes along left edge of blue ring

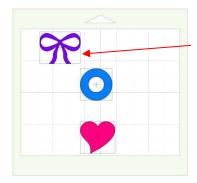


**Edge Right** aligns the shapes along right edge of purple bow

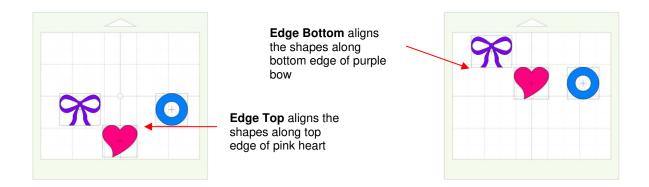

#### **Spacing**

- There are two alignment functions used to equally space shapes, either horizontally or vertically. After selecting three or more shapes, these functions can be accessed using any of the following:
  - Right click on the screen and select Align and Space>Space>Vertical (or Horizontal)
  - Press [ or ] (see below)
  - Go to Edit>Align and Space>Space>Vertical (or Horizontal).
- **Vertically** (press [) equally spaces shapes between the uppermost and bottommost shapes in the selection.
- Horizontally (press ]) equally spaces shapes between the leftmost and the rightmost shapes in the selection.
- Another way to increase or decrease the spacing between a selected group of shapes, is to hold the Ctrl key and drag the middle:



This same method can be used for vertical spacing, as well. The shapes also do not need to be the same. You could equally space, for example, a star, a letter "B", and a straight line.

### Mirroring and Flipping

- To horizontally mirror a shape, select it and then use one of the following:
  - Click on the Mirror icon on the Magic Toolbar



- Right click on the screen and select Shape Magic>Mirror
- $\Diamond$ Press Ctrl+M
- Go to Edit>Shape Magic>Mirror.



To vertically flip a shape, select it and then use one of the following:

Right click on the screen and select Shape Magic>Flip

- Click on the Flip icon on the Magic Toolbar

- ♦ Press Ctrl+F
- ♦ Go to Edit>Shape Magic>Flip.




## 4. Importing and Exporting

#### 4.01 Accessing the Import Options

 Go to File>Import and select from one of the available import options. Note the shortcut keys for the various file types:



 Alternatively, click on the appropriate icon on the Import Bar. Note the sections of the user manual included with each label:

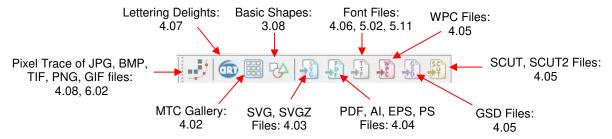


 Alternatively, right click on the project tab on the Tab Bar and select Import from the menu. This is the same as going to File>Import.


#### 4.02 Importing from the Online MTC Gallery



 The MTC Gallery can be accessed using the three methods shown above or by going to Help>Free SVG's and MTC's. When selected, the following window opens and you can choose from thousands of freely shared files from other MTC owners:

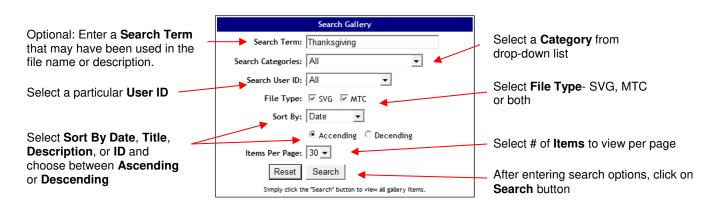


• Upon clicking on **Search**, thumbnails of the images identified in the search will appear:

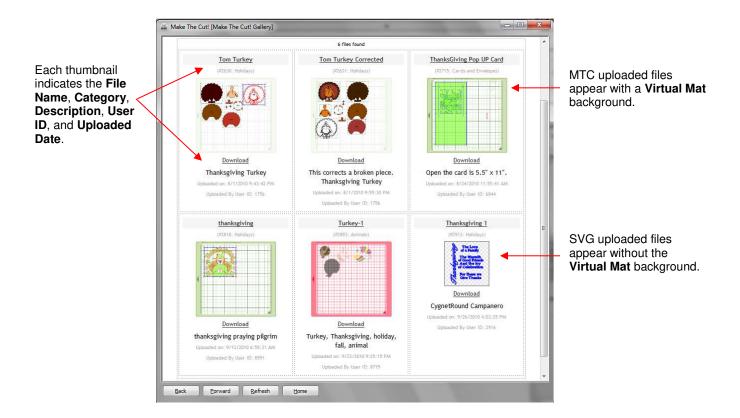

• Click on the thumbnail image and a larger preview window will open. Click on **Download** and the file will immediately import at the current location of the **Caret**. You can then resize, cut, edit, save, etc., as needed.

#### 4.03 Importing SVG, SVGZ from Your Computer


If the selected file format is SVG or SVGZ, then importing the graphic will bring the shape into MTC to be
resized, edited, cut, etc. Similar to opening files, a window will pop open, allowing you to browse your
computer to locate a subfolder and select the file you wish to import. With SVG you can click on Large
Preview to open a window displaying a much larger view than the thumbnail preview:

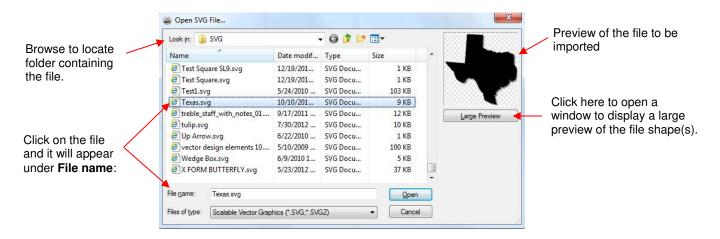


- Different programs use different DPI's when exporting as SVG. While MTC will import the SVG at the DPI most commonly used, it is possible that an imported size will be different from the original (such as what happens with SVG's created in KNK Studio). So, always check the size to see if it is appropriate for your needs before cutting.
- If you import an SVG which is a print and cut file and the cut lines are not appearing, apply the **Join** function, followed by the **Layer** function (refer to *Section 7.01*). A new layer will be created with the cutlines around the raster. The original layer can be deleted.
- You can also import SVG files using drag and drop into a running instance of MTC.

#### 4.04 Importing AI, EPS, PS, PDF

• If the selected file format is one of the following vector formats: **AI, EPS, PS, PDF** (vector only), then importing the graphic works the same as opening MTC files or importing SVG files. There are a few different import options:

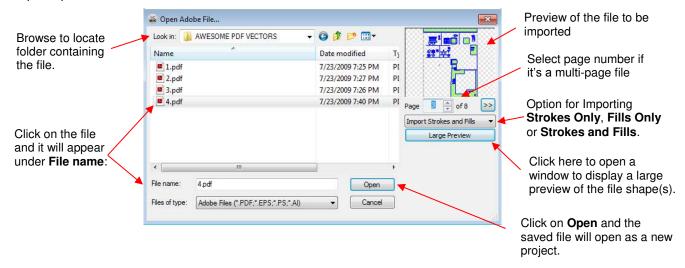


- Note that when the file has multiple pages (such as some PDF vector files), the user should choose which
  page to import. Click on Large Preview to better see the individual shapes or use Adobe Reader to view the
  pages in the same way you would view any PDF file.
- MTC will only import Al files that are Version 9 or newer. Thus, if an Al fails to import, that is the most likely issue. From some programs, such as Funtime, it will be necessary to save in a different format, such as PDF or EPS.
- A PDF created from a raster image will not import into MTC. In the preview window will be a message saying "Nothing to Preview" and a message in blue type will appear at the bottom of the window. This message will give you the option to access the Pixel Trace window so that that image can be vectorized first. Refer to Chapter 6.

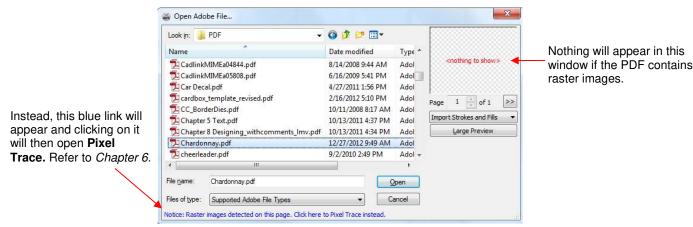

• There is also an **Import Strokes and Fills** menu with three options to **Import Strokes Only, Import Fills**Only or **Import Strokes and Fills**. Select the latter and then note if you have unwanted lines in your image. If so, then try one of the other choices, such as **Import Strokes Only**.

#### 4.05 Importing SCUT, SCUT2, WPC, GSD

- Files created in Sure Cuts a Lot (SCAL) are saved in the format SCUT or SCUT2, depending on the version
  of SCAL used. Files with the WPC file extension are created in programs developed by Sign Max, which
  include WinPC Sign, Funtime, Pazzles Inspiration, and Gazelle. GSD files are created in RoboMaster,
  RoboMaster Pro and Wishblade Advance. These formats are all imported using the same methods as
  described for SVG. There are no special settings. Just locate the file on your computer, select it, and click
  on Open.
- The GSD format does not have an available preview. Also, the **Fuse N Weld** option is available, in the import window, to connect the many individual segments making up paths in these files and it is recommended that the box remains checked. The scroll bar next to this setting allows you to set the minimum distance between two nodes in order for them to be connected upon importing.

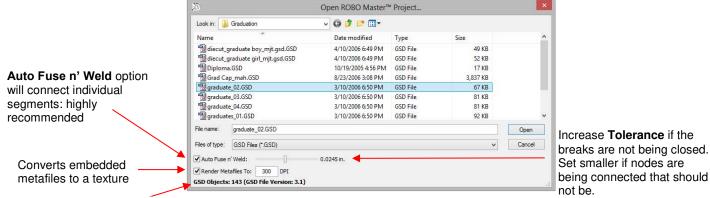

Indicates how many paths are found. Note that with **Auto Fuse n' Weld** turned on, the imported graphic, in this example, ended up with 7 paths instead of 143.


- It is recommended that both the Auto Fuse n' Weld and Render Metafiles To 300 DPI be left turned on.
  The Fuse N Weld option is needed to connect the many individual segments making up paths in GSD files.
  The Render Metafiles function is use to identify embedded wmf and emf files used for print and cut applications and convert those to textures.
- Before saving an imported GSD file, run the Auto Simplify Path to reduce nodes. Refer to Section 7.02.2.

#### 4.06 Importing TTF, OTF Font Files

• If the imported file format is **TTF**, **OTF**, or **OPF** then the font file will be added to the installed fonts list and be available for creating text shapes. The font does not need to be installed first in Windows, nor does it need to be re-opened in MTC after the file is saved and opened again on the current user's computer or any other computer. More details on importing font files are covered in *Section 5.02*.

#### 4.07 Importing from Lettering Delights


- If the **Lettering Delights** option is chosen, then the **Lettering Delights** window will open at the left side of the screen.
- You may log into the following web site: <a href="http://www.letteringdelights.com/">http://www.letteringdelights.com/</a> and purchase new cutting files or load existing cutting files from your account.

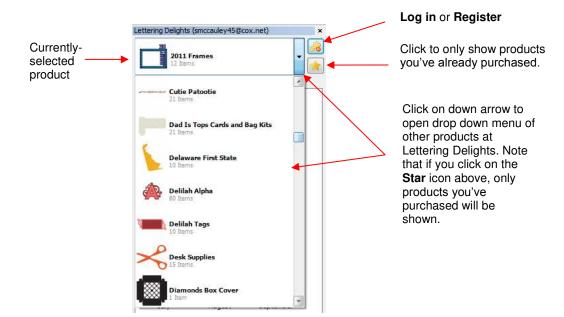

• The Lettering Delights cutting files you own will be displayed in alphabetical order by Collection Name. If you wish to change the sorting order to Sort by Date Added, go to Help>Advanced>Advanced Settings, and select the other option under Sort Lettering Delights:



- When working with Sort by Collection Name, if you know the name of a particular LD product, you can
  type the first letter and you will be taken to the products which begin with that letter. This allows you to more
  quickly scroll through the products.
- Once you have selected a Lettering Delights product, double click on any image and a window will open
  where you can choose to go to the Lettering Delights' web site to purchase this particular product. The
  shapes in that product package will then be available to download directly into MTC in the future, when you
  log into your account.
- The following example shows a collection of clipart called "Arizona Grand Canyon State" that has been found at the Lettering Delights site, but has not yet been purchased. You can see the images contained in this collection and, upon double clicking any of the images, a window will open:

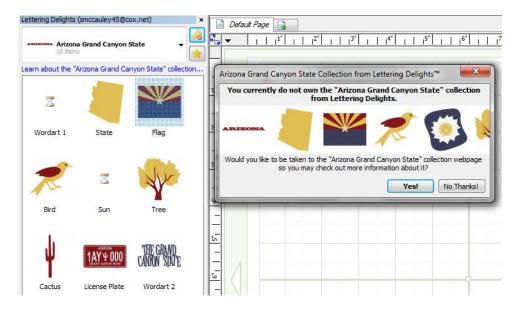

If you answer Yes, your Internet browser will open and you will be taken to this link:
 <a href="http://www.letteringdelights.com/clipart:arizona\_grand\_canyon\_state-10057.html">http://www.letteringdelights.com/clipart:arizona\_grand\_canyon\_state-10057.html</a> where you can again view the images in this collection, browse projects made with this collection, link to related collections, and, of course, purchase this collection.

#### 4.08 Importing Raster Files (JPG, BMP, PNG, etc.)

- If the selected file format is a raster (e.g., JPG, BMP, TIF, PNG, or GIF), then the **Pixel Trace** option is used to import the graphic and vectorize selected portions or all of the shape. Refer to *Chapter 6 Tracing*.
- Raster images may also be copied and pasted into the **Pixel Trace** window directly from Windows Explorer.
- If the raster file is only going to be used to fill a shape with the image (also referred to as adding a **Texture**), then refer to Section 3.14.

#### 4.09 Accessing the Export Options


- One can export a selected shape or group of shapes in any of the following ways:
  - ♦ Go to File>Export and select from one of the available export options
  - ♦ Right click on the screen and select Export
  - A Right click on the project tab on the **Tab Bar** and select **Export** from the menu. This is the same as going to **File>Export**.
  - Use any one of three shortcut keys to bring up the available **Export** choices. Refer to the following screenshot.



#### 4.10 Exporting to Basic Shapes



 When exporting a file to the Basic Shapes library, a popup window will appear asking for the file to be named. Enter a descriptive name for the shape and then click on Add. That shape will be added to the category – "Your Shapes".




As you build "Your Shapes" library, you may want to back it up in the event you have a hard drive crash or
if you want to load "Your Shapes" to other computers you own. To access this function, go to
Help>Advanced>Advanced Settings. Under Backup/Restore Shapes, you will find the options to either
Backup or Restore.



Clicking on Backup will bring up a Save As window where you can browse your computer to find a locating
for storing, such as onto a flash drive. Clicking on Restore will bring up an Open window where you can
then browse to locate the backup file you created.

#### 4.11 Exporting to MTC Gallery

When exporting to the MTC Gallery, you have a choice between exporting as an SVG or as an MTC. To
export just a selected shape from MTC to the Gallery, select the file and then choose the Sel. as SVG to
MTC Gallery option. The following window will open where you can then enter information and select a
category:

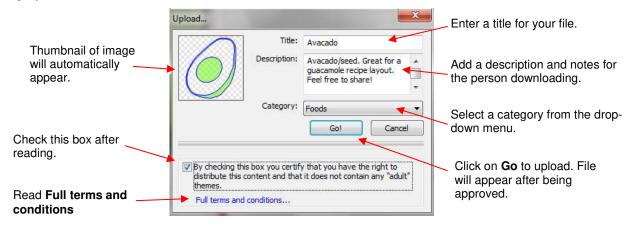


- When another MTC owner imports the file, it will automatically import at the height and location of the Caret.
  If necessary, the designed size could be mentioned in the Description. For a file such as this avocado, it's
  not necessary. But for something like a cupcake wrapper, it could be important for the user to know the
  original design dimensions.
- Another alternative, which preserves the original dimensions of all shapes in the file, is available. From the
   Export options, choose Sel. as Project to MTC Gallery. An identical window appears, but the upload will
   include everything in the file, including the same Virtual Mat settings. Notes, Layers, etc.
- If you upload a file and then later wish to delete it, locate your file and click the **Delete Item** link at the bottom of the image window:




#### 4.12 Exporting as SVG

- To export as an SVG file, select the shape or shapes and then either go to File>Export>Sel. to SVG File or
  right click on the selected shape(s) and choose Export>Sel. to SVG File.
- Choose a location and name for the file. You also will have the option to set a Stroke Color and/or Stroke Width. Note the stroke doesn't appear if you re-import the file into MTC. However, you will be able to view this stroke in other vector programs, such as Inkscape.

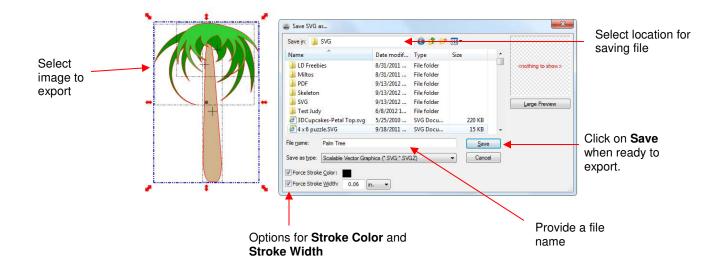


#### 4.13 Exporting as EPS/AI or PDF

For either of these formats, first select the shape or shapes and then either go to File>Export or select the
Export option from the drop-down menu (right click on selected image for Export option). Then choose
either Sel. to Al/EPS File or Sel. to Vector PDF File. A window will open:

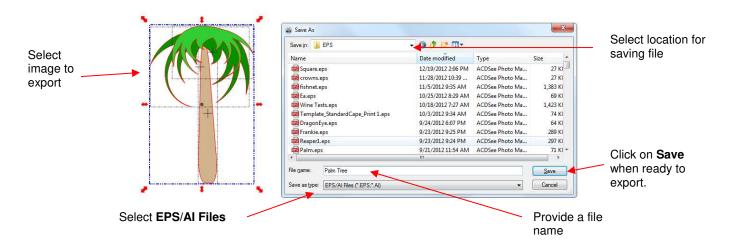

#### 4.14 Exporting as a Raster File

- There are many reasons why you might want to export your file as a raster. For example: (1) The image could be posted on a web site or blog, (2) The image could be shared with a friend or a customer, (3) The image could be used in a digital scrapbooking program.
- Select the image and right click to bring up the menu to select Export and then select the last choice, Sel. to Raster File. This window will open:

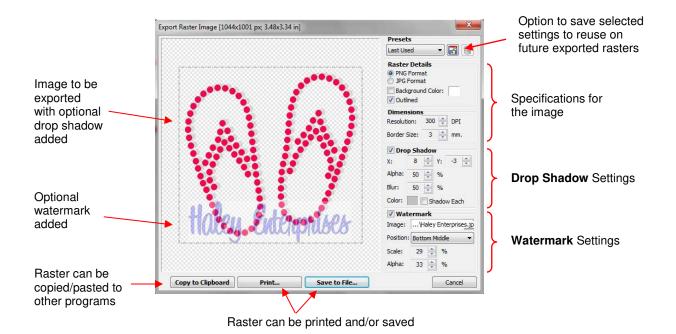

Note the many settings available for the raster export. If the image is to be imported into a layering program (such as Photoshop or a digital scrapbooking program), then PNG will be the preferred format. For commercial applications, you may wish to add a watermark to protect your image from being copied. A drop shadow can be added to give your image dimension. Experiment with these settings and if you find certain ones that you wish to use repeatedly, click on the option at the top to save the settings and a window will open where the settings can be saved with a name you provide:



#### 4.15 Using Windows Copy/Paste

#### **Adobe Illustrator**

- In Adobe Illustrator, select the shape or shapes and use **Edit>Copy** or **Ctrl+C** to copy the images to the Windows clipboard. In MTC, use **Paste in Place** (**Ctrl+Shift+V** or the icon on the **File Toolbar** ) to import the shapes at the original size. Note the fill and stroke colors assigned in Illustrator will not be brought into MTC.
- On some shapes, duplicates can result during the conversion from AI to MTC. The quickest way to eliminate those duplicates is to apply the **Fuse n' Weld** function. It isn't necessary to know which shapes might be

duplicated. Just select all of the imported shapes and click on the **Advanced** icon on the **Shape**Magic Toolbar, and select Fuse n' Weld. A small window will open. It's not necessary to adjust any settings in this case. Instead, click on the **Optimal** button. The window will close and any duplicate shapes will be fused into a single version:



• If you have any problems using the Windows Copy/Paste method, try importing your saved Al files into MTC. Refer to Section 4.04.

#### <u>Inkscape</u>

- In Inkscape, select the shape or shapes and use **Edit>Copy** or **Ctrl+C** to copy the images to the Windows clipboard. In MTC, use **Paste in Place** (**Ctrl+Shift+V** or the icon on the **File Toolbar**) to import the shapes at the original size. Note the fill and stroke colors assigned in Inkscape will not be brought into MTC.
- Similar to Al files, duplicates can occur with some shapes during the copy/paste process. Apply the **Fuse n' Weld** function noted above to reduce any duplicates into single occurrences.
- If you have any problems using the Windows Copy/Paste method, try importing your saved SVG files into MTC. Refer to Section 4.03.

#### KNK Studio/ ACS Studio



- In KNK or ACS Studio, select the shape or shapes and use **Ctrl+C** or **Edit>Copy** to copy the images to the Windows Clipboard. In MTC, use **Paste in Place** (**Ctrl+Shift+V** or the icon on the **File Toolbar** ) to import the KNK shapes at the original size. The **Fill** color in KNK Studio will also be maintained.
- If you need to cut by color, then it may be easier to select one color at a time in KNK Studio, to copy/paste over to MTC. A new layer will be created on the Layer Bar and those shapes assigned to that new layer. This may be faster and easier then copying and pasting everything to MTC and then trying to reassign same-colored shapes to their own layers.
- If the dimensions of the imported shapes are larger than the same dimensions shown in KNK Studio (which will happen with rhinestone patterns, for example), apply the **Flatten Paths** command and the dimensions should then match. The shapes have not changed sizes during the conversion from KNK Studio to MTC; this is simply a correction to remove the Bezier control points. Refer to *Flatten Paths* under *Section 7.04*.
- The Notes function in KNK/ACS Studio will also allow text to be copied and pasted to the Notes Window in MTC.
- If any of the VEF and WFN fonts specific to KNK/ACS Studio have been used to create text, that text may also be copied and pasted from KNK/ACS Studio to MTC even though those particular fonts cannot be opened in MTC.
- If you have any problems using the Windows **Copy/Paste** method, export your files from KNK Studio in either EPS or PDF format to import into MTC. Refer to *Section 4.04*.
- To export from MTC to KNK/ACS Studio, select the shape(s) and use either the EPS or PDF export functions described in Section 4.1. Imported files in KNK/ACS Studio will need to have fill colors assigned and Thick Line Attribute set to No Line or Hair Line. Refer to the KNK Studio User Manuals.


### 5. Working with Text

#### 5.01 The Text and Fonts Tab

• On the Main Bar in MTC, you will find a tab called Text and Fonts:



- The Text and Fonts tab is used for:
  - Browsing and selecting which font to use for creating a text shape. Note that marking the **Show Face** option will display the font names in their font type.
  - ♦ Browsing all of the characters (glyphs) available in any given font
  - Opening/importing new fonts
  - Accessing the window for typing text
  - Ohoosing to make text bold or italic.

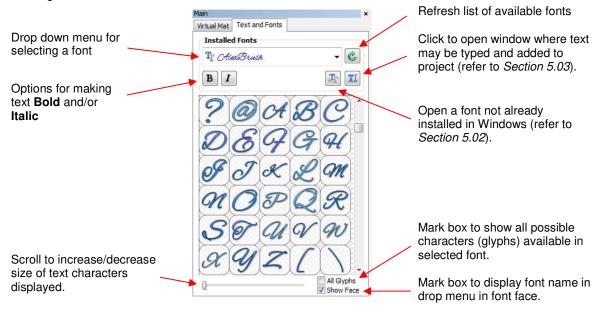

- Fonts appearing in black in the drop-down menu are installed in Windows. Fonts appearing in blue have been opened into MTC during the current session. Fonts appearing in green have been opened during this session or previously opened, with the option marked to permanently install in MTC. (Refer to Section 5.02.)
- You can click on any font in the drop-down menu and then use your mouse scroll button to scroll through all
  of the fonts in the menu. Make sure the **Show Face** option is marked if you want the font names to appear
  in the actual font.
- If you are looking for a particular font, type the first letter of the font name and you will be taken to the fonts that begin with that letter.
- Some fonts will change significantly if the **Bold** option is selected, so be aware of that possibility. The same is true of the **Italic** option. Make sure it is not indented/blue in color.

#### 5.02 Opening Font Files




- True type (.TTF) and open type (.OTF) fonts which are already installed on your computer are ready to be
  used in MTC. However, unlike most other Windows applications, uninstalled fonts do not need to be preinstalled in Windows in order to be used. They can be opened directly in MTC, as easily as importing other
  vector files.
- A font can be opened in MTC using any of the following ways:





♦ Click on the Add Font from TTF File icon on the Font and Text tab of the Main Bar:

- ♦ Press Ctrl+Shift+H
- ♦ Go to File>Import>True/Open Type Font File.
- After invoking one of the methods to open a font file, the following window opens:

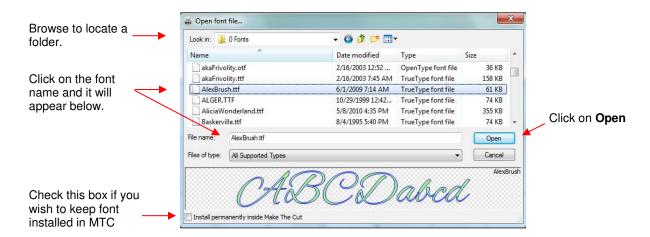

- When MTC is closed, any new fonts which were opened <u>during that session</u> (but not permanently installed in MTC) will automatically be uninstalled from MTC. Not to worry! Once a particular font is used to create text and that file is saved, then that same font does not need to be re-opened when opening that same file.
- If you wish to open more than one font at a time, hold the **Shift** or **Ctrl** keys, just as you would when selecting multiple files in other Windows applications.
- If you wish to continue using that same font or fonts in MTC for other projects, then check the **Install** permanently inside Make The Cut box at the bottom of the Open Font File window.
- To remove a font permanently installed in MTC, select it and press the **Delete** key on your keyboard or right click on the font. Note that this only works with fonts you installed from within MTC, not fonts installed in Windows.


#### 5.03 Add Text Group




- There are two ways to open the Add Text Group window for creating text for your project:
  - Click on the Add a Group of Characters icon on the Text and Fonts tab



♦ Press Ctrl+I.

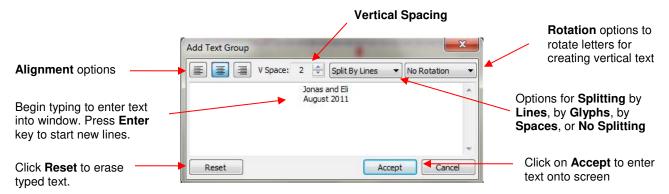


As you type the text, it will also appear on the screen at the location and height of the Caret (refer to Section 4.01). After clicking on Accept in the above window, the Add Text Group closes and the text is ready for any additional editing desired:



Note that text can also be imported into this window, from other Windows applications (Word, Outlook,
 Excel, or other text programs), using the normal copy and paste method.

#### **Rotating Text**

• To create vertical text, select **Rotate Left** in the **Add Text Group** window:

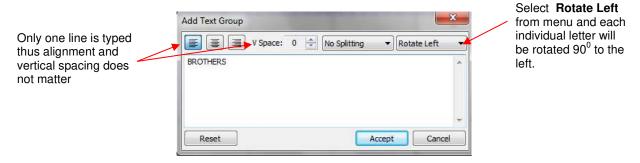

• Then select the text created and rotate 90° (Ctrl+G):



#### **Splitting Text**

- There are four options in the Splitting drop-down menu:
  - ♦ **No Splitting**: Entire text is treated as a single shape:



♦ **Split by Lines**: Individual lines of text will be separate shapes:




Split by Spaces: Spaces created using the space bar will divide text into separate shapes:



♦ Split by Glyphs: Each typed character will be its own individual shape:



- The different options are useful depending on what the next planned step will be with the text. For example, if you plan to overlap the characters to weld together, then you want the text to be **Split by Glyphs**. But as you explore other designing functions, you will learn how the other options will be better choices.
- If you inadvertently select the wrong option for your intended design, not to worry! You can use the **Split** function (**Ctrl+P**) on the text after you close the **Add Text Group** window to **Split by Glyphs**. Then, if you want **Split by Lines** or **Split by Spaces**, then just marquee-select the characters groupings, one at a time, and apply the **Join** function (**Ctrl+J**) to recreate the splitting you wish to have. For example, marquee-select the entire top line of the title that was **Split by Glyphs** and apply the **Join tool**:

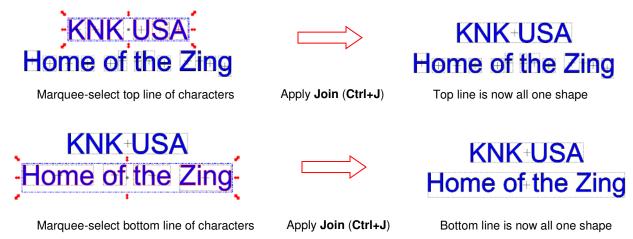

#### 5.04 Creating a Connected Letter Title

# Wideo

• Using the instructions from *Section 5.03*, type the letters of your title. In this example, you will want to choose **Split by Glyphs** so that individual letters can be moved to overlap one another, as desired:



- If you forget to select Split by Glyphs, then select your title and use the Split function in any of the following ways:
  - ♦ Click on the **Split** icon on the **Magic Toolbar**
  - ♦ Press Ctrl+P
  - ♦ Right click on the screen and choose **Shape Magic>Split** from the menu
  - ♦ Go to Edit>Shape Magic>Split.
- With the letters split, you can select one or more and use the left and right arrow keys to change the spacing between letters, overlapping as desired. It is advisable to zoom in on the text to get a more accurate view of the actual positioning of the letters. You may also want to check the text both with and without the Fill turned on (which can be changed on the Virtual Mat tab).
- You can also quickly overlap letters by selecting them all, holding the Ctrl key, and then dragging the middle
  right of the bounding area towards the left. Note that you must be in Resizing mode for this to work (refer to
  Section 4.13):



- When you are satisfied with the overlap, select all of the letters and then apply the Weld function using one
  of the following:
  - ♦ Click on the **Weld** icon on the **Magic Toolbar**



- ♦ Press Ctrl+W
- ♦ Right click on the screen and choose **Shape Magic>Weld** from the menu
- ♦ Go to Edit>Shape Magic>Weld.



• To create an outline/shadow for titles and other shapes or if you need to thicken a font that turns out to be too thin for cutting, refer to Section 8.05.

#### 5.05 Incorporating Dingbat Shapes into a Title

# Video


- A quick way to incorporate a shape into a welded title is to use any of thousands of dingbat fonts available
  from the Internet for free. In this example, a free font called 1 Bean Sprout DNA is being used for the title
  and the dingbat font, Wingdings, will be used for the shape.
- Using the steps in *Section 5.03*, create the title, with the **Split by Glyphs** option selected:

# Barber Shop

Marquee-select the left side and drag away from the right to create a gap for a shape:


# Barber Shop

• On the **Text and Fonts** tab, select the font, *Wingdings*, from the drop-down menu. Scroll to locate the scissors image. Rather than entering the **Add Text Group** window, you can double click on the image you want to use and it will added at the location of the **Caret** (refer to *Section 4.01*):

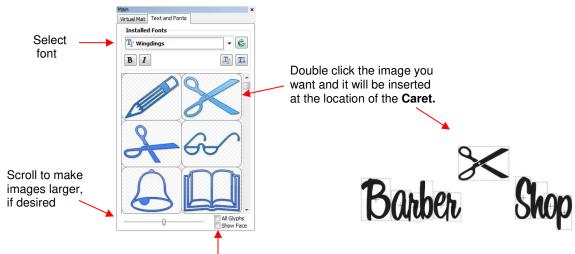

Some dingbat fonts will show up, as images, in the drop-down list of all fonts. Thus, uncheck **Show Face**, as needed.

Resize and arrange the dingbat shape, as desired. Also overlap the letters with each other, as desired.
 Then apply the Weld (Ctrl+W) tool.



 Note that dingbat fonts are not the only shapes that can be welded to letters. Any shape imported or created within MTC can be used!

#### 5.06 Welding Titles in Imaginative Ways

Some fonts simply do not work well with the traditional overlapping of the letters to be welded into one piece
for cutting. For example, let's take an extreme case with Arial font and the name, "Billy". Note what happens
when you take the work and then overlap the letters in this particular font:



Most crafters will just start looking for a different font... one with ligatures (extenders) that easily connect the
letters to one another. However, many fonts with ligatures are script fonts and may not convey the desired
look. So, is there a solution? Definitely! Look for objects that can be used to connect the letters! A basic
thin rectangle is an easy solution. Just align it along the bottom of the letters and weld:



But the objects to use as a base do not have to be so basic! Look for objects that will tie into a theme! Here
are just a few examples:



#### 5.07 Fitting Text to the Outside of a Shape

#### Wrapping Text around A Circle

- The **Wrap Objects to Path** function can be used to fit text to the outside of a shape. In this example the words "Happy Birthday" will be wrapped around a circle three times.
- The first step is to type the text, making sure the **Split by Glyphs** option is selected. If you forget, then use the **Split** function to break your text into individual letters:

#### Happy Birthday!

The next step is to create the circle. You can import a circle from Basic Shapes and resize it to what seems
close to fit the lettering if the letter were repeated three times. It's not necessary to be exact as you will have
some settings to tweak this! Worst case, you will be able to cancel the process and resize the circle larger
or smaller, as needed:



• There is currently only one way to activate the **Wrap Objects to Path** function. Select what you want to wrap (in this case, the text) and hold down the **Ctrl** key while you drag the text onto the shape. When you see the cursor change to release the mouse button and the following window will open:



The lettering doesn't fit. But not to worry! Begin to tweak the settings:



- To end up with a perfectly arranged design, work with the settings in this order:
  - Repeat Count: If you want a particular number of repeats, enter it.
  - **Spacing:** This is the distance between each of the repeats. In our example, it is the space set between the end of "Birthday" and the start of the next "Happy." Note that this may not be retained as the Space setting is adjusted to get all of the repeats visible.
  - **Space:** This is the distance between the individual shapes making up the design. In our example, it is the space between all of the letters making up "Happy Birthday."
  - Vert. Align: This indicates how close the original text is positioned to the circle. At 100%, the text just touches the circle but the setting can be increased to move the text outwards, away from the center of the circle or decreased to move the text inwards, towards the center.
  - Offset: This will rotate the text around the outside, if desired, so that the text begins in a circle location along the outside of the circle.
- On the settings you drag with your mouse button, remember to also use the right and left arrow keys on the keyboard for smaller changes in the settings.
- Click on **Accept** and then delete the circle:




#### Wrapping Text Half-way Around the Top and the Bottom of a Circle

- In this example, the text needs to be split so that the first half wraps around the top half of a circle and the second half wraps the other way around the bottom.
- Type the text, again making sure that **Split by Glyphs** is selected. In this example, an address will be used:


# 231 Semoran Commerce Place Apopka, Florida 32703

Marquee-select the <u>second half</u> of the address and apply both the **Mirror** and the **Flip** functions:




• Draw a circle and marquee-select the first of the text. Hold the **Ctrl** key while dragging the text into the circle, letting go of the mouse button first. The **Wrap Objects to Path** window will open:

### Apopka, Florida 32703

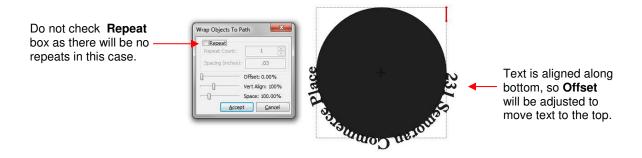

This time, leave the Repeat box unchecked. Then begin adjusting the Offset so that the text moves to the
top half of the circle. It is a good idea to write down the Space and Vert. Align settings so that similar
values can be used when you do the second half of the text:

## Apopka, Florida 32703

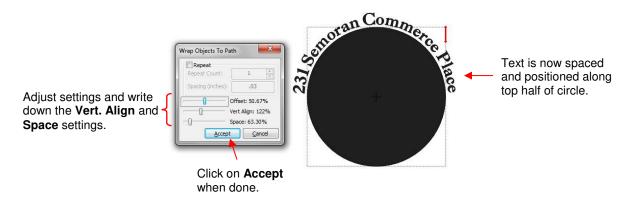

• After clicking on **Accept**, the second half of the text is selected and, again, moved to the center of the circle while holding the **Ctrl** key:



Adjust the Vert. Align and the Space settings to match what was used for the top half. Then change the
Offset to align second half of text along the bottom half of the circle.



 Click on Accept when done. Add other shapes, as desired. In this case the company named was added to the center:



 The Wrap Objects to Path can be used for other designing applications, one of which is shown in Section 8.08.

#### 5.08 Fitting Text to Paths

- A different function, the **Bézier Warp**, can also be used to fit text to a circle or to fit text to a custom designed path.
- As before, type the letters you wish to fit to a circle using the method described in *Section 5.03*. The text created in *Section 5.04* will again be used. Note that the lettering can be welded or not. And if not welded, the letters can be **Split by Glyphs** or not:




- With the title selected, open the **Bézier Warp** window using one of the following ways:
  - ♦ Click on the **Bézier Warp** icon on the **Magic Toolbar**



- ♦ Press Ctrl+T
- Right click on the screen and choose Shape Magic>Bézier Warp from the menu
- O Go to Edit>Shape Magic>Bézier Warp.


#### Closed Path in Bézier Warp

 In the first example, the text is fit to a circular shape and the Auto Size option is chosen. Note that the Manual Size option could also have been used and will be selected in the example after this one:

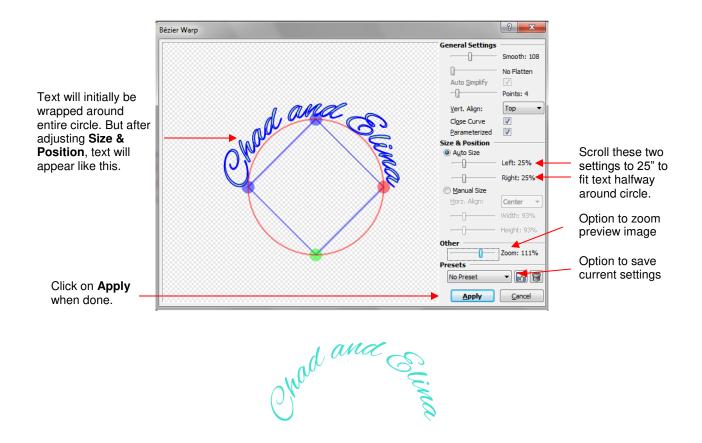

#### Open Path in Bézier Warp

To use an open path, the Close Curve option is unchecked, so that the path is a line instead of a circle.
 Next, more Points are added and then the points are dragged to create the desired path. Use the Zoom setting if you cannot see your entire text.

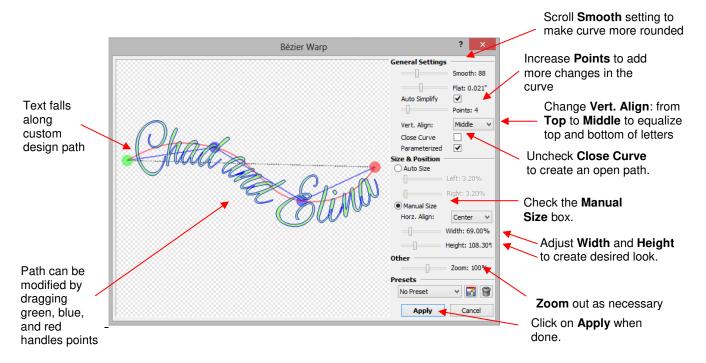



• In this example, **Manual Size** was selected but you can also try **Auto Size** again, too! The **Bézier Warp** process is about experimenting and having fun with it! If you like certain settings, remember that the option to save settings (**Presets**) is available.

#### 5.09 Creating an Overlay Title and Welding Text to Frames


Creating a frame for welding single letters or images is very easy. Using the steps in Section 5.03, create a
title. The font chosen for this example is Times New Roman. Also, Split By Glyphs is selected so that
individual letters can be resized, if needed, to overlap the frame:









 Click on the Import Basic Shapes icon on the Import Toolbar and select Polygons. Scroll to locate the Rectangle shape and double click to add to the screen:




- On the **Virtual Mat** settings tab on the **Main Bar** (refer to *Section 4.04*), make sure you have **Outline** mode selected so that you will be able to see the rectangle and the letters clearly. Also, change to **No Snapping** under **Snap Position** so that you can resize the rectangle and letters with precision.
- It will also be easier to select individual letters if the rectangle is on its own layer and below the text. With only the rectangle selected, click on the **Selection to New Layer** icon (at the bottom of the **Layers Bar**) and then move the rectangle layer so that it is below the text layer:

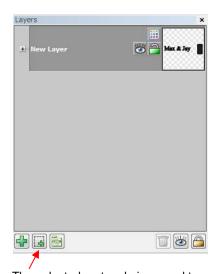

The selected rectangle is moved to its own layer by clicking on **Selection to New Layer** icon.

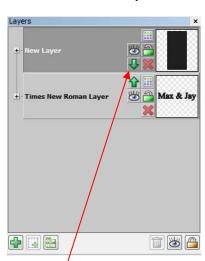

Then, the layer with the rectangle is moved below the layer with the text by clicking on the down arrow on that layer

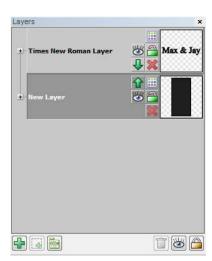

Now the two shapes are on separate layers with the text above the rectangle

• Resize the rectangle to be wide and thin so that the letters extend a little above and below it. Then resize and re-space individual letters, as needed, to overlap the rectangle. Remember to zoom in for a closer look at the overlap:





Zoom in to verify the overlap and adjust individual letters, as needed.

• If the regular weld tool were applied at this point, the letters would disappear, with the exception of the tiny overlaps at the top and the bottom:




- Thus, an alternative type of weld must be applied. The one to use is part of the **Boolean Join** options (Refer to *Section 8.07* for more details on the **Boolean Join**). But before the **Boolean Join** can be used, you must reduce the number of individual shapes to just two: the letters (as one single shape) and the rectangle. To combine the letters to be treated into a single shape, click on the preview of the text layer on the **Layer Bar** and then apply the **Join** function, which can be accessed in any of the following ways:
  - ♦ Click on the **Join** icon on the **Magic Toolbar**



- ♦ Press Ctrl+J
- ♦ Right click on the screen and choose **Shape Magic>Join** from the menu
- ♦ Go to Edit>Shape Magic>Join.
- Now marquee-select both the rectangle and the letters and bring up the Boolean Join menu, using any of the following:
  - ♦ Click on the **Boolean Join** icon on the **Magic Toolbar**



- ♦ Press Ctrl+U
- Right click on the screen and choose Shape Magic>Boolean Join from the menu
- ♦ Go to Edit>Shape Magic>Boolean Join.
- The following popup menu will appear and as you move your mouse over the various options, you will see
  your image change on the screen. The option called **B-A Difference** shows the rectangle outline
  disappearing where the letters overlap, which is what you want in this case:

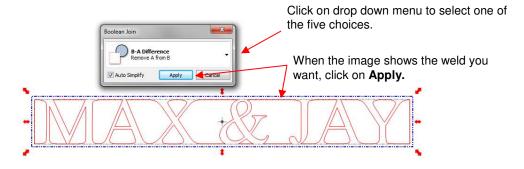

Now, this resulting weld would work fine for an overlay where the negative part of the image is what you want to keep. To have an actual frame, add a rectangle to the outside and then select all, apply Stack Ctrl+S (which will center the two shapes) and perform a Join (Ctrl+J). Here are the two results:



#### 5.10 Stenciling Letters



• When creating a stencil, you want to keep the "waste" or "negative" of a cut. When using regular fonts, such as Arial, some of the letters, such as a "B", "a", and "e", will not work because they have interior paths called child shapes. Those child shapes are not connected to the waste portion of the material and will be lost from the stencil as shown below. The red arrows indicate the child shapes inside parent shapes for the letters "B", "a", and "e":





- To avoid this, a procedure called stenciling can be used to connect the area outside of the letters to the child shapes, essentially eliminating them. While there are various ways to do this in MTC, the easiest is probably using the **Eraser** tool. In this method a straight line erase, at a preset width, results in the interior shape being connected to the outside of the letter.
- The **Eraser Tool** is the 8<sup>th</sup> icon on the **Node Mode** toolbar and can be activated by first opening the **Node Edit toolbar** (or pressing **W**) and then clicking the icon or pressing **F8**.
- Zoom in close on the lettering so that you'll be able to see exactly where you need to erase. When you activate the Eraser Tool, the following settings will appear at the top of the screen:



- The **Size** you enter will normally relate to the height and style of the lettering you are stenciling. In this example, the word "Batteries" is typed at a height of 1 inch. The eraser **Size** is set at 1.5 mm, but it could be smaller or larger depending on your personal preference.
- Hold down the Ctrl key and the left mouse button and drag the mouse in a straight line where you want to erase. A red line is drawn:

Small horizontal lines at the top and bottom of the red erase line indicate that the line is perfectly vertical.



Hold Ctrl key and drag mouse down, through the middle of the "B"

• Release the Ctrl key and the left mouse button. The "B" will now have a gap through the letter:



- Repeat the process with the other letters containing child shapes. If at any time something goes awry, use the **Undo** key at the top of the screen to back up a step.
- Now when you cut the letters to create a stencil, all parts of the letters remain connected:

# Batteries Batterie

Completed stencil

• Note that the erased lines do not always need to be vertical. For example, with the font Cooper Black, the "o"s are angled, thus you might want to angle the erase lines the same way:



Colombus

Vertical Stenciling

Angled Stenciling on the angled letters

#### 5.11 Open Path Fonts (OPF)

• Besides TTF and OTF, a third type of font, Open Path Font (.OPF) can be opened in MTC. This font consists of single lines/curves only:



• These fonts are useful when using a pen or engraving tool in your cutter or for designing single line rhinestone titles (Refer to *Section 8.12* for more information on the **Rhinestone** function in MTC.)



• Currently, this font type only works in Make The Cut and does not install into Windows for use in other applications. There are free ones to download here:

http://www.iloveknk.com/Support/Software/Make-The-Cut/Open-Path-Fonts/

You can purchase Open Path Fonts (also called Thin Fonts) from <u>www.letteringdelights.com</u> and from <u>www.onelinefonts.com</u> to use in MTC. Note that these also come with the TTF equivalents, which are not actual single lines and curves, but are still thin.

## 6. Tracing

#### 6.01 Raster versus Vector

- All graphics are either raster or vector and there is no third type. While you can often tell by the file format, even that isn't always a good way to know for certain. For example, a PDF file can be made from either raster images or vector images and some PDF's will contain both types.
- You may not be able to tell, at first glance, whether an image is a raster or a vector. For example, this screen shot shows the same image in both formats:



Raster Vector


Most everyone today has a digital camera and, at the very least, has heard the term "mega-pixel." A pixel is
a square that is black, white, or colored. Photographs are made up of millions of these pixels to create the
image you see. If you zoom in close enough on any raster image, you can see these tiny pixels. But when
you zoom in close on the same area in the vector version, you will instead see lines and curves, not
squares/pixels:



Raster

Vector

A vector image isn't made up of pixels. Instead, a vector is like a connect-the-dot puzzle in which little dots (called nodes or points) are connected to each another with paths (either straight lines or curves). Digital die cutters need those paths so that that they can communicate to the cutter where the blade should travel in order to make the cuts you want... kind of like a road map. In MTC, the nodes look like this:



• As mentioned earlier, you can often tell whether a file is a raster or a vector based on the file format. Here are some guidelines:

Raster: BMP, JPG, TIF, PNG, GIF Vector: AI, EPS, WMF, DXF, SVG Either: PDF, sometimes EPS & WMF

• To convert a raster into a vector, MTC offers two options: **Pixel Trace** and **Manual Trace**. Because the **Pixel Trace** feature in MTC is so fast and powerful, it is always worth trying it first. The only situation in which it may not be able to provide the results you need are (1) the image is very tiny or has a very poor resolution or (2) the image has poor contrast between one part and the next. For example, imagine a brown dog lying on brown carpet. How would the software know what part is the dog and what part is the carpet? Thus you may need to manually trace some images, so both functions are covered, in detail, in this chapter.

#### 6.02 Finding Easy Images to Trace

- What qualifies as an easy image? The obvious answer is "an image which gives you the results you want!" But those who are new to the vectorizing process do not always realize which images are going to be easy and which ones are not. Note that you shouldn't be discouraged from trying to trace anything. But when you are learning the process, working with easier images will make the learning stage go smoother. So here are a few guidelines in selecting images:
  - Black and white images are easier to vectorize than colored images  $\Diamond$
  - Colored images with flat colors are easier to trace than those with variegated colors  $\Diamond$
  - $\Diamond$ Large, high resolution images are easier to trace than tiny, low resolution images
  - $\Diamond$ Images with tiny details will be more difficult to trace than simpler images with fewer details
  - Photographs are usually the most difficult to trace, especially when some of the colors blend (such as the brown dog on the brown carpet, mentioned earlier).
- For your own personal use, there are many images that can be found on the Internet. Use Google Images to search and find images based on keywords. Google Images also has filters at the top of the window (under Search Tools) to limit your search to black and white, as well as to clipart or line drawings. Use these filters!

#### 6.03 Pixel Trace




Tracing for a PNC: Trace and Edit Example:



- To begin the **Pixel Trace** process, it is recommended that you first double click near the top left part of the Virtual Mat. This will plant the Caret at that location and, as you play with the trace settings, you'll be able to see the results of the current-selected settings.
- The next step is to import a raster image. You can access the **Open Image for Tracing** window in any of the following ways:
  - Click on the Pixel Trace icon on the Import Toolbar

- Press Ctrl-Shift-T
- Go to File>Import>Pixel Trace
- Drag and drop a raster image into a running instance of MTC.
- When the window opens, there are three options for importing your raster image:


Option 1: Browse to find image folder. Click on the image and the File Name will appear below. A preview will appear. Click on **Open** to import the image.

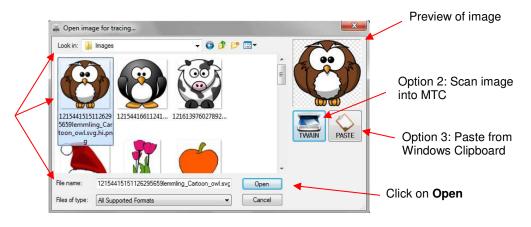


- Option 1: Import a file that is already on your computer, CD, flash drive, external drive, etc.
- Option 2: Import an image using a scanner connected to your computer

- ♦ Option 3: Copy/paste an image from Window Explorer or from the Internet
- The image will open in the **Pixel Trace** window. Note the following information in this window:




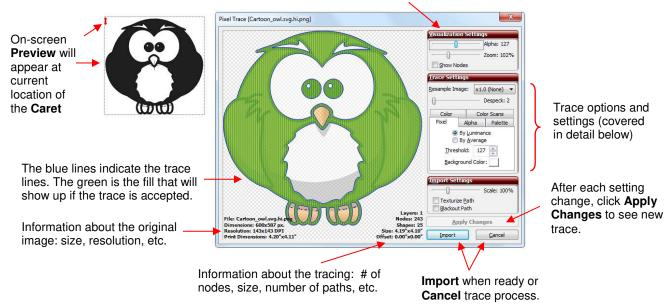

- When experimenting with the various tracing methods, remember the following:
  - ♦ Each time you change a setting, you need to click on the **Apply Changes** button to see the updated preview.
  - Before beginning the Pixel Trace process, position your Caret in the top left part of the screen. You will then also see a preview of the tracing on the main screen as you test different settings in the Pixel Trace window. You may need to move the Pixel Trace window to see this tracing.
  - ♦ Experiment! Remember that you can change settings and refresh the results without making any commitments. Take notes when you discover something new about tracing!
  - A combination of tracing methods might occasionally yield the best results. Each time you click on **Import**, you will be given the opportunity to place the current trace into your main window, but then return and try different settings or different methods. Be adventurous in your tracing! You can always go back and delete parts of a trace you don't like or duplicate tracings that are not as perfect as perhaps one of the others. *Chapter 7* contains methods for editing your tracings, as well.
  - For print and cut applications, mark the **Texturize Path** box so that the original raster graphic will also be imported with the trace. You may also want to mark the **Blackout Path** box so that only the outermost trace line will be imported.
  - If your imported graphic has many images and you only wish to trace one, or if you only want to trace a part of an image, hold the **Ctrl** key and marquee-select the portion you want:

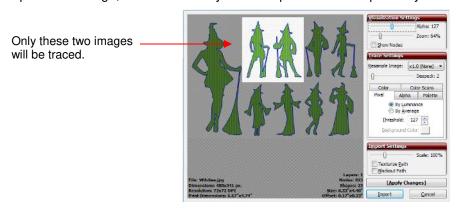

- If you decide to cancel your selection, just hold the Ctrl key and left click once anywhere on the preview.
- If you choose to use the **Scale** function to resize your image before importing, then note that as you are sliding the bar, the new size of the image will appear:

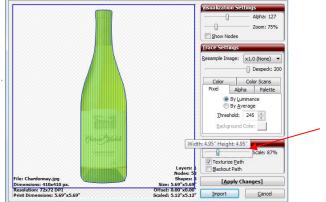

As the slider is moved on the **Scale** setting, the popup shows new dimensions of image.

#### 6.03.1 Pixel Trace Method

# Wideo

- The pixel trace is a monochromatic vectorization. In the Pixel Trace window, blue trace lines and green fills will appear, regardless of the colors in the original image. These are defaults and can be changed by going to View>Default Colors. After tracing, the tracings in the main window will be colored according to the Virtual Mat color selected. They can be changed to other colors just like any other shapes.
- The **Threshold** setting ranges from 1—255. Decrease this setting to add more distinction between colors and increase the number of individual paths recognized and traced. Increase to lessen the distinction between colors and decrease the number of individual paths recognized and traced. At the extreme of 255, you will have nothing more than a box around the outside of the image being traced.
- The following screenshots show the same image with different Threshold values used and the resulting trace when imported onto the screen:

#### Image in **Pixel Trace** window:








#### Resulting trace after import:



Threshold: 1 Lots of detail



Threshold: 75 Losing wing detail

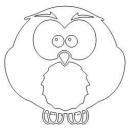

Threshold: 127 Wings missing




Threshold: 250 Detail in claws missing




Threshold: 255 Border only traced

- As shown in the above example, the most detail was obtained with the lowest Threshold. Typically, this is
  not necessarily what you want in your tracing. The point is to experiment freely over the entire range of
  Threshold settings to see the effects of changing this important setting. At the same time, test the other
  available settings.
- Choosing By Luminance versus By Average can give different results. Start with By Luminance and switch if you are having problems getting a good trace. Refer to Appendix B Terminology for definitions of these two terms.
- The **Despeck** setting will filter out small paths that you may not want to be traced. Increase to remove these tiny paths from your tracing. However, if you see parts disappearing that you need, then decrease. You can also apply a **Break** to your tracing and then manually delete parts you do not want.




• The **Resample Image** setting can be used to increase or decrease how tightly an image is traced. Lower it to decrease the number of nodes and "loosen" the fit of the tracing. Increase it to increase the nodes and create a more precise fit. This can also be used to soften angular tracings, as shown in this trace of a cat:

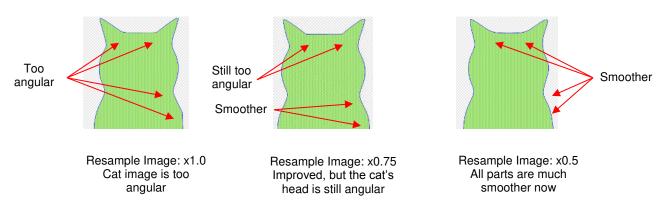


• The **Background Color** setting becomes usable when there is a transparent or alpha channel in the image you are tracing (such as you will find in some PNG and GIF files). The background color will define the semi-transparent pixels by blending them with the background color you select. Here is a photo of a white car that illustrates this feature:




• When imported into the **Pixel Trace** window, with default settings in place, note the parts of the image that are traced with the default white background selected:

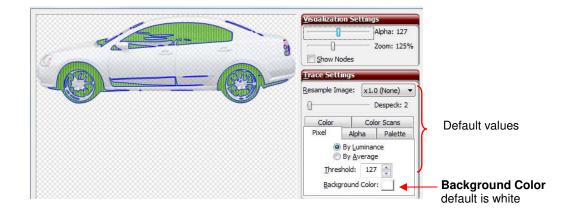

• Next, click on the **Background Color** box and a window will open. Select a different color, for example, red:

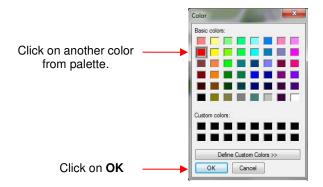

The parts of the image that will be traced changes:

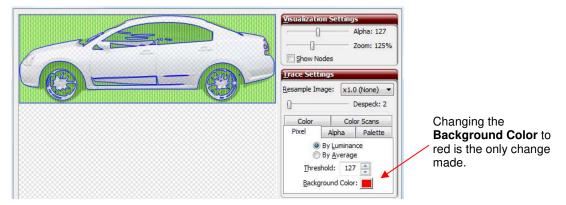


 This can be used to identify and trace different parts of an image. However, with the newer Alpha, Palette, and Color options available, this feature may not ever be something you need.

#### 6.03.2 Alpha Trace Method




Use the Alpha Trace for PNG files with transparent backgrounds (alpha channels). To switch to the Alpha
Trace method, click on the tab named Alpha and following will appear:

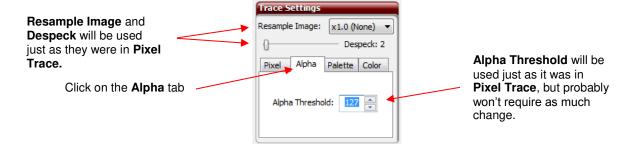

- Use the Alpha Threshold in the same way that the Threshold was applied in the Pixel Trace method. You
  will most likely discover that less adjustment is required. Both Despeck and Resample Image settings also
  apply in the same way.
- In this example, we are importing a <u>PNG image of a leopard</u>. Before importing, make the following changes
  on the **Virtual Mat** tab of the **Main Bar**. These two changes will allow the image you trace to appear in full
  color, on the main screen, after tracing:




Before using the Alpha Trace feature, note how the leopard appears when the default settings in the Pixel
tab are applied. Also note that if you first double click in the top left part of the screen, you can "plant" the
Caret in a location where you can see a clearer preview of shape that will be produced with those settings:

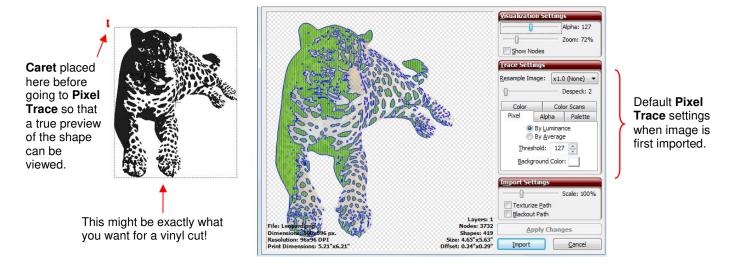


• As indicated in the screenshot, the tracing could be used for vinyl cutting, since vinyl is applied using transfer tape. However, let's say this is going to be a print and cut application in which the leopard will be printed onto paper and then the outside border cut out. What is needed is a single contour line around the leopard. By experimenting with the **Threshold**, it is found that a setting of 240 is needed to obtain a smooth outline around the image. Additionally, either a **Despeck** of 18 or marking **Blackout Path** was needed to remove tiny paths traced inside the animal:



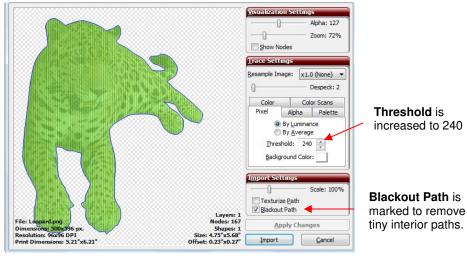


However, if you switch to the Alpha Trace tab, the default of 127 immediately gives you, in this case, the
outline you want:



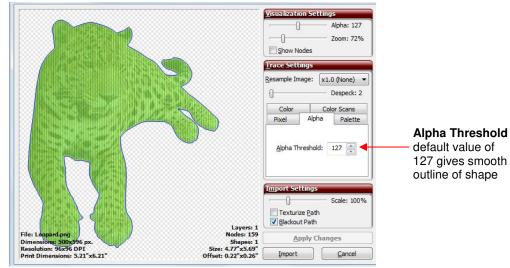

 Mark the Texture Path box, click on Apply Changes, and the image appears on the screen, ready for the print and cut process (refer to Chapter 9):



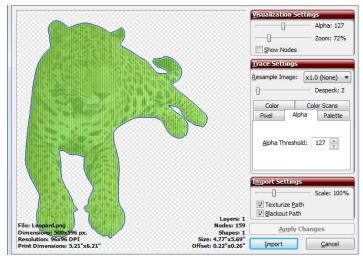


#### 6.03.3 Palette Trace

## Video

• The **Palette Trace** provides color tracing which is especially useful when designing paper piecing patterns. In this example, the following flower image was imported and will be vectorized:



• With the **Palette Trace**, the most prevalent 16 colors in the image are identified and displayed. To switch to the **Palette Trace** method, click on the tab named **Palette** and the following will appear:

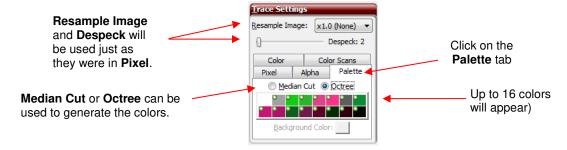


You can then select which colors to merge together, into one color, to be traced. Note that selecting
 Median Cut, instead of Octree, will use a different algorithm and produce a different set of 16 colors:




• For this example, we will return to the choice of using **Median Cut**. First, turn off all of the colors by right clicking on the boxes. A popup menu will appear which provides some options for which colors to have selected as well as how to sort them. Begin by choosing **Select None.** 




• With no colors selected, you can then click on colors that are similar and would be merged together to simplify the trace. For example, for the flower in this example, begin by clicking on all of the shade of pink:

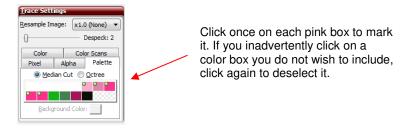

Use **Despeck** to eliminate tiny unwanted paths and **Resample Image to** sharpen details or provide more
curves to the image. Also, click on **Apply Changes** as you change settings so that you can see the effect of
each change. Now, the parts selected to be traced will be outlined in blue and filled with green, just as we
saw with the **Pixel** method:

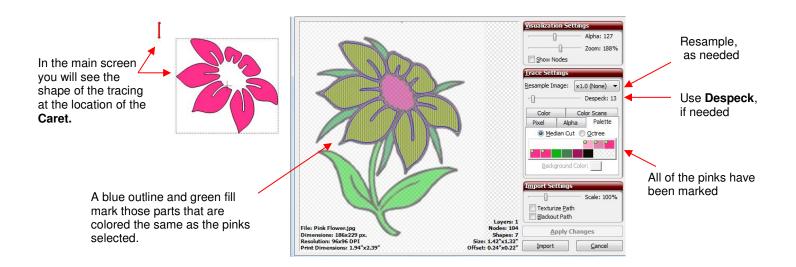

- Note that **Despeck** and **Resample Image** can be used, respectively, to remove tiny unwanted traced specks and to sharper or soften the tracing (just as they were used in the **Pixel Trace** method). In this particular case, only **Despeck** was applied.
- Now, before we accept this part of the image, you can add more colors if you wish. For example, the very center of the flower is more of a purple, but if you are going to cut this as a paper piecing pattern or as a vinyl design, perhaps you want to use the same color for the petals and for the center. Thus, clicking on that color, followed by click on **Apply Changes**, results in that color being added to the parts that are traced:

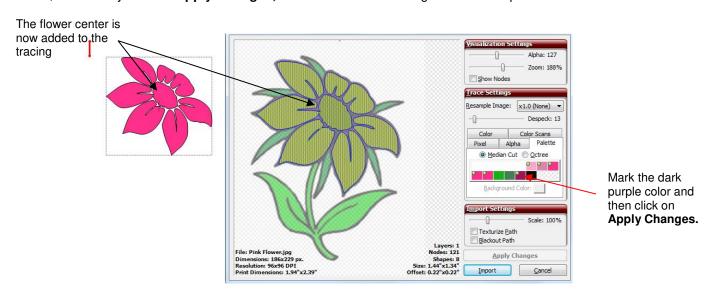


Click on Import and the program will ask you if you want to Continue Tracing or Finish Tracing. Answer Continue Tracing. Now click on the pink and red boxes again to turn them off or right click on the colors and choose Select None from the menu. Then click on the green boxes and click on Apply Changes:

Image on screen now shows both the pink and green shapes.




Mark the two green boxes after deselecting all of the pink ones. Click on Apply Changes.

- Click on **Import**. Then decide if you wish to also trace the black shadow around the image or create one using the **Shadow Layer** feature in MTC (refer to *Section 8.05*). If you decide to trace the black layer, then answer **Yes**. Repeat the above step, but only have the black color box selected.
- Now, before clicking on Apply Changes, stop and think about what you want to create. You do not want
  individual black parts to be created as separate shapes. Instead, you want the large black outline on which
  you will adhere the individual pink petals and green leaves. So, mark the Blackout Path option in order to
  remove any interior parts. Then click on Apply Changes to see the results:

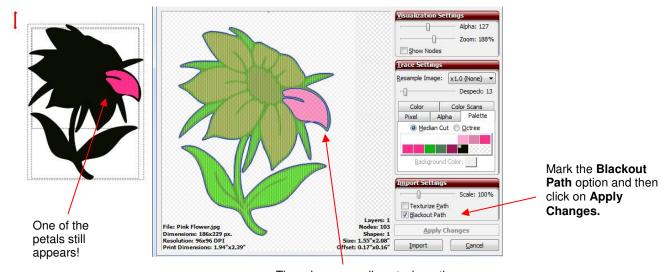


There is one small spot where the black is not a continuous path.

• But there's a problem! Instead of seeing one large black outline of the flower, there's still a petal showing. This is because the black wasn't recognized as extending around the outside edge of that petal. But not to worry... increasing the **Resample Image** value to **X2.0 Times** provided a closer trace and which then covered that thin section around that particular petal:

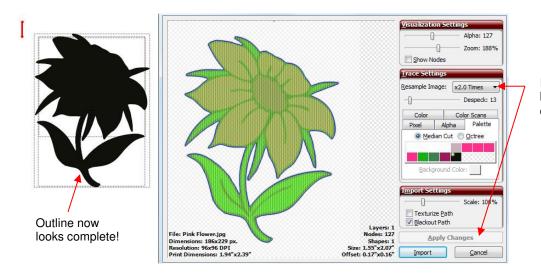


Increase Resample Image. Then click on Apply Changes.

Click on Import and answer Finish Tracing. On the Layers Bar, you will see the different layers of your image. However, there is no Show/Hide Layer icon on those individual layers. Thus you need to click on the Layer Options Menu and select To Each Its Own:

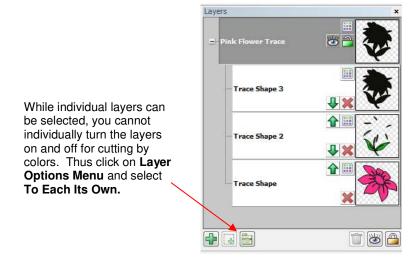

Now each of the four colors has been moved to its own higher level layer where you will now be able to turn
on and off individual layers for cutting. Also, you can move the layers up and down so that the black layer is
on the bottom where it serves as an outline:

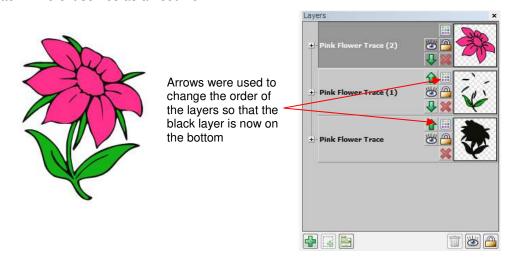

• Is the flower perfect? No. The blue arrows indicate where the image needs some tweaking:



• There are easy-to-use editing tools to tweak the petals in this image. These tools will be presented in Section 7.11.


#### 6.03.4 Color Trace

# Video


• The **Color Trace** is similar to the **Palette Trace** but you can individually click on a color, from your original imported raster, to trace and then specify a **Tolerance** level which will add or subtract similar colors to include in that selection. This is the image to be used in this example and has been imported:




• To switch to the Color Trace method, click on the tab named Color and the following will appear:

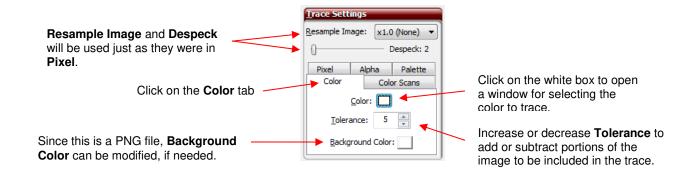

• The first step is to click on the little white box on the Color Trace tab. A window will open showing the imported image and you can select the first color to be traced. Let's start with the interior of the flower pot. An eyedropper cursor will appear and it can be moved around the screen to pick up the color of any part of the image. To select the color of the flower pot, simply place the eyedropper anywhere over the flower pot:

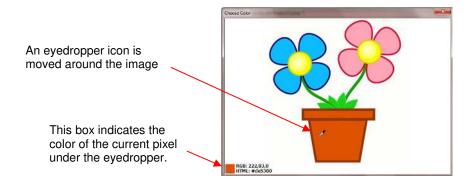


When the desired color is selected, left click once to select it, click on Apply Changes, and the trace will be
immediately made using current settings. Just like with the other trace methods, other settings in this
window can be adjusted. In this particular case, the Despeck setting will need to be used to eliminate tiny
paths being added to the tracing.

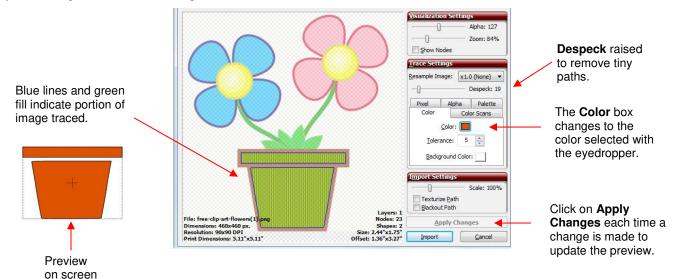


• Let's assume that you want the entire flower pot traced instead of just the interior. Increase the **Tolerance** setting to expand the color range that is close to the original color. In this example, the **Tolerance** is increased to 14 and the flower pot looks great! The entirety is now traced. Unfortunately, the outside of the pink flower also fell into this color range and is being included. But that's okay! That part can be deleted later after the tracing is completed:


Outline of flower is also traced.

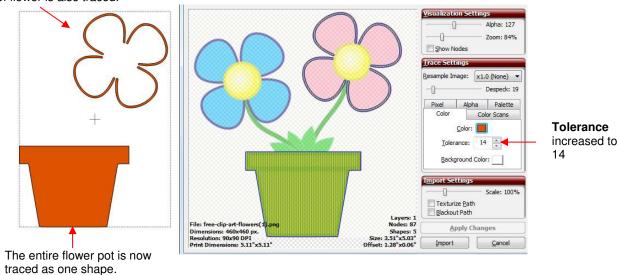


• Click on **Import** and the program will ask you if you want **Continue Tracing** or **Finish Tracing**. Answer **Continue Tracing**. Click on the **Color** box again and then pick another color. This time choose the green leaves:

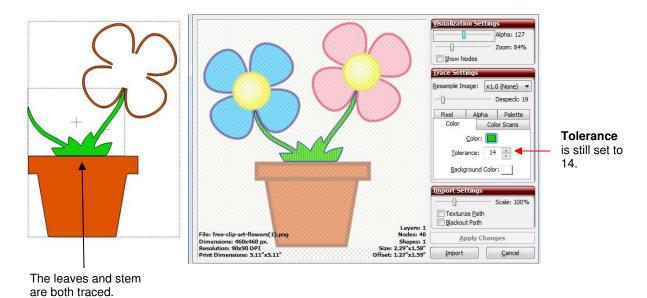

• If you want the leaves and stem to be traced as different shapes, then reduce the **Tolerance**. It was required to reduce the **Tolerance** all the way down to 2 in order to get just the leaves traced:

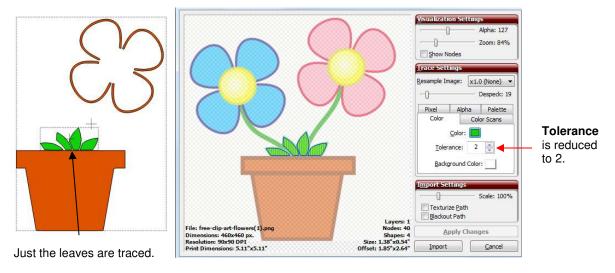


• Click on **Import**, answer **Continue Tracing** to trace more layers, and then select the stem color. Again, the **Tolerance** must be kept low in order to trace the stem only and not include the leaves in the selection:

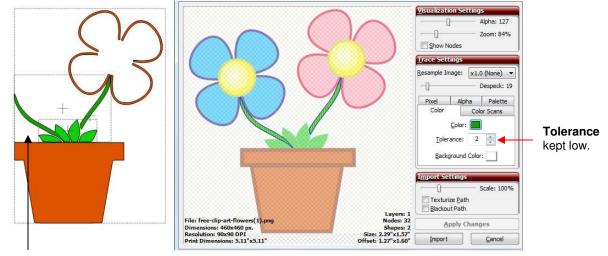


Stems are now traced.


- Click on Import and now repeat the same process for the blue and pink flowers.
- This leaves the yellow centers of the flowers. Click on the **Color** box to bring up the original raster for color selection. The centers are not one solid color, but rather radiate from an almost white color in the middle to a very dark yellow (almost brown) shade on the outside. In cases such as this, pick a shade somewhere in the middle of the color range (a darker shade of yellow, but not the darkest):

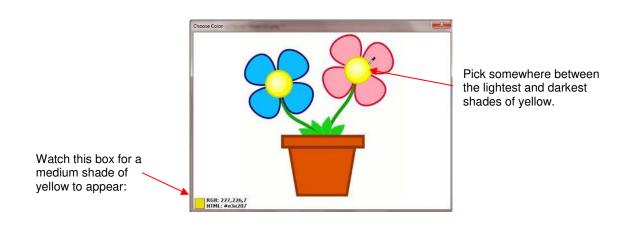


• Left click on the yellow. The **Choose Color** window will close. The **Color** box will show this selected yellow color. Click on **Apply Changes**. Increase the **Tolerance** and the full outside of the yellow regions are included in the trace:

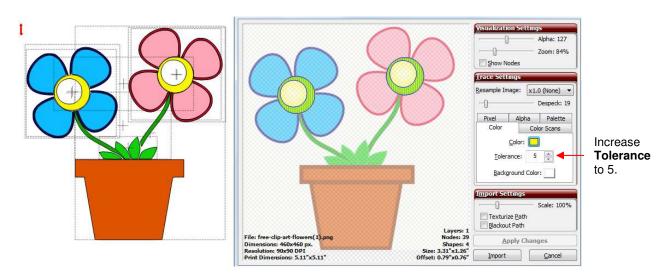

 The inner circles where the color is a very pale yellow are not included. Increasing the Tolerance gradually reduces the sizes of those inner circles:

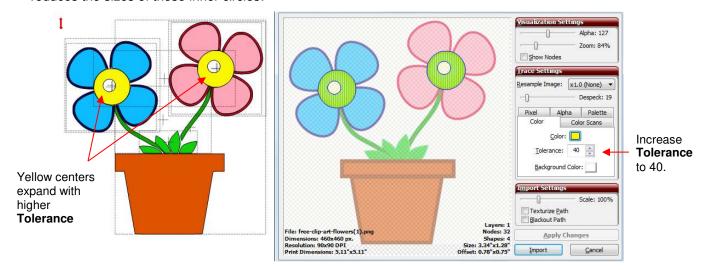


 However, there's an easier way to handle those! Just mark the Blackout Path box and they are instantly removed from the trace:

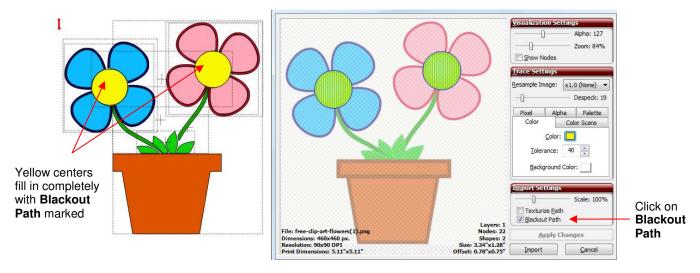

• Click on **Import** and, this time, answer **Finish Tracing**. The tracing part is complete:



 Now for the editing. To select the tracing, click on the Layer Options Menu icon and select To Each Its Own. Now the image can be edited, as needed and the colors turned on or off for cutting.

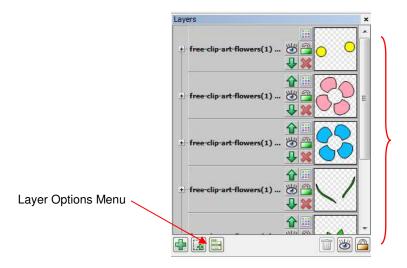

After selecting **To Each Its Own** from **the Layer Options Menu**, each
color that was traced, will
have those shapes on
their own layer.

• Locate the path that had the extra outside flower border traced and select that layer:



• Apply a Ctrl+B (Break) so that the pink flower border that was traced with the flower pot can now be selected and deleted. Then the flower is ready to cut from individual colors of paper, cardstock, vinyl, etc.:




### 6.03.5 Color Scans Trace




• Version 4.3.3 of MTC introduced a fifth tracing tool called **Color Scans**. This feature will trace by color (similar to the ways that **Palette** and **Color** tabs work) but it will do all of the colors in one step. You specify how many colors you want identified. This is the image to be used in this example:




 To switch to the Color Scans Trace method, click on the tab named Color Scans and the following will appear:

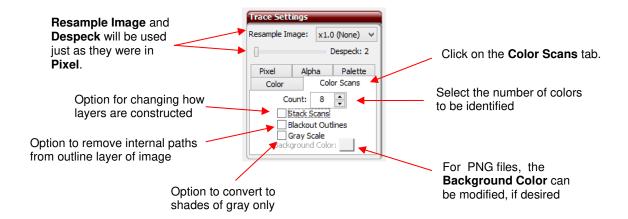


 The first step is to select the number of colors you want to scan. Always include white in the count. To see the original imported image, hold the right mouse button over the preview:

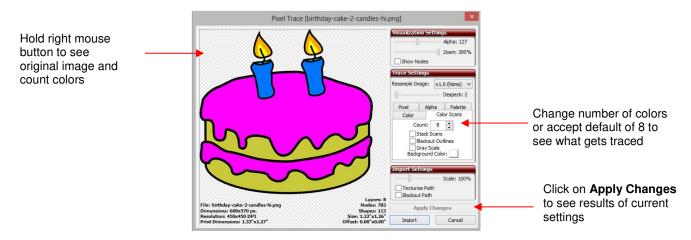


 In many cases, you might want to just go ahead and check the tracing results if the default Count of 8 is used. Before deciding any particular Count seems okay, be sure to check the number of shapes. In this case it shows 113:

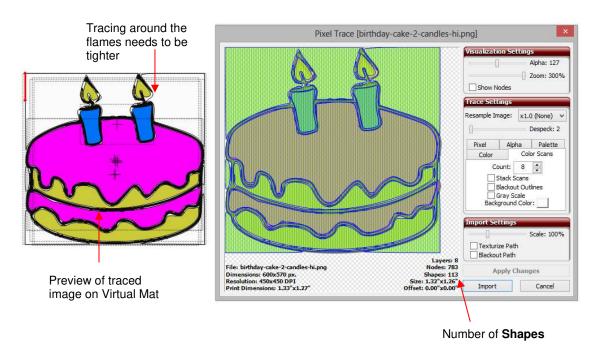


- Some of the settings will now be adjusted:
  - ♦ Based on how loose the tracing appears to be, the **Resample** will be increased.
  - Based on the excessive number of shapes, the **Despeck** setting will be raised to about 20. This will eliminate any tiny shapes that are not wanted. Of course, it's important to also make sure you do not lose any fine detail you need.
- After clicking on Apply Changes:

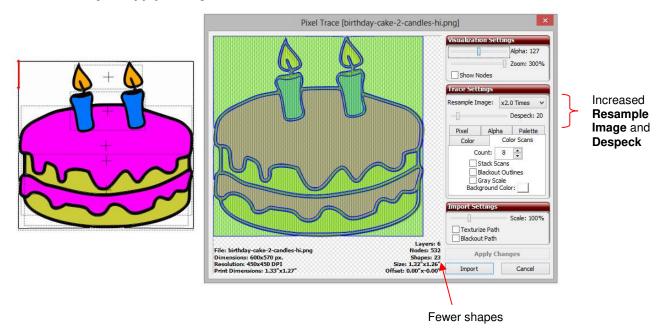


- The number of Shapes was reduced from 113 to 23. This still seems high. However, remember that every individual shape you see has a black outline shadow. In most paper piecing projects, you will probably prefer the black outline to be a single background shape. This is where the Blackout Outlines option can be applied.
- Also note that the lighter yellow on the flame is still missing from the image. If that detail is desired, then
  increase the Count and, possibly, decrease Despeck, until the yellow centers of the flame appear. In this
  case, a Count of 17 was required, but the Despeck was left at 20:

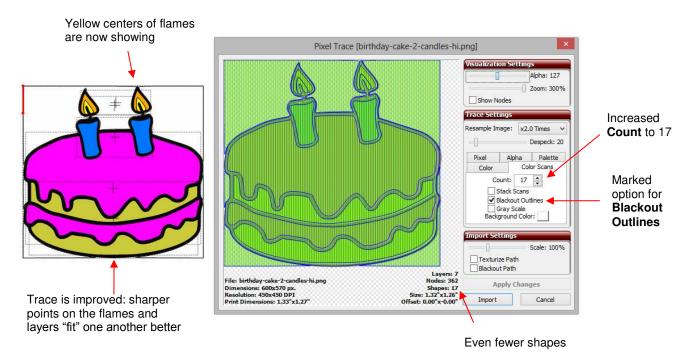


• When you click on **Import**, you will be asked if you wish to **Continue Tracing** or **Finish Tracing**. Select **Finish Tracing**. Click on **Finish Tracing**.



• Next, let's have a look at the **Layers Bar.** Opening the trace layer shows that each of the 9 colors not only has those shapes joined together, but also have been named with the corresponding color:

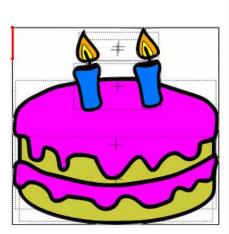

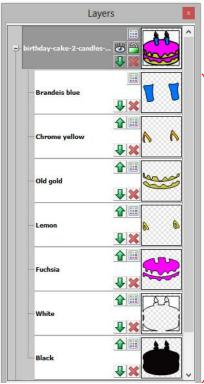

Even though **Count** was set to 15, only 7 layers/colors were traced. Note the layers are named based on the color.

If the Blackout Outlines option had not be marked, then the black layer would not be filled in:










Blackout Outlines checked

• You'll notice there's also a white layer which will always be created unless the background of the image is a color other than white. This white layer can be deleted except in situations where there are white shapes that make up the image. For example, here's an image that's been traced and it contains white:

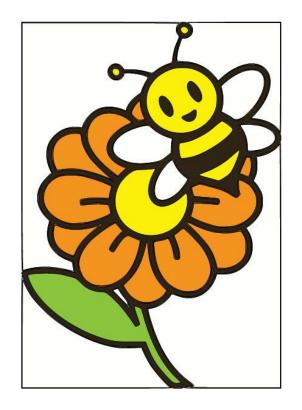


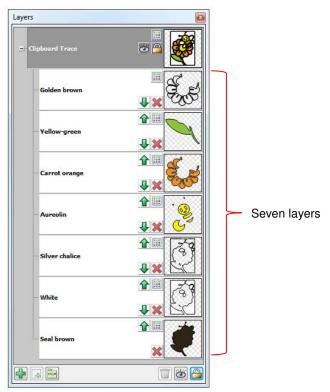

• It also contains a layer called Silver Chalice and another called Golden Brown. Before separating the various layers, you can also just try deleting the ones you feel you don't need. If you don't lose anything visually, then you know you don't need that layer. Just watch carefully in case it happens to be something small.

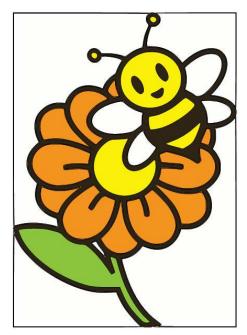


Traced image

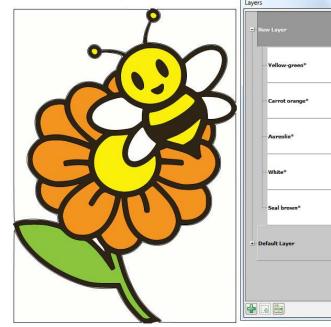

Traced image after deleting Silver Chalice and Golden Brown layers – no difference!

• Now, move the White layer aside so that you can edit out everything but the bee's wings. Use Break so that individual paths can be selected:

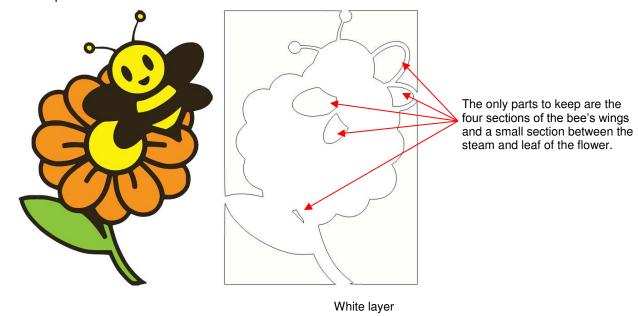

After breaking and deleting, those five white parts can be rejoined and added back to the image:




#### **Stack Scans**

• The **Stacked Scans** feature affects what parts of the image are traced and assigned to each layer. In certain printing applications, it would be advisable to have this function checked when doing a pixel trace in order to get a higher quality result for the printout. On the other hand, for most paper piecing applications, you wouldn't want to use this because you might miss out on specific parts you want to cut out. The easiest way to understand how this feature affects the tracing is to just look at what happens. The following example, in which a well-known logo will be traced, shows the effect of **Stack Scans**:



• After tracing the layers are separated. Note the differences in what is created:


Stack Scans not checked

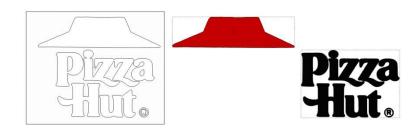

Stack Scans checked



While the Stack Scans function was developed for certain printing applications, paper crafters may find
it useful for some paper piecing projects. For example, using Stacked Scans to trace a simple image of
a basketball will eliminate the need to individually adhere all of the sections of the basketball onto a
black background. Instead, a single black overlay can be cut and laid on top of a single orange piece:

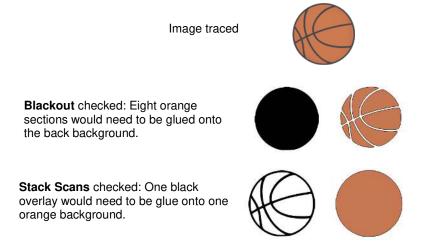

#### **Grayscale Option**

- The **Grayscale Option** introduced with version 4.6 converts imported raster images into the closest of 256 possibly shades of gray, based on the number of colors selected. It is well suited for photos or paintings.
- When selecting a photo for the **Grayscale** application, look for a solid color background and bright lighting on the subject you wish to trace. Here are examples of a good choice and a poor choice:




Will work well: solid background, good lighting



Will <u>not</u> work well: busy background, object in front of face, poor lighting


• Import the photo and select the **Color Scans** option. Because you will most likely be layering your cuts, mark the **Stacked Scans** option. Then start with a count of 2 and work upwards, comparing each trace to determine which is desirable. Remember that with increase in count, a new layer of cutting will be required:

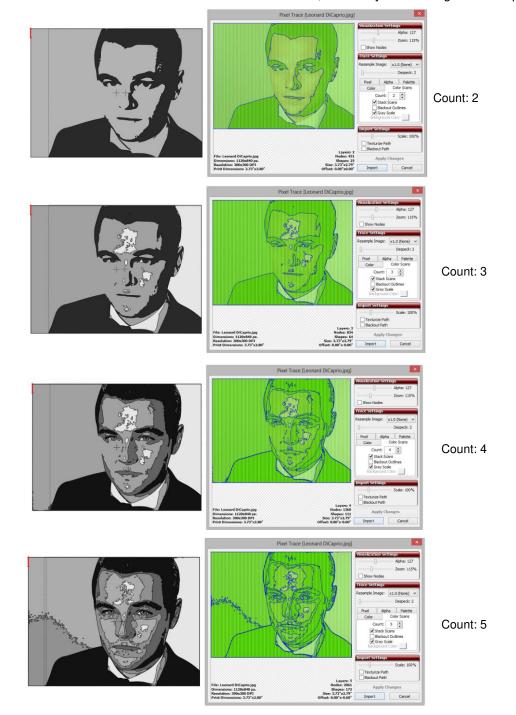


- The last two screenshots have the detail, but until the Despeck setting is applied, it's not clear which one might be best. Remember that any tracing can be edited, so large unwanted paths, such as the background in the lower left of the last scan, can be easily removed after the completion of the tracing process. Be sure to read relevant sections of *Chapter 7*.
- In the next two screenshots, **Despeck** has been set to 20:



• It is decided that the simplicity of the one with a Count of 4 looks better. But there are some touchups required:

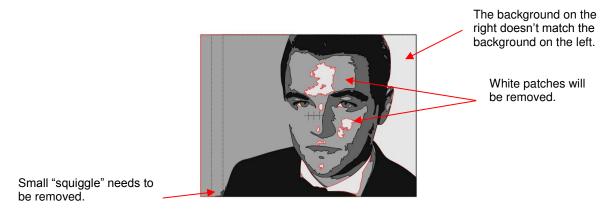

After editing, we have the final grayscale trace of Leonardo DiCaprio:

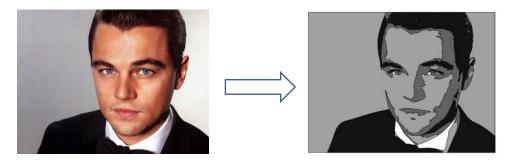

## 6.04 Manual Tracing

• There are two ways to manually trace an imported image in MTC:


- Using the **Draw Freehand Lines** tool (**Pencil Tool**) (refer to *Section 7.10*): If you own a graphics tablet and enjoy freehand drawing, you may find this method workable for manual tracing. It's not covered in this tutorial because it's fairly simple to freehand draw lines and curves as presented in *Section 7.10*. But unless you have a very steady hand, your tracing will probably require considerable node editing if you want smooth curves in the final design.
- Using the Draw Bézier Curves and Straight Lines tool (Bézier or Pen Tool) (refer to Section 7.12): Review this section and practice using the tool to draw both straight lines and curves before attempting to repeat the steps shown in the following tutorial.

#### Importing an Image for Manual Tracing

- Raster images can be imported using either **Pixel Trace** (refer to *Section 6.03*) or as **Texture** filling a shape (refer to *Section 3.14*). The former method will be presented here.
- Click on the Pixel Trace icon and browse to locate the image you want to trace. You can also scan in an
  image or paste an image that has been copied to the Windows Clipboard. In this tutorial, the dress image
  from this web site will be used:

#### http://houseofstirfry.com/chia/templates/dress01.html


- Note that this dress could easily be pixel traced but because it provides a great example of how the Bezier curves can be drawn to fit a shape such as this, it will be used for the manual tracing example!
- Instead of making changes to settings in order to automatically trace the image, set the Threshold to 255 on the Pixel tab and mark the Texture Path box. Click on Apply Changes and the entire window will fill with green indicating a rectangle around the image will form the trace line:

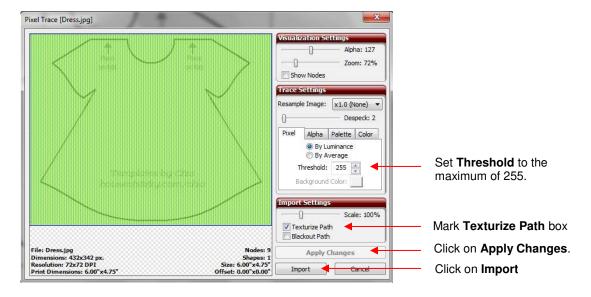

• Click on **Import.** Answer **No** when asked if you wish to trace more layers. The image will appear on the screen. Be sure to change your mat color to **Contrast** on the **Virtual Mat** tab (refer to *Section 3.04*) and also select either **Fill** or **Fill/Outline** so that you can clearly see the image:



One little additional tip: when manual tracing and editing, it can often be troublesome if you inadvertently
click on and select the imported image. A way around this issue is to have the import image on one page
and perform the tracing on another page. But first, you want to make the imported image visible on other
pages. To do this, right click on the current page containing the imported image and select Visible:

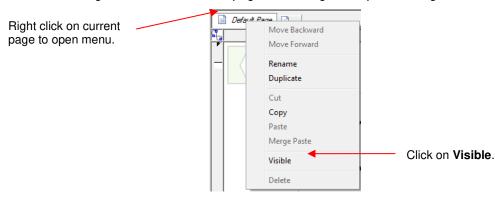

Now click on the icon to add a new page and you will see the imported image clearly on the screen but not be able to inadvertently select it:




The image will now be slightly grayed, but still distinct enough for tracing.

## Manual Tracing Using the Bézier Curves and Straight Line (Pen Tool)

Simple: Video Intermediate: Video


- As mentioned at the beginning of this section, you will want to read Section 7.12 to learn how to comfortably and successfully use the **Pen Tool.**
- Now, the best method for tracing a symmetrical image is to only trace one half. Then you can make a mirror
  image copy and weld to the origin to create a perfectly symmetrical shape. This is what will be done in this
  case because the dress is symmetrical.

• Before beginning the trace, take note of how many changes in curves and straight lines exist. This will help you understand where you will be beginning and ending paths as you trace:

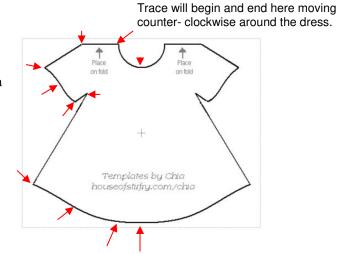


Red arrows indicate where a change in direction or curvature occurs and where a new path begins.


- The process guidelines are as follows:
  - Left click once to plant a node. Right click to end a segment and plant the end node.
  - A series of straight line segments can be made, one right after another, without needing to right click.
  - Curve segments can also be created, one after another, although it may be difficult to get the curves to look exactly the way you want. For this reason, it is often easier to end each new curve by right clicking before starting the next segment.
  - After ending a segment, you can left click in that same spot where the last one ended to begin the next segment. The new segment will automatically connect to that last node.
  - You do not need to end a straight line segment before adding a curve segment. After left clicking to plant the last node for the straight line segment, click and hold the left mouse button at the point where that next curve segment should end and drag the mouse, as needed, to form the curve that fits the image. With the left mouse button <u>still held down</u>, right click to end that curve.
  - When you reach the original starting point and right click on it, the shape will fill with color and you will have a closed path, in spite of starting and stopping along the way.
- Now to show this process in more detail:
  - Trace the straight portion as show:




Now, to do the first curve, go to the point at which the curve ends, hold down the left mouse button and drag the mouse so that the curve matches up with the dress. Then, while still holding down the left mouse button, right click to end the segment:

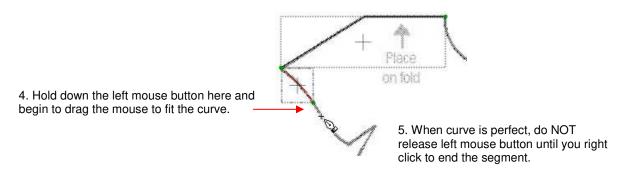


Next, left click where the last curve ended, move to where curve will end, hold down left mouse button and drag to form curve. Immediately right click to end that segment:

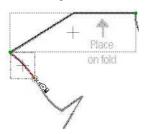

6. Left click on top of where the last segment ended.

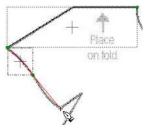


7. Hold down right mouse button at end of next segment.

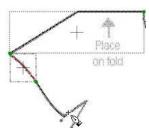


8. Drag mouse to fit curve and then right click before releasing left mouse button.


Now there are two more straight line segments, so just left click at each one. Then, again, move to the end of the next curve, hold down left mouse button and drag to fit the curve and then right click to end:




7. Left click on top of last segment end and then left click at top of inner sleeve.



8. Left click at bottom of dress.




9. Hold down left mouse button and drag to fit curve of dress.




10. Right click while still holding left mouse button to end the segment.


Start and end another curve segment to finish bottom curve of dress. Then do another short straight segment along bottom, followed by a long segment up center of dress::



11. Left click on top of last segment end and then hold down left mouse button where curve ends.



12. Hold down left mouse button and drag to fit curve of dress. Right click to end.




13. Left click where last segment ended and click again to finish straight part of dress bottom.



14. Left click at top of dress.

Finally, hold down left mouse button at top where initial trace began. Drag mouse to create the neckline curve. While left mouse is still held down and extended out to form the curve, right click to end the segment and then release mouse button. The final right click will close the shape and the dress will fill with color:



15. Move to top and hold down left mouse button over original starting point.




16. Drag mouse up to fit curve of dress neckline.




17. While still holding left mouse button down, right click to end the trace. Dress fills with color.

#### Flip/Mirror and Weld to Complete Symmetrical Shapes


• The final step to complete the dress involves making a mirror image copy and then welding it. Select the dress and do a **Copy/Paste in Place**. Then, immediately click on the **Mirro**r tool. (If the line of symmetry were horizontal, then you would click on the **Flip** tool). Then use the arrow keys to move the symmetrical copy to overlap as desired and perform the **Basic Weld**:



Copy dress trace and Paste in Place



Apply Mirror tool

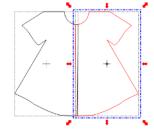

Move copy to overlap dress trace



Apply Weld tool

## 7. Editing


#### 7.01 Separating and Combining Shapes

#### **Split**


- The **Split** function is used to break up combined shapes into individual shapes, but keep inner paths joined to their respective outer paths. Sometimes the outer paths are called parent shapes and the inner paths are called child shapes.
- After selecting a combined shape, the **Split** function can be accessed in any of the following ways:
  - Click on the Split icon on the Magic Toolbar




- ♦ Press Ctrl+P
- ♦ Right click on the screen and choose **Shape Magic>Split** from the menu
- ♦ Go to Edit>Shape Magic>Split.
- As was shown in *Section 5.04*, if you apply **Split** to a word such as "Bob", the child shapes inside the letters "B", "o", and "b" are still a part of the parent shapes:



- Three things will let you know that the child and parents shapes are still joined to one another:
  - ♦ There are no individual bounding boxes around the child shapes, only around the individual parent shapes.
  - You can see the grid lines of the Virtual Mat inside the child shapes, indicating those are empty spaces:
  - ♦ If you move one of the letters, the child shape moves with the parent shape.
- The same is true when you open a file and discover that all of the parts are combined as one shape. First
  apply the Split function to see if the file will then be broken into the combined shapes that make the most
  sense. For example, the following SVG file (<u>Cupcake Seashells by Judy Keating</u>) is imported into MTC:

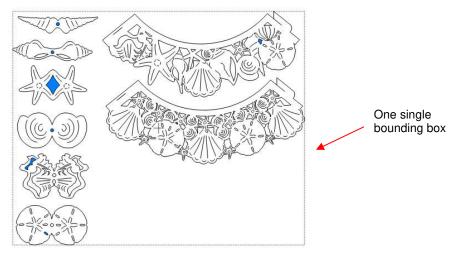

• The file imports as a single shape. But once **Split** is applied, there are 8 individual shapes which can then be individually moved, resized, re-colored, assigned to separate layers, etc.:

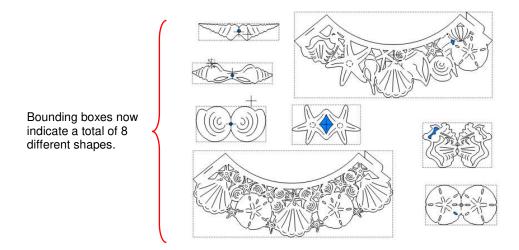


#### **Break**

- The **Break** function is used to separate every path, every curve, and every line into its own individual shape.
- After selecting a combined shape, the **Break** function can be accessed in any of the following ways:
  - ♦ Click on the Break icon on the Magic Toolbar



- ♦ Press Ctrl+B
- ♦ Right click on the screen and choose **Shape Magic>Break** from the menu
- ♦ Go to Edit>Shape Magic>Break.
- If the **Break** function is applied to the "Bob" example used in the earlier section on **Split**, the child shapes then have individual bounding boxes and they fill will color. This indicates that the child shapes are no longer joined to their parent shapes:



Once you apply Break, you have complete editing control over every individual shape within a design. But
be careful! It's also easy to inadvertently move an individual shape (especially the tiny ones) and you can
risk messing up the design. So, only use Break when needed and then, most importantly, know how to
rejoin your shapes, which is covered in the next section.


#### Join

- The **Join** function is used to combine individual paths, curves, and lines into a single shape. This is basically the opposite function to **Break**.
- After selecting two or more shapes, the **Join** function can be accessed in any of the following ways:
  - $\Diamond$  Click on the Join icon on the Magic Toolbar



- ♦ Press Ctrl+J
- Right click on the screen and choose Shape Magic>Join from the menu
- ♦ Go to Edit>Shape Magic>Join.
- If the **Join** function is applied to the "Bob" example in the above section on **Break**, the word will now become all one shape and even the individual letters can no longer be selected:

The grid is visible again inside the inner parts of the letters.



Another reason to apply **Join** before cutting is to control the order of the cutting. A child shape, which is
joined to a parent shape, will always be cut before the parent. This provides stability to the cutting. If you
were to cut the other way around, where the outside parent shape is cut first, this shape would be more
likely to come loose from the mat when followed by a child shape being cut.


#### Layer

# Video

- The Layer function is in-between Split and Break in terms of what it does. But it can also perform a Join function at the same time! Follow the examples carefully.
- After selecting a combined shape, the Layer function can be accessed in any of the following ways:
  - Olick on the Layer icon on the Magic Toolbar




- ♦ Press Ctrl+L
- ♦ Right click on the screen and choose **Shape Magic>Layer** from the menu
- ♦ Go to Edit>Shape Magic>Layer.
- For example, let's use the "Bob" example above, after we applied the **Join**, which resulted in a single shape. Applying the **Layer** function will initially seem to have performed the same function as **Break**:




However, the big difference is this: If you apply Break to "Bob", you end up with seven individual shapes (one for each outer parent shape plus one for each inner child shape). If you apply Layer to "Bob", you end up with only two shapes (the three outer parent paths are joined as one shape and the four inner child shapes are joined as a second shape). In this example, one shape is moved away from the other to show what makes up each of these new separate shapes:



• A different result occurs if we go back to the "Bob" example in which the word has been **Split** first and then apply **Layer**. Again, it looks similar to the results of a **Break**:




 This time, instead of getting two individual shapes, we end up with six (one for each parent path plus one for each inner <u>set</u> of child paths). The difference is that that two inner child paths inside the letter "B", remain joined as one shape:




#### **Blackout**

- The **Blackout** function deletes all child paths from their parent paths.
- After selecting a shape that contains one or more child paths, the Blackout function can be accessed in any
  of the following ways:
  - ♦ Click on the Blackout icon on the Magic Toolbar
  - ♦ Press Ctrl+R
  - ♦ Right click on the screen and choose **Shape Magic>Blackout** from the menu
  - ♦ Go to Edit>Shape Magic>Blackout.
- In the prior "Bob" example, it doesn't matter if you have **Split** the text into individual letters or the text is still one shape, the same result occurs using **Blackout**. The inner child paths are deleted:

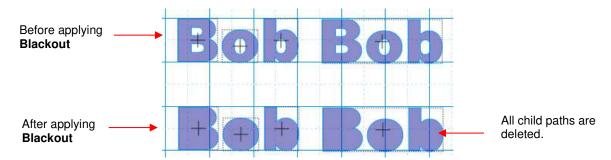

What happens if there are nested child paths?

# Before applying Blackout: Rings have been joined together to create one shape. 2 shapes (an inner ring and an outer ring) 4 individual circles stacked

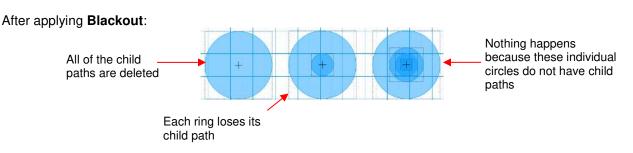


#### 7.02 Shape Magic Advance Part 1: The Simplify Functions

#### 7.02.1 Auto Simplify Paths

- The Auto Simplify Paths function is an on/off feature which should be turned on when MTC is installed. Its
  purpose is to continuously reduce the number of nodes after other functions are applied, so that a design
  will cut smoothly and quickly to a cutter.
- Auto Simplify Paths can be accessed in the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar and select Auto Simplify Paths
  - ♦ Right click on the screen and choose **Shape Magic>Advanced>Auto Simplify Paths** from the menu
  - **♦ Go to Edit>Shape Magic> Advanced>Auto Simplify Paths.**
- Most of the time, this function can be left on. However, if you are extensively editing an image, such as
  using the Eraser function over and over on the same selected shape, then it may be necessary to turn off
  this feature. Repeated applications of the Auto Simplify Paths will begin to distort the shapes. So, as
  recommended in later sections of this chapter, turn it off, and then the following Auto Simplify Path can be
  applied once the editing is completed.

#### 7.02.2 Auto Simplify Path

- The Auto Simplify Path function can be applied when you have turned off Auto Simplify Paths. Select the shape(s) and then apply Auto Simplify Path in any of the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar and select Auto Simplify Path
  - ♦ Press Ctrl+Shift+Z
  - Right click on the screen and choose Shape Magic>Advanced>Auto Simplify Path from the menu.
  - **♦ Go to Edit>Shape Magic>Advanced>Auto Simplify Path.**
- The function will be automatically applied and a window will open indicating the results of the simplification. Here is a sample window:

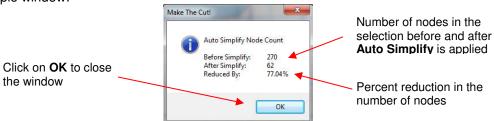


• If not enough nodes are deleted, then try temporarily decreasing the size of the shape. Use the scaling method shown in *Section 3.13* to reduce the size of the shape to, say, 25 %. Apply the **Auto Simplify Path** function. Then resize using the reciprocal, 25%r, to return to the original size.


#### 7.02.3 Smooth & Simplify

- The **Smooth and Simplify** function is a manual version of the **Auto Simplify Path** function in which you can choose how much simplifying will be applied. Select the shape and then open the **Smooth & Simplify** window in any of the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar and select Smooth & Simplify
  - ♦ Press Ctrl+Shift+J
  - Right click on the screen and choose Shape Magic>Advanced>Smooth & Simplify from the menu

- ♦ Go to Edit>Shape Magic>Advanced>Smooth & Simplify.
- The following window opens with settings which can be adjusted as desired. Adjustments will be reflected in the preview so that distortions of the image can be avoided:

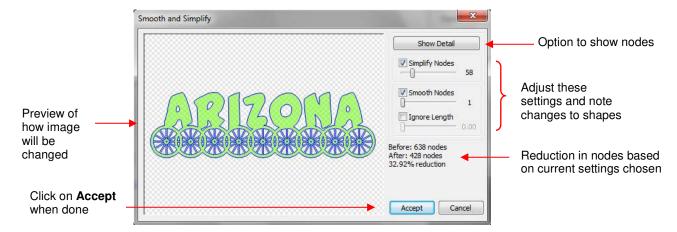

• The **Ignore Length** option can be used to control the amount of smoothing applied to an image. For example, in the following image of a very angular apple, the higher the setting for **Ignore Length**, while holding **Smooth Nodes** at a constant value, the more rounding of the shape:

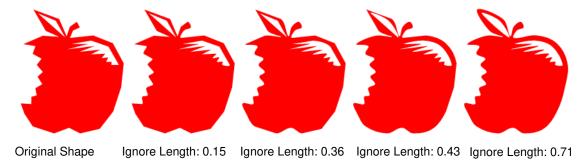


- In general, the **Smooth and Simplify** function is not used because of the two easier functions (**Auto Simplify Paths** and **Auto Simplify Path**) which were both added to MTC after this function was introduced.
- If **Simplify Nodes** doesn't reduce the nodes significantly, then try reducing the size of the image, as described at the end of the **Auto Simplify Path** section.

#### 7.03 Shape Magic Advance Part 2: Details


#### **View Path Detail**

- The **View Path Detail** function is used to provide information about the selected shape or shapes, as well as indicating the order in which shapes will be cut. It can be accessed in the following ways:
  - ♦ Click on the **Advance** icon on the **Magic Toolbar** and select **View Path Detail**
  - ♦ Press Ctrl+Shift+X
  - Right click on the screen and choose Shape Magic>Advanced>View Path Detail from the menu
  - ♦ Go to Edit>Shape Magic>Advanced>View Path Detail.
- Once selected, the following window opens:

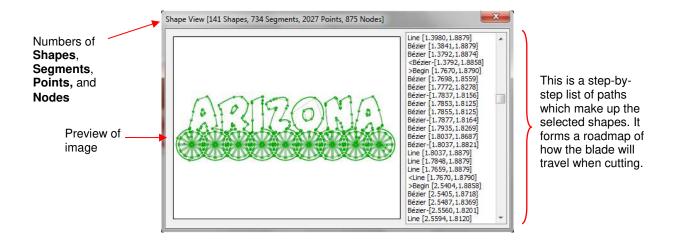

#### **Nodes on Mat**

• The **Nodes on Mat** function is an on/off feature which will be turned off when MTC is first installed. When turned on, the nodes on all shapes will be shown on the screen:




- Nodes On Mat can be accessed in the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar and select Nodes On Mat
  - ♦ Press Ctrl+Shift+I
  - Right click on the screen and choose Shape Magic>Advanced>Nodes On Mat from the menu
  - ♦ Go to Edit>Shape Magic>Advanced>Nodes On Mat.
- To view the order in which shapes will be cut, click on the top line on the right side to highlight it. The location of that starting cut will appear on the shape on the left side. Next, press and hold the down arrow key on your keyboard. There is no way to actually control the order in which shapes cut. As of Version 4.3, shapes will automatically cut in order from right to left.

#### 7.04 Shape Magic Advance Part 3: The Path Functions

#### **Flatten Paths**

- The Flatten Paths function removes all Bézier curves from a shape. It is very seldom used because other
  functions perform it automatically as needed. The one time you might need it is when resizing a bounding
  box that extends beyond the boundaries of a shape. The Flatten Paths feature will resize a bounding box
  to align with the true width and height of the image.
- For example, import the **Heart 1** shape from the **Generic** folder in **Basic Shapes**:




- These gaps do not pose a problem except in some circumstances, such as:
  - ♦ If you are trying to align the top, left, or right sides of this heart with another shape or shapes. Because of the gaps, you wouldn't be able to use the alignment functions from *Section 3.15*, with the exception of the bottom alignment.
  - If you needed the heart to be a specific size, for example, exactly 1" in height. The bounding box for this heart is 1" tall, but clearly the heart is significantly shorter than that.
- To refit a bounding box, select the shape and then the **Flatten Paths** function can be applied in any of the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar



and select Flatten Paths

- ♦ Press Ctrl+Shift+F
- ♦ Right click on the screen and choose Shape Magic>Advanced>Flatten Paths from the menu
- **♦ Go to Edit>Shape Magic> Advanced>Flatten Paths.**
- The heart now appears with the bounding box aligned:




Because the Flatten Path command adds a substantial number of nodes, it is advisable to follow up this
function with the Auto Simplify Path function presented in Section 7.02.2.

#### **Thin Paths**



The Thin Paths function is used to convert a shape into a single line or curve. This is useful in rhinestone
designing for converting thin fonts into single line fonts. It can also be used after tracing a black and white
line image (aka coloring book image) such as this wolf image:

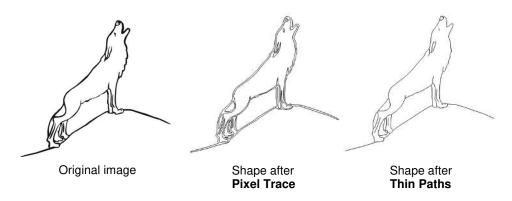

- After selecting the shape, **Thin Paths** can be applied in any of the following ways:
  - ♦ Click on the **Advance** icon on the **Magic Toolbar**



and select Thin Paths

- ♦ Press Ctrl+Shift+K
- ♦ Right click on the screen and choose **Shape Magic>Advanced>Thin Paths** from the menu
- ♦ Go to Edit>Shape Magic> Advanced>Thin Paths.

#### Fuse n' Weld

- The **Fuse n' Weld** function is used to remove duplicate shapes in the same path and also join nodes together that are on top of one another. This is mostly commonly used when importing certain file formats in which there can be hundreds of small disconnect paths making up the shape.
- As an example, let's say we have several disconnect straight lines paths:
- To connect these, we need to first make sure the gaps are very small. To that, we will select the line segments and resize to say 10% using the method shown in *Section 3.13*. In other words, make sure the **Aspect Ratio** is locked and type in 10% in the **W**: setting box:




- Once the line is resized, click on the **Join** icon on the **Shape Magic** toolbar to join the segments and then the **Fuse n' Weld** function can be applied in any of the following ways:
  - ♦ Click on the Advance icon on the Magic Toolbar and select Fuse n' Weld
  - ♦ Press Ctrl+Shift+M
  - Right click on the screen and choose Shape Magic>Advanced>Fuse n' Weld from the menu
  - ♦ Go to Edit>Shape Magic> Advanced>Fuse n' Weld.




- For closing tight gaps, such as in this case, slide the Tolerance to the maximum and click on Apply.
- To resize the selection, type in 10%r into the **W**: setting, so that the reciprocal will be applied and the line will be resized to its original width.

#### **Reverse Paths**

- The Reverse Paths function is used to change the direction of a cut. This is not a commonly used function but can sometimes fix cutting issues with some files.
- To see the direction of a cut, press F10 to open the Measure Tool on the Node Mode toolbar. Move your
  mouse over a shape and it will fill with stripes. A green arrow will point in the direction of the cut. In the
  following example, the cut will proceed counterclockwise around the shape:

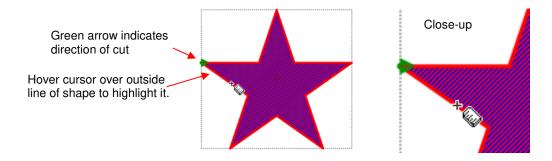

- Reverse Paths can be accessed in any of the following ways:
  - ♦ Click on the **Advance** icon on the **Magic Toolbar** and select **Reverse Paths**
  - Alight click on the screen and choose Shape Magic>Advanced>Reverse Paths from the menu
  - **♦ Go to Edit>Shape Magic> Advanced>Reverse Paths.**
- Applying **Reverse Paths** to the above example will cause the arrow to now point downwards and the cut will proceed clockwise around the shape:

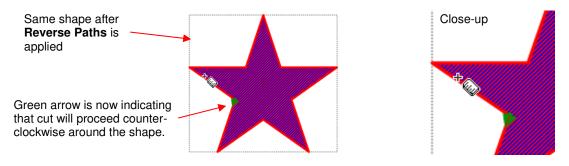

• Refer to Section 7.08 for additional uses for the **Measure Tool**.

### 7.05 Shape Magic Advance Part 4: Tiler




- The **Tiler** function is used to split a shape or selection of shapes into smaller sections for cutting.
- In the following example, it is assumed that you wish to cut a 58" wide design (such as the one below) but your cutter only has a maximum 14" cutting width (such as the KNK Zing).




- After selecting the shape, the **Tiler** function can be accessed in the following ways:
  - ♦ Click on the **Advance** icon on the **Magic Toolbar**



- ♦ Press Ctrl+Shift+N
- ♦ Right click on the screen and choose **Shape Magic>Advanced>Tiler** from the menu
- **♦ Go to Edit>Shape Magic> Advanced>Tiler.**
- The following window will open with a set of default settings:

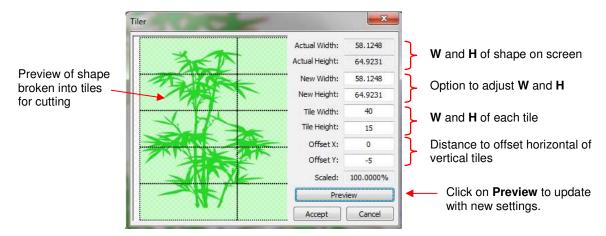


Only the Tile Width must be set to something less than 15" since the cutter can handle 14" wide cutting. For
this example, the Tile Width will be set to 13.5". Note that it is assume that the cutter can cut long sections
of vinyl at one time, so the Tile Height will be set slightly larger than the height of the shape. Also there is
no need to have an Offset yet, so it is set to 0:

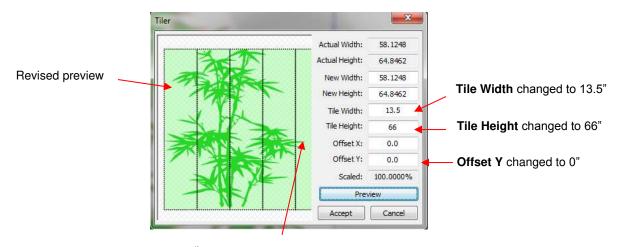

5<sup>th</sup> tile only has a tiny part of a leaf!

• Everything looks fine except for the last tile in which there's only a fraction of a leaf. This wouldn't be an economical use of the vinyl. Thus, the settings could be adjusted just a slight amount so that only four tiles will be cut instead of five. There are several options: 1. The **Actual Width** of the image could be made slightly smaller, 2. The **Tile Width** could be made slightly larger, or 3. A combination of both:

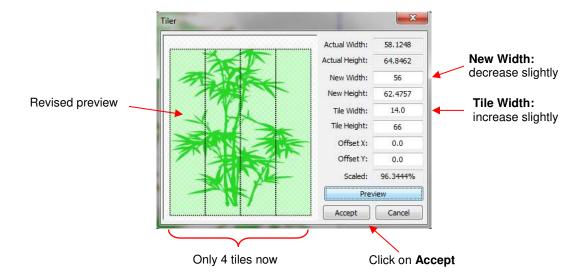


The individual tiles are placed on new Pages on the Page Bar:



# 7.06 Node Mode Toolbar

- The Node Mode Toolbar offers tools to use for editing shapes, drawing lines and curves, importing from the Basic Shapes library, and a number of other functions. This toolbar can be activated in any of the following ways:
  - ♦ Click on the licon in the upper left region of the screen as shown in Section 4.01.
  - ♦ Press F1 or W
  - ♦ Go to View>Node Mode.
- The **Node Mode Toolbar** appears along the left side of the screen. The following screenshot shows the function of each tool and section number detailing this tool. Note that three of the functions are presented in *Chapter 8* because they are related to designing, rather than editing:

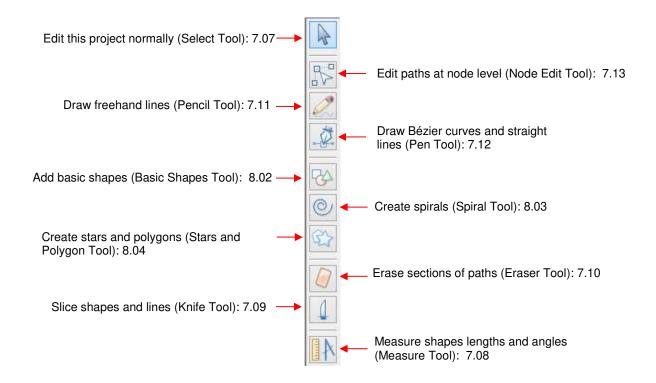

# 7.07 Edit this Project Normally (Select Tool)

• The **Edit this Project Normally** function (**Select Tool**) is the 1<sup>st</sup> icon on the **Node Mode Toolbar** and can be activated by clicking on the icon or pressing **F1**. It has one primary function which is to take you out any other function on this toolbar, thus allowing you to use the other toolbars or functions in MTC.


# 7.08 Measure Shape Lengths and Angles (Measure Tool)




- The Measure Shape Lengths and Angles function (Measure Tool) is the last icon on the Node Mode Toolbar and can be activated by clicking the icon or by pressing F10. It is used to obtain properties and details about any shape, including internal paths within that shape.
- In this example, the Measure Tool is used to note differences between these two stars:




Click on the Measure Tool icon and the mouse cursor becomes a ruler. Hover the cursor along the side of
one of the shapes. The shape will fill with stripes and the top of the screen will show the properties of that
shape, which include Perimeter (distance blade will travel), Path Area, Cut Direction, number of Nodes,
and the bounding box dimensions of the shape (W and H which should match those you see in the Sel.
Properties Bar when you are no longer in Node Mode).

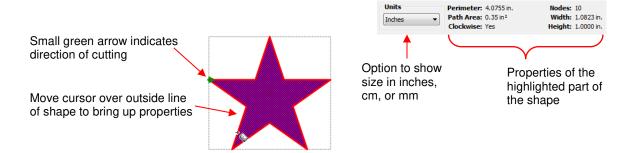


Likewise, when you hover the cursor over an outer side of the other star, the solid area of the star will fill with stripes and the properties of the outer star will be displayed. If you hover the cursor over the inner star, then the properties of that star will be displayed instead:

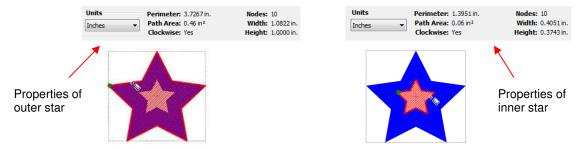


- Note that the Path Area of the outer star includes the area of the inner star. It does not subtract out that
  part of the shape. This makes sense with regards to cutting since the same amount of material would be
  needed to cut the outer star, regardless of whether or not the inner star were cut. If, for any reason, you
  needed the actual area of the larger star, then you could subtract the Path Area of the inner star from that of
  the outer star.
- To measure an angle, place the cursor at the point where the two sides of the star meet and drag outwards along one of the sides. The length and the angle of this side to the horizon are displayed. Then hold the Ctrl key and bring the mouse cursor down to the outer tip of the other side. The length of this side and the angle relative to the other side are now displayed:

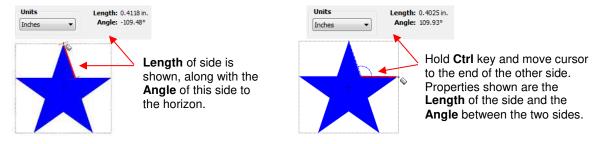

• Similarly, the **Angle** of the other star can be measured and then the full list of properties compared between the two stars:

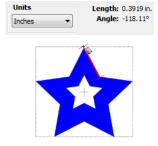


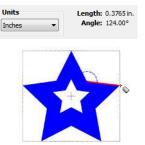


#### 7.09 Slice Shapes and Lines (Knife Tool)

- The Slice Shapes and Lines function (Knife Tool) is the 9<sup>th</sup> icon on the Node Mode Toolbar and can be activated by clicking on the icon or pressing F9. It is used to cut an existing shape or shapes along straight lines or freely drawn paths.
- For example, let's use the Secret Agent Man shape from the Basic Shapes library. Let's say you want to remove the bottom of the shape so that when cut, the shape would still be attached to the material and could be folded up:


The **Knife Tool** will be used to remove the bottom line of this shape.



• To slice off just the bottom of the shape, select the **Knife Tool** and hold down the mouse button outside of the shape on one side, just barely above the bottom of the shape and then drag the mouse over to the other side, letting go once the cursor is outside of the shape:

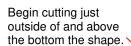






Drag the mouse to the other side and let go when the cursor is beyond the shape border.

Then click on the Select Tool (Edit this project normally) at the top of the Node Mode Toolbar.
Now you can select and move the cut line away from the bottom of the shape and delete. The shape no longer has a connecting line along the bottom:





Shape is open at the bottom.

# 7.10 Erase Sections of Paths (Eraser Tool)




# <u>Erasing</u>

- The **Erase Sections of Path** function (**Eraser Tool**) is the 8<sup>th</sup> icon on the **Node Mode** toolbar and can be activated by clicking the icon or by pressing **F8**.
- Use this tool to erase parts of a shape as well as adding to a shape. To erase, drag the left mouse button and the shapes beneath that drawn path will be deleted. For a straight line erasure, press the **Ctrl** key while dragging your mouse.
- Important! Before using the Eraser tool for extensive changes to an image, turn off Auto Simplify Paths. Otherwise, the shape will begin to lose its form as the simplify process is applied repeatedly. To do this, right click on the screen and choose Shape Magic>Advanced>Auto Simplify Paths from the menu (or refer to Section 7.02.1 for the other methods). Then, after you have finished using the Eraser tool, apply either the Auto Simplify Path or Smooth and Simplify functions to reduce the number of nodes for smoother cutting. Refer to Sections 7.02.2 and 7.02.3.
- The flower that was traced in *Section 6.03* will be used to illustrate the **Eraser Tool**. The flower will be recolored blue so that the red eraser lines, in the screenshots, will be easier to see in this user manual. The arrows indicate the areas that need to have some of the blue layer erased:





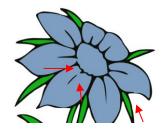

When using the Eraser Tool, all layers will be erased in the location where the eraser is applied. So, to
avoid erasing the black layer when erasing the blue, the black layer needs to be hidden. Select that layer

and press the **Selection to Own Layer** icon at the bottom of the **Layer Bar**. Then hide the black layer by pressing the **Hide Layer** icon


After hiding the layer, the icon will change to a closed eye.




• Zoom in close so that you'll be able to see exactly where you need to erase. When you activate the **Eraser Tool**, the following settings will appear at the top of the screen:




 Hold down the left mouse button and drag the mouse in a small line where you want to erase. A red line will be drawn and, when you release the mouse button, the portion of the shape beneath that red line will be erased:



Shape needs to be erased so that this petal matches the others




Drag mouse along path to be erased. A red line will appear as you drag.




Release mouse and path under the red line is erased.


- If the line was too thick and you erased more than you wanted, then use the **Undo** button (or **CtrI+Z**) to back up a step. Then enter a smaller **Erase Size**. If not enough was erased, then increase the **Eraser Size** and go over your path again with the thicker eraser.
- Apply the Eraser tool to the other two areas of the yellow petals. In the next example, one of the petals
  needs to be separated from the center of the flower:




Petal is connected to center of flower.



**Eraser Tool** is used to disconnect.




**Eraser Tool** is used again to smooth edge of petal and around center of flower.



Petal is now separated from center of flower.

• In this last example, one of the petals sticks out a little too far and will be trimmed back. On the second erasure, the **Ctrl** key is held down so that the red line will be perfectly straight:

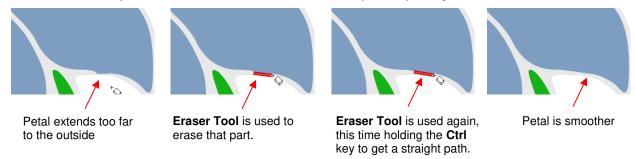

• Once you have finished erasing all part of the petals, click on the **Select Tool** so that you have access to the regular MTC functions. Select the petals and apply the **Auto Simplify Path** (*Section 7.02.2*) to smooth the edges where you erased and reduce the nodes. At this point, if you are finished using the **Eraser Tool**, you can now reactivate **Auto Simplify Paths**. Refer to *Section 7.02.1*.

#### **Inverse Erasing (Adding to an Image)**




• The other option in the **Eraser Tool** settings is the **Inverse Eraser** which allows you to add to or fill in empty areas of a shape. Mark that option and again, set a **Size** for using the **Eraser Tool** as a drawing tool:




Back to our prior example, the gray path around that last yellow petal represents the black shadow layer that
was hidden during the erasing process. Notice how it becomes very thin in that area where the last petal
was smoothed:




- This is a perfect application for the **Inverse Eraser**. If there were many areas around the image where the shadow layer needed correcting, it would probably be faster to delete the shadow layer that was pixel traced from the original and then use the **Shadow Layer** function in MTC to create a new one (refer to *Section 8.05*). But in this case, only that one spot seems too thin.
- Several things need to be done before using the tool. If you plan to use it for a number of spots around the shape, then again turn off **Auto Simplify Paths** (refer to *Section 7.02.1*). Note that if you are still in the **Eraser Tool** function, you'll need to click on the **Select Tool** to return to normal MTC mode.
- Next, unhide the black layer and move it down on the **Layer Bar** so that it is now behind the petals.

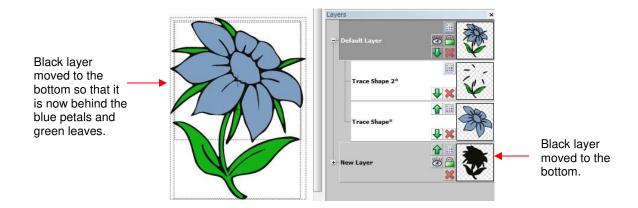


Activate the Eraser Tool, again confirming that the Inverse Eraser box is marked. Then zoom in on the
area where the black shadow was very close to the petal. Drag the left mouse button to extend that border
around the flower:

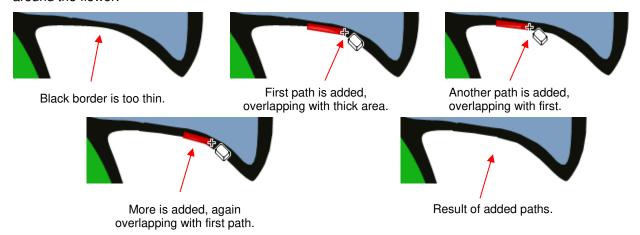


- As with the erasing process, apply the **Auto Simplify Path** function (refer to *Section 7.02.2*), if you turned off the **Auto Simplify Paths** before using this tool. Then turn on **Auto Simplify Paths**. Refer to *Section 7.02.1*.
- <u>CAUTION!</u> If using the **Inverse Eraser** and cross from one individual shape into another, this addition will not automatically be welded and, when sent to the cutter, you may end up with unwanted cut lines. For example, let's say you have a flower and there are two leaves that are not attached to the stem. You decide to use the **Inverse Eraser** to join those leaves to the stem:

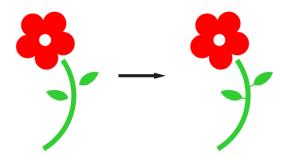

• Everything looks like it worked as you wanted but, you cut out the flower stem/leaves, the new leaf stems will cut into the larger stem. However, it appears to be what you wanted because you have **Fill** turned on. If you switch to **Outline** mode and zoom in on the leaves, you'll see this:

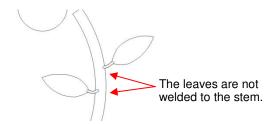

If you realize this has happened, you only need to apply the Weld tool to remove the overlapped parts:

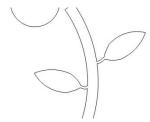


To prevent this, first select the shapes (in the case, the stem and two leaves) and apply the Join tool
 Then you can use the Inverse Eraser and the parts added will be automatically welded.

# **Eraser or Knife?**

- In Section 7.09, it was shown how the **Knife Tool** can be used to cut shapes into parts. The **Eraser Tool** can also be used for this same purpose when the **Size** is set to a very small value, such as 0.03 mm (the minimum size allowed). The differences between the two tools are:
  - ♦ The **Eraser Tool** automatically closes the paths on both sides of the erased parts:



♦ The Eraser Tool doesn't break the shape into individual shapes whereas the Knife Tool does:



♦ The Eraser Tool isn't limited to straight line cuts:



Knife Tool can only cut straight lines

Eraser Tool can cut custom paths

• If you are creating a popup card, where the tops and bottoms of the shapes needs to be deleted, then the **Knife Tool** is the better choice:



• If you are breaking up an image to create a paper piecing project, the Eraser Tool is the better choice:



# 7.11 Draw Freehand Lines

• The **Draw Freehand Lines** function (**Pencil Tool**) is the 3<sup>rd</sup> icon on the **Node Mode Toolbar** and can be activated by clicking on the icon or pressing **F3**. This tool is used to freely draw thin or thick lines with your mouse or tablet, or even draw dashed lines or a path of circles! Your shapes can then be edited using the other tools on the **Node Mode** toolbar, as well as customized using other functions in MTC.

# **Drawing Thin Lines**

There are a number of settings which will affect the outcome of your drawing. Smoothing is used to control whether the drawing is more angular (made up of straight lines paths) or rounder (made up of curves).
 Precision is used to control the number of nodes used as the image is drawn. The Force Closed option, when marked, will automatically close the beginning and the end of the path as you draw:




• For example, if you are freehand drawing the letter "A", you would want to decrease **Smoothing** and **Precision** so that straight lines are drawn. But if the same low settings were used to draw an "S", the letter would end up angular and not well-formed:



• For a curve, such as an "S", you would want to increase **Smoothing** so that no straight lines are formed. For the smoothest result, check the **Super Smooth** option:



• The **Precision** setting, as mentioned before, allows a more precise "S" to be drawn, but many more nodes will result. The following shows the difference when **Precision** is left at 0 versus 100% versus 50%:



If you need to draw a perfectly straight line, hold the Ctrl key while drawing:



• The **Force Closed Path** option can be marked so that, as you draw an image, the start and end will always be connected. For example, in this freehand drawing of a lightning bolt, the end of the line is always connected back to the beginning. Once the cursor returns to where it started, the shape will close and fill with color (assuming **Fill** is turned on):




### **Drawing Thick Lines**


 To draw a line that is set to a particular thickness, mark the Fat Path box and enter settings for thickness and Line Cap style:



When you freely draw with Fat Path selected, the line will be the thickness you selected. Note that when
you cross the path, the overlap will be automatically removed. Also note the differences in the three Line
Cap options:



Note that if a Fat Path crosses itself, the overlap will be removed:



# **Drawing with Other Line Styles**

• The **Freehand Drawing Tool** offers other line styles besides solid lines, including dashes, circles, and combinations of the two:

# Choose from Solid, Dash, Dot, Dash Dot, or Dash Dot Dot



• There are five **Dash Style** options to produce even more designing capability, especially, when then combined with the seven different start and end cap options. Here are a few examples:



# 7.12 Draw Bézier Curves and Straight Lines (Pen Tool)


• The **Draw Bézier Curves and Straight Lines** function (**Pen Tool**) is the 4<sup>th</sup> icon on the **Node Mode Toolbar** and can be activated by clicking the icon or by pressing **F4**. Use this tool to draw new paths. It can be a bit tricky to master but just like with many good things- practice makes perfect!

# **Drawing Straight Lines**

• To draw a single straight line, use your mouse to left click once where you want to start the line and then right click where you want to end the line. Each click produces a node:



• If you wish to continue drawing a connecting straight line path, then instead of right clicking to end, keep left clicking. At any point you can right click to add the last node and end the drawing of straight lines:

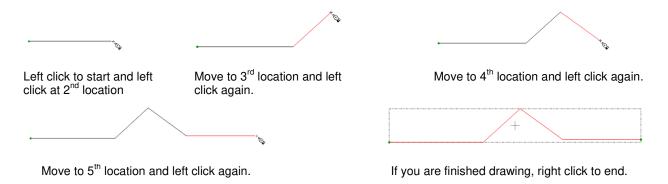

 On the other hand, if you are creating a closed path, then just as the mouse cursor approaches the starting node, the shape will fill with color and you can click one last time to end the process. You do not have to right click to end the drawing if the shape is closed:



Left click to start and then left click at 2<sup>nd</sup> location



Move to 3<sup>rd</sup> location and left click again.



As you approach the start, watch for the shape to fill.



As soon as the shape fills with color, left click to end.


Again, if the shape is closing, you can left click or right click to end the drawing of that shape. If the shape is not closing, then you must use a right click to stop the drawing of that shape.

#### **Drawing Curves**

- Drawing curves is a bit more difficult. The key is to take it one step at a time, practice the technique a lot, and remember that you can later correct your curves using the **Node Edit Tool** (refer to Section 7.13).
- To draw a curve, use your mouse to left click once where you want the start the curve. Then instead of left clicking, hold the left mouse button down and begin dragging the mouse outwards. Continue holding the left button and notice a dotted line appears with two points at either end. These are called control points:



As you drag the mouse, you'll see that you have full control over how long this dotted line will be, as well as where the control points are positioned. Experiment with longer and shorter control lines, as well as rotating the line to bend the curve in a range of different ways:

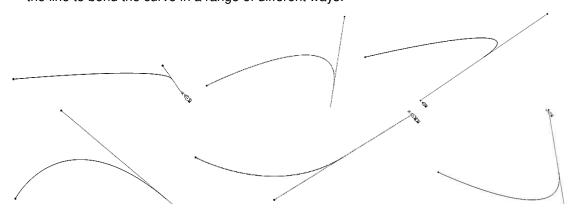

#### **Combining Straight Lines and Curves**

There are different methods for creating a continuous string of straight lines and curves. The straight lines are easy because, as you left click to plant nodes, the straight lines remain straight and do not change as you create the next connected straight line. However, once you begin creating Bézier curves, you cannot return to straight lines, without right clicking to end the curves and then beginning the next straight line from that point:



2 straight lines are drawn and then a curve is created



But then, when you attempt to switch back to a straight line, the curve becomes distorted


 Not to worry! Once the curve is complete, you can right click to end that curve and then left click in the same spot to begin a new straight line or another curve without disturbing the one just created:



• In the end, all of those points/nodes will be connected. This is a method that can be used to do manual tracing, as presented in *Section 6.04*.

#### Fat Path and Super Smooth

The Draw Bézier Curves and Straight Lines function, like the Draw Freehand Lines function, has the
option for Fat Path and Super Smooth. There are the same five Dash Style types and the same seven
options for Line Caps at the start and end of the Bezier curves/lines. Refer to Section 7.11 for examples.

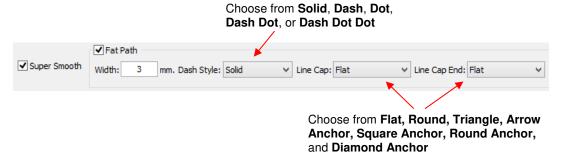

# 7.13 Edit Paths at Node Level (Node Edit Tool)



Special note: As of version 4.6, the end nodes on a selected path are displayed as squares instead of small circles. The screenshots in the following sections reflect the way nodes were displayed prior to this change.

- The Edit Paths at Node Level function (Node Edit Tool) is the 2<sup>nd</sup> icon on the Node Mode Toolbar and can be activated by clicking the icon or by pressing F2. Use this tool to edit both paths and nodes in any shape.
- Before editing paths and nodes, it is recommended that the following settings be made:
  - ♦ Nodes On Mat should be made visible by pressing Ctrl+Shift+I (or any of the other ways shown in Section 7.03)
  - Set Snap Position, on the Virtual Mat, to No Snapping, so that segments and nodes can be dragged freely
  - Set the display on the Virtual Mat, to Fill/Outline or Outline so that nodes will be visible.

### **Segment Editing**

In this section, the Tools shape from **Basic Shapes** will be used. Select the head of the hammer and then activate the **Node Edit Tool**. You will notice that as you move the mouse over the shape, whichever individual segment is beneath the mouse cursor will change to red. This is similar to how individual shapes will turn red when in the regular mode in MTC. If you left click on a segment it will turn green, unless you happen to have the green mat color selected in which case the segment will turn blue. Note that the following screenshots were made from an earlier version of MTC. Starting with version 4.6, the end nodes on a selected segment appear as blue squares, and a selected end node turns yellow. For now, these screenshots show the nodes as small black circles only:



Hovering over a segment turns it red




Selecting a segment turns it green



Selecting a segment, with a green mat, turns the segment blue

- A selected segment can now be "dragged" in the following ways:
  - ♦ Drag on the segment with your mouse to change the curvature in different ways:



Drag a segment in any direction to transform into different shapes.



Upon releasing mouse button, shape will be modified.

♦ Drag on the Bézier control points (also called handles) to also modify the shape of the segment:



Select the segment and then place mouse over control point



Drag point and shape will change



Drag other point and shape will change differently

A selected segment can be moved using the arrow keys on your keyboard. Alternatively, you can also move the segment by holding the Ctrl key and dragging the segment with your mouse:



Select segment



Use arrow keys on keyboard to move segment.




Shape is extended outwards.


 If you right click on a selected path, the following menu will open. Explanations for each options are described below:



Insert Node: a node will be inserted wherever your mouse cursor is currently positioned on the segment and the segment is now split into two segments.

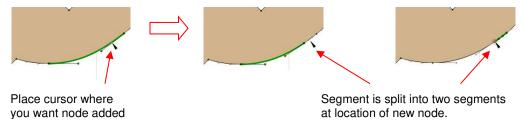

Insert Mid-Point Node: a node will be inserted exactly half-way along the selected segment and the segment is now split into two segments of equal length.

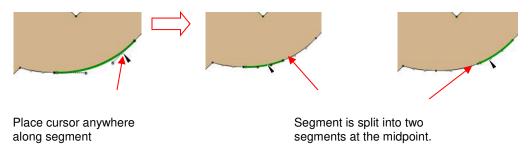

Neutralize Segment: the segment will become perfectly straight but will still be a Bézier curve with Bézier control points to maneuver. This is something of a panic button to use whenever a segment becomes extremely distorted.




♦ **Convert To Line:** the segment will be converted to a straight line and will no longer be a Bézier curve. However, dragging the line to form a curve will immediately transform it back into a Bézier curve.



Delete Segment: the segment will be erased and will leave unconnected nodes at the ends of the two paths that were connected to this segment. Note that if the shape was previously a closed shape (and Fill was turned on), it will now be an open shape with no Fill.




Auto-Smoothing: all changes to a segment will result in smoothing (curving) of this segment as well as adjacent segments. This should be turned off when segments have sharp junctures or cusps with other Bézier curves. A heart will be used to illustrate this:

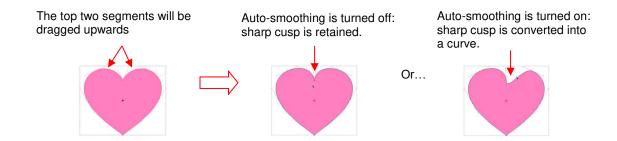


# **Node Editing**


• If you hover your mouse over one of the end nodes on a selected path, you will see it become encircled with a dotted red path. That means the node can now be edited. For example, you can drag the node to a new location and the connecting segment(s) will move as well.



Red dashed circle appears around a node as the mouse cursor is held over it



Drag the node to a new location




Segments on either side of the node are modified.


 If you right click on a highlighted node, the following menu will open. Explanations for each option are described below:




• For the sake of illustrating the node editing, the hammer claw has been modified so that there's a "bump" or warp at the intersection of two segments. Note the length and direction of the two control points:

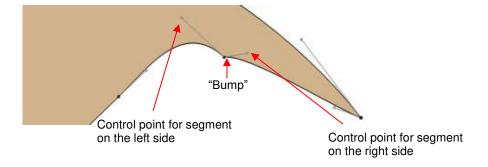

Smooth Node: The lines of the Bézier control points on either side of that selected node will align in a straight line, resulting in a smoother transition:

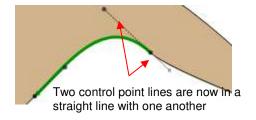


Symmetric Node: The lines of the Bézier control points on either side of the selected node will become equal in length, resulting in a smoother transition:




Two control point lines are now the same length

Delete Node: The node will be deleted and the two segments will become a single segment. The Bézier control points of the new segment will automatically adjust to try to recreate the previous path of the two segments:



♦ **Break Node:** Breaks the node into two nodes so that the segments are no longer connected. The shape is no longer a closed path, thus it will not be filled with color. The new broken nodes can be moved to different locations, if desired and reconnected using the **Pen Tool**:

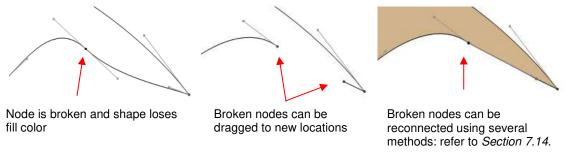

Note that you can also use node breaking to define the cutting start point of a path since, on a broken path, the blade will always start cutting where a node is not connected to any other node.

Auto-Smoothing: Same function as Auto-Smoothing under Segment Edit. It is listed again, under the Node Edit for quick access. Again, if a sharp transition needs to be maintained between the segments involved, leave unchecked. Otherwise, select this option to automatically smooth curves.

#### **Applications for Node Edit**

- It's not always obvious when the **Node Edit Tool** (for either or both segment and node editing) might be needed. Here are a few examples to keep in mind:
  - Editing of pixel traced images: Sometimes a pixel trace will appear to be perfect until, for example, you use it for a print and cut and discover that some of the paths are slightly outside the printed areas of the original image:



A node is added to break segment and segments are dragged inward.

- Manual tracing: One of the quickest ways to manually trace a raster image is to simply click/click/around the image and then use node and segment editing to move paths and nodes to more closely align with the original image and to adjust segments for smoother cutting.
- Improving a cut: If you have problems with a particular location on a cut shape, examine the nodes in that location. You may find a cluster of nodes or a sharp cusp. Edit the segment and then retest the cut.
- Modifying poorly designed files: Sometimes you will pick up free files that prove to not quite work the way you expected. Examples are often fold-up templates where corners and fold lines do not quite meet. Having the ability to move segments and nodes can perfect these kinds of designs and provide cleaner and more professional end products.

#### 7.14 Reconnecting Broken Segments



- A shape that appears closed but will not fill with color has one or more broken segments. In many cases, it's
  not necessary to close the path because often the disconnected nodes are so close to one another that a
  closed cut will still be obtained. However, you may still wish to have your shapes fill so that you can better
  see what the final design will be.
- If you cannot easily see where the segment is broken, select the **Measure Tool** from the **Node Mode Toolbar** and then hover over the shape. Because a cut will always begin at a disconnected node on an open shape, the green direction arrow will show where the cut begins, thus indicating where the segment is broken.




• There are several ways to connect open segments. The first one listed below is restricted in its application. Any of the others can be used to close one broken segment at a time.

# Using Fuse n' Weld

• If the shape has many tiny gaps where the nodes to be connected are within close proximity, then refer back to Fuse n' Weld portion of Section 7.04.

# **Using Edit Paths at Node Level (Node Edit Tool):**

• Select the broken segment and then right click on the end node that is not connected to another segment. The following menu appears:



Join Node to Closest Node: if this is selected, a segment will form between that node and the nearest node and will appear perfectly straight but will still be a Bézier curve with Bézier control points to maneuver.




Right click on end node and select **Join Node to Closest Node.** 

Ends are connected and the shape is now closed.

Bézier control points are moved to create desired curve.

desired curve.

Join Node to Closest Node with Line: if this is selected, a straight line segment will be formed between that node and the nearest node but will not be a Bézier curve. However, dragging the line to form a curve will immediately transform it back into a Bézier curve.



# **Using the Drag Freehand Lines (Pencil Tool)**

First, press and hold the Ctrl key. Then drag your mouse from one end node to another and release. The
path will close with a straight line. Return to Edit Paths at Node Level, if necessary, to drag the line to form
a desired curve.



Hold **Ctrl** key and place cursor over one of the nodes.


Use left mouse button to drag cursor towards other end node.

When cursor reaches other node, release **Ctrl** key and left mouse button.

Select **Node Edit Tool** to create desired curve.

# Using the Draw Bézier Curves and Straight Lines (Pen Tool)

Hover your mouse over one of the end nodes until a small circle appears around it. Then drag the mouse to
the other node. When you see a small circle appear around that node, right click to release and a straight
line, connecting the two nodes, will be created. Return to Edit Paths at Node Level, if necessary, to drag
the line to form a desired curve.



# 8. Designing

# 8.01 Where Do I Start with Learning to Design?

MTC offers some excellent easy-to-use designing tools to assist you in creating whatever you can imagine! The best way to learn these tools is to focus on only one at a time, watch the related video, and pause the video after each step, to repeat what you are seeing. You might want to also jot down some notes about any particular settings or tips presented in the video. Try to imagine how the same tools can be used for other kinds of designs and write down your ideas.

# 8.02 Add Basic Shapes (Basic Shapes Tool)

- The Add Basic Shapes function (Basic Shapes Tool) is the 5<sup>th</sup> icon on the Node Mode Toolbar and can be activated by first opening the Node Edit toolbar (or pressing W) and then clicking on the Basic Shapes Tool icon or pressing F5.
- This tool will access the same library of shapes found on the **Import Toolbar**, with the exception of the "**Your Shapes**" category. However, instead of double-clicking on a shape to automatically place that shape on the screen, this function allows you to hold down the left mouse button and freely drag your mouse to create the size you desire. In this example, the kite shape from the **Polygons** category has been selected:




 Holding the Ctrl key while dragging to create the shape will release the Aspect Ratio, allowing you to make the shape thinner or wider. You may need to set Snap Position to No Snapping on the Virtual Mat tab:



 Dragging from the bottom upwards (rather than from the top downwards) will automatically vertically flip the basic shape on the screen.




- Upon releasing the left mouse button, you may immediately begin drawing another of the same shape.
- This function also tracks your most recently used shapes and provides a list of them within the menu:

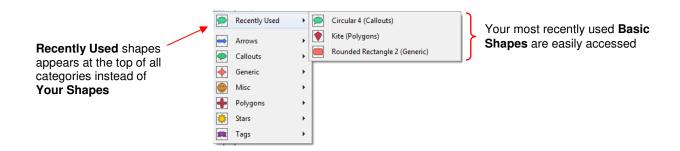

#### 8.03 Create Spirals (Spiral Tool)




- The **Create Spirals** function (**Spirals Tool**) is the 6<sup>th</sup> icon on the **Node Mode Toolbar** and can be activated by first opening the **Node Edit toolbar** (or pressing **W**) and then clicking on the **Spiral Tool** icon or pressing **F6**. This tool allows you to create spirals with as many turns as you wish, along with several other settings.
- Once you are in this function, you create a spiral by holding the left mouse button and freely dragging your
  mouse to create a spiral to the size you desire. You are using the same method as described in Section
  8.02:



 Dragging the handles clockwise or counterclockwise will change the locations of the start point and end point of the spiral:



- If you hold the **Shift** key while dragging the ending point handle, you can change the scale (overall size) of the spiral.
- If you inadvertently draw a new spiral while trying to adjust the current spiral, press the **Delete** key to remove it. If you need to move the spiral, hold the left mouse button down anywhere on the spiral (except on top of a handle) and drag to another location.
- The left side settings for the **Spiral Tool** allow you to change the **Turns** (same as dragging the ending point handle), change the **Inner Radius** (same as dragging the starting point handle), and change the **Divergence** (the distance between the turns). There is also a **Reset** button to bring back default values:

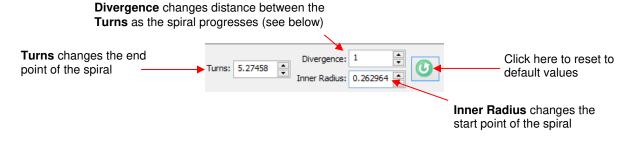

• With a **Divergence** of 1.0 (default) the distance between the turns is the same. If the **Divergence** is less than 1.0, the distance decreases as the number of turns increases. With a **Divergence** larger than 1.0, the distance increases:



**Divergence:** 1.0 Distance between all turns is the same



**Divergence:** 0.5 Distance decreases with the number of turns




**Divergence:** 3.0 Distance increases with the number of turns.

• The right side settings for the **Spiral Tool** allow you to have a **Fat Path**, control the thickness of the **Fat Path**, as well as the style of path and the end caps:




The five available Dash Styles are:



• The start and end point styles of the spiral can be changed to any of seven different line caps:



The available Line Caps are:

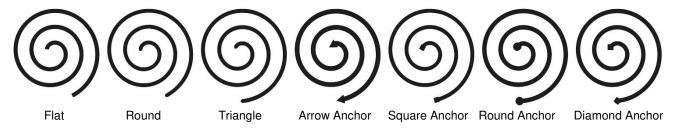

• Once a spiral is created and you click to another function, it cannot be modified further. However, the most recently used settings will be retained when you go back to the **Spiral Tool**.

# 8.04 Create Stars and Polygons (Star & Polygon Tool)




• The Create Stars and Polygons function (Star & Polygon Tool) is the 7<sup>th</sup> icon on the Node Mode Toolbar and can be activated by first opening the Node Edit toolbar (or pressing W) and then clicking


on the **Stars & Polygon Tool** icon or pressing **F7**. This function allows you to create customized stars and polygons.

# <u>Star</u>

• Once you are in this function, you create a star by holding the left mouse button and freely dragging your mouse to create a star to the size you desire. You are using the same method as described in Section 8.02:



- If you need to move the star, hold the left mouse button down anywhere on the shape (except on top of a handle) and drag to another location. If you inadvertently draw a new star while trying to adjust the current star, press the **Delete** key to remove it.
- There are several settings used to control the appearance of the star, as well as a Reset button. Examples
  of how these settings change a star are presented in detail below. Note, however, that there are thousands
  of possibilities based on combinations of these settings:

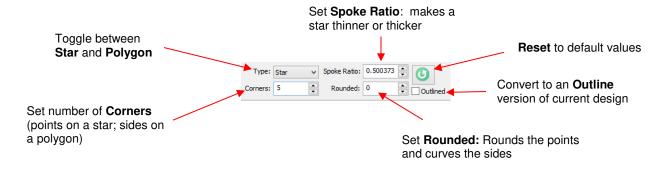


Corners: The default is five. However, the range is 3 to many. Here are a few examples:



Spoke Ratio: The range for this setting is 0 to 1.0. You can also change this setting by dragging the outer point handle inward or outward. You will see that it changes both the thickness and the size of the star. You can also rotate the star using this handle:



Dragging the <u>inner corner handle</u> up or down also changes the thickness, but not the size of the star. Dragging the handle left or right rotates the interior of the star. It also creates a far wider spectrum of design possibilities:

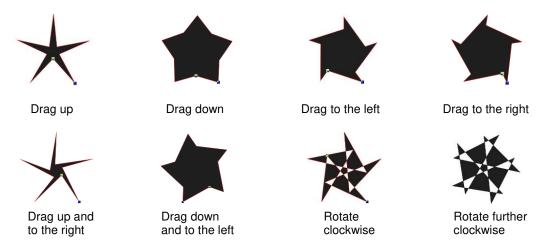

- ♦ If you hold the **Ctrl** key while dragging either handle, no rotation will occur.
- Rounded: This feature is used to curve the sides of a star. The default is 0. While you can hold the **Shift** key and drag the handle to change the value, the range is much larger (from -10.0 to 10.0) if you input values in the setting window at the top. Here are just a few of the thousands of possibilities:




Outlined: This feature removes all or part of the interior paths on a star which may result in shapes better suited for cutting:




# **Polygon**

To draw a polygon, first set the **Type** to **Polygon**. Then, holding the left mouse button, freely drag your
mouse to create a polygon at the size you desire:

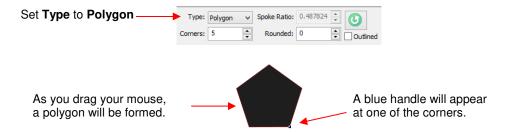

- If you need to move the polygon, hold the left mouse button down anywhere on the shape (except on top of the handle) and drag to another location. If you inadvertently draw a new polygon while trying to adjust the current polygon, press the **Delete** key to remove it.
- There are several settings used to control the appearance of the polygon, as well as a Reset. Examples of
  how these settings change a polygon are presented in detail. Note, however, that there are thousands of
  possibilities based on combinations of these settings:



♦ **Corners:** This controls how many points or sides are present on the polygon. The default is five. However, the range is 3 to many. Here are a few examples:



♦ To resize a polygon, hold the left mouse button and drag the blue handle inward or outward. You can also use this same handle to rotate the polygon, as desired:



♦ **Rounded:** This feature is used to curve the sides of a polygon. The default is 0. While you can hold the **Shift** key and drag the handle to change the value, the range is much larger (from -10.0 to 10.0) if you input values in the setting window at the top. Here are just a few of the many possibilities:



Outlined: This feature removes all or part of the interior paths on a polygon, which may result in shapes better suited for cutting:



#### 8.05 Shadow Layer




- The Shadow Layer function allows you to create an outline or an inline of any shape including, of course, text. After selecting the shape or shapes, the Generate Shadow Layer window can be opened in any of the following ways:
  - ♦ Click on the Shadow Layer icon on the Magic Toolbar




- ♦ Press Ctrl+H
- ♦ Right click on the screen and select Shape Magic>Shadow Layer
- ♦ Go to Edit>Shape Magic>Shadow Layer.

#### **Outset Shadow**

• In this example, three stars have been added to the screen from the **Basic Shapes** library and they have been colored red, white and blue:



Marquee-select the stars and then use Ctrl+H to open the Generate Shadow Layer window:

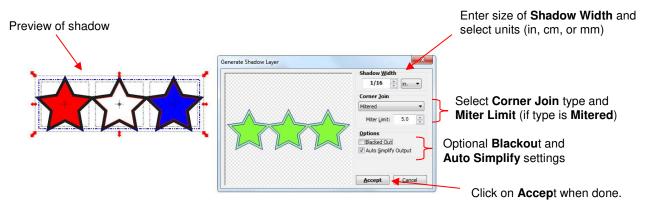

- The **Shadow Width** can be entered as a fraction (¼, ½, ¾, etc.) or as a number (1, 0.2, 0.03, etc.). Next to the input window is a drop-down menu for the units of measurement, with the option of selecting in, cm, or mm.
- Note that the shadows on the three stars will automatically weld together to form one single outline shadow and this shadow will be placed on its own layer on the **Layer Bar.** This layer can then be re-colored from black to another color, as desired:




#### **Blackout Option**

• The **Blackout Option** can be toggled on and off to either apply the shadow to interior paths or to black out the shadow and only have a single outset:



# **Corner Join Option**

The Corner Join controls the style or shape of the shadow at the corners. There are three choices:

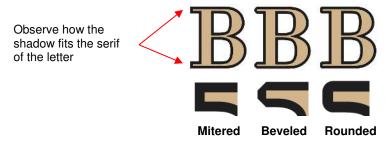

The Miter Limit affects how far the shadow layer extends at the corners:



### **Inset Shadow**

- An Inset Shadow is the opposite of an Outset Shadow instead of creating a contour that is larger than
  the original shape, a contour is created that is smaller and fits inside the original shape.
- For example, let's say you are going to create a two-color vinyl sign that says "For Sale":



• If **Outset Shadow** is used to create the second layer, the letters will automatically be welded because of their proximity to one another. This may not be suitable for your application:



Instead, create an Inset Shadow by inputting a negative number for the Shadow Width:



• The result, after re-coloring the layers:

# For Sale

# 8.06 Weld Tool


- The **Weld** tool removes the overlap between two or more selected shapes. After selecting the shapes, it can be applied in any of the following ways:
  - ♦ Click on the Weld icon on the Magic Toolbar.



- ♦ Press Ctrl+W
- ♦ Right click on the screen and select Shape Magic>Weld
- ♦ Go to Edit>Shape Magic>Weld.

# **Designing a Balloon**


In Section 5.03, the Weld tool was used to remove the overlap with lettering. It can also be used to design
everyday items from basic shapes:

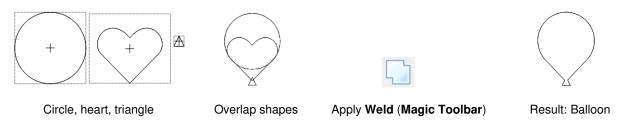

### **Designing a Border**




 Another use of the Weld tool is in designing borders. First create the shape to be repeated. A circle with a smaller circle near the top is created. Apply the Join (Ctrl+J) function to make the two circles into a single shape:







Select the shape and use Ctrl+D to initiate the Duplicate function:



Add a long rectangle to overlap the bottom and then apply the Weld tool to the selected shapes:






#### **Designing a Wreath**




• In Section 3.10.6, it was shown how to arrange a shape into a circle pattern using the **Rotated Duplicates** function. This feature opens up a world of designing possibilities. In this tutorial, we'll create a wreath using the following flourish found in the *Wingdings* font that comes with Windows:



• Select the shape and open the **Duplicates** window by right clicking and selecting **Duplicate>Rotated Duplicates**. Enter the number of flourishes you want to use in the wreath and click on the sigma icon. Then double the Rotated By setting to arrange the duplicates in an equally-space circular pattern:

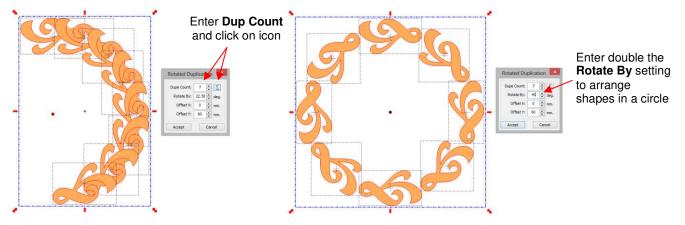

• Experiment with **Offset X** and **Offset Y** to create a design that you like! When satisfied, click on **Accept** and then click on the **Weld** function to remove the overlap:

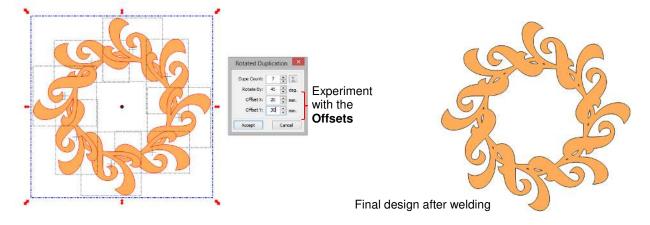

To see more examples of how the Rotated Duplicate function can be used for designing, visit this link:

http://teamknk.com/rotated-duplicate-a-reason-to-upgrade-to-mtc-4-6/

#### 8.07 Boolean Join



- The Boolean Join menu contains five welding options but it can only be applied to two selected shapes at
  one time. If you have more than two shapes, then just apply the Boolean Join to any two at a time or, in
  most cases, you can either use the Weld (Ctrl+W) function or the Join (Ctrl+J) tool first to reduce your
  multiple shapes down to two and then use the Boolean Join function needed to complete your design.
- For example, if you have text that has been **Split by Glyphs** and there are 5 letters in your word, then you have 5 individual shapes. You would need to apply either **Weld** or **Join** so that those 5 letters become one single shape. Then you could perform a **Boolean Join** with that text and some other shape to achieve your desired design. This will become clearer later in this section.
- After selecting two shapes, the Boolean Join menu can be opened in any of the following ways:
  - ♦ Click on the **Boolean Join** icon on the **Magic Toolbar**
  - ♦ Press Ctrl+U
  - ♦ Right click on the screen and select **Shape Magic> Boolean Join**
  - ♦ Go to Edit>Shape Magic> Boolean Join.
- The menu contains the following choices:

Boolean Join

A-B Difference
Remove B from A

A-B Difference
Remove B from A

B-A Difference
Remove A from B

Intersect
Bitwise AND

Exclude
Bitwise XOR

Union
Bitwise OR

Same as Weld tool

Five tools are shown with the purpose of each tool. The screen will also show the net result as you select each one.

- When you apply a Boolean Join to shapes of two different colors, the resulting shape will be the color of the shape that was on the higher layer.
- Note: There is an Auto Simplify option in the Boolean Join window. You may need to uncheck that option
  to get the desired result. For example, the Exclude Function will not perform correctly without unchecking
  that option.

#### **Cutting One Shape from Another**

- If you wish to cut one shape from another, then the **Boolean Join** menu provides the solution you need. In this example, two hearts will be cut from a title.
- First, type the word "MOM" using the font of your choice. Make sure to have "No Splitting" selected in the Add Text Group window. By doing this the text will be a single shape. Then import one of the hearts from the Basic Shapes library, resize and duplicate to create the design you want to make:




Make a third copy of the heart and set aside. After arranging the first two hearts on top of the text, select
them both and apply a Join (Ctrl+J), so that they will now be one shape. Thus, you now have just two
shapes for the Boolean Join: the text and the joined hearts:

The text forms one shape. The two hearts are now the second shape



Marquee-select the two shapes and go to the Boolean Join menu (Ctrl+U). Select the second option: B-A
Difference. Note that if the hearts had been behind the title (positioned in a lower layer than the title), then
the A-B Difference would have given the desired result.



- Select the heart you set aside and decrease in size to fit inside the cut area of the title, so that a little white border surrounds the heart. Note that with some shapes you might need to use the **Inset Shadow** function presented in *Section 8.05*.
- Make a duplicate of the smaller heart and arrange inside the other cut area. Recolor the original "MOM" text to pink (refer to Section 3.14):



#### 8.08 Wrap Objects to Path

Wrap Objects to Path can be used to align repeats of a shape along the path of another shape. To open
the Wrap Objects to Path window, select the smaller shape, hold the Ctrl key and drag this shape into the
middle of the larger shape. As soon as you see the mouse cursor change, release the left mouse button
before releasing the Ctrl key.


#### 8.08.1 Designing a Scalloped Oval




• Import a circle from **Basic Shapes** and resize to create an oval. Then also import or open any design. In this design, we joined a larger circle with a smaller one to create an eyelet shape:



• Select the design, hold down the **Ctrl** key, and drag the shape into the circle. Once you see the cursor icon change, release the mouse button and the **Ctrl** key.




Cursor starts as a double headed arrow



Cursor changes to an arc with little shapes. This indicates that you can now release the mouse button and **Ctrl** key.


Upon releasing, the Wrap Objects to Path window will open. Begin by marking the Repeat box, set a
negative Spacing according to the overlap you want, and begin increasing the Repeat Count until the last
image overlaps the first:

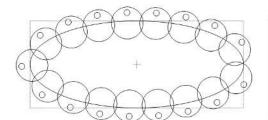



In order to get equal spacing and for the images to overlap for welding, begin tweaking the **Vert. Align** and the **Space** settings. The **Space** setting is actually changing the **Spacing** setting you originally entered by some percentage so that you can visually achieve equal spacing of the repeats around the circle. If the spacing entered were positive, then a larger **Space** value will, logically, increase the spacing between the objects. But with a negative **Spacing**, such as in this example, a larger **Space** value decreases the spacing, resulting in more overlap:

The goal is to achieve a symmetrical pattern

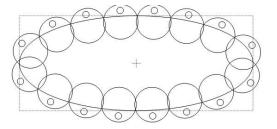




Adjust the settings to achieve the goal. Use the arrow keys on the keyboard to change values in smaller increments.

If needed, click here to reset to default values

Once you have the settings needed to get the desired overlap, click on Accept. You will be given the option
to weld and you should respond Yes. Then apply a Break and remove the interior shape. Move the oval
away or hide it so that the remaining scallop with eyelets can have a Join applied:







After deleting interior

• Then we can create an **Inset Shadow** of the original oval to make it smaller. Then remove the original oval, select everything and apply a **Join**:




#### 8.08.2 Warp Objects to Path


Part 1: Video Part 2: Video Stretch Extend: Video Filling a Frame Video

• The Warp Objects to Path function forces the shape or shapes put onto a path, to bend or distort in order to hug the shape of that path. To apply Warp, check the box in the Wrap Objects to Path window. Here's

an example of the difference in what you would see if **Warp** is not applied versus applied with the same shape, same repeat, same path:



There are three settings within the Warp function:



Stretch: The Stretch setting will extend the shape or shapes to fit along the entire length of the path. In the following example, a stretch hexagon from the Basic Shapes is use to create a curve with tapered points:



Parameterize: The Parameterize setting will keep individual shapes more evenly sized and spaced along a Bezier curve. In the following example, a Happy Birthday greeting is placed on a curve. The two versions illustrate the effect of having Parameterize turned on versus off:




♦ **Flatten:** The **Flatten** setting will smooth shapes (add curvature) by adding nodes. There are five settings: x1 – x5. In the following example, an arrow is fit to the curve:




Use the other settings from **Wrap Objects to Path**, to control the starting point (**Offset**), position on the curve (**Vert. Align**) and overlap of repeats (**Space**), just as presented at the beginning of this section. There is a fourth setting, **St. Extend**, which is similar to **Space**, but used to create equal spacing between repeats


when the **Stretch** function is applied. In the following example, the border created in *Section 8.06* will be stretched to fit around a circle:




♦ After entering the **Wrap Objects to Path** window, **Repeat** is checked and increased first. Then, **Warp** is turned on:

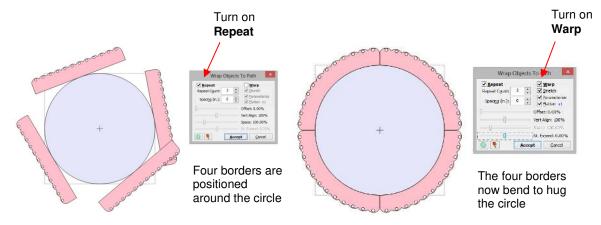

Notice that where one border ends and the next one begins (indicated by the green arrows below), the scallop spacing is greater than between the scallops along a border. In other words, the repeats need to overlap more so that the spacing looks more even. This is first accomplished by decreasing the **Spacing** setting:

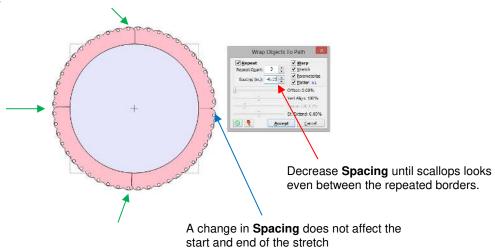

♦ However, there is still the same gap between the initial start and end of the stretch, as indicated by the blue arrow above. This is where the **St. Extend** setting will correct the gap. By changing it from 0% to 50%, the start and end will now overlap and the spacing is correct:

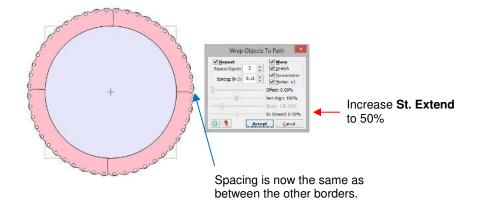


Upon clicking on **Accept**, a popup window provides the option to weld the repeated borders. Responding **Yes**, followed by deleting the circle, yields the final scalloped frame:




### 8.08.3 Live Edit Window


• One last feature in the **Wrap Objects To Path** function is a **Live Edit** window which allows you to modify, at the node level, the object being placed onto the path. In this example, the **Basic Shape** called Broad 2 is being applied to a curve and stretched. Note the roundness at the middle of the Broad 2 shape at both the start and end of the curve:



• Without needing to leave the **Wrap Objects to Path** function, the Broad 2 shape can be modified by clicking on the red icon at the bottom of the window. **The Wrap Objects To Path** window will expand and display the current object:

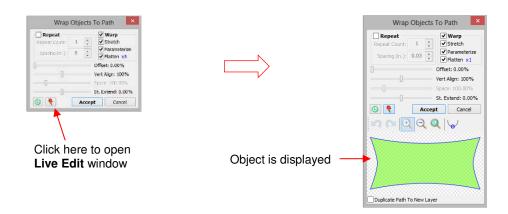


• At this point, the object can be edited as if you were using the **Edit Paths at Node Level** tool presented in *Section 7.13*. Curves can be re-shaped, nodes can be dragged to new locations and added or deleted. In this case, the inner portion of the Broad 2 shape will be edited to be more "pointy" in order to alter the stretched shape on the curve:

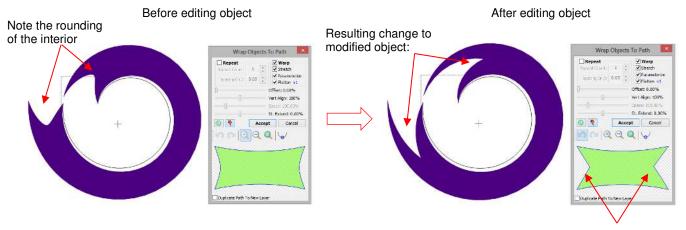

Curves are made straighter and center nodes dragged inwards


 There are additional icons just above the displayed shape which permit zooming in or out, and even autosmoothing. If you hold the space bar, you can then pan the small screen, moving to other parts of the shape, which is convenient if you have zoomed in close on particular areas to edit.

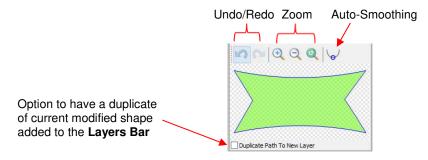


• An options box at the bottom of the window allows you to copy the currently modified object and place it on a new layer on the **Layers Bar** (for later use, as needed). You might also want to then save this new shape to **Your Shapes** in the **Basic Shapes** library, as well (refer to *Section 4.10*).


# 8.09 Auto 4-Point Warp


This function is used to fill a four sided concave quadrilateral with a selected shape or shapes. What exactly
is a four sided quadrilateral? There are three types, as shown below, however, only one of these three will
work:

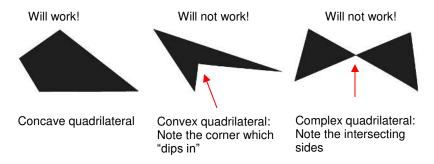

• A second requirement for **Auto 4-Point Warp** is that the mode needs to be switched to **Warp**. This is done by clicking on the quadrilateral to cycle through the three available modes (refer to *Section 3.13*):

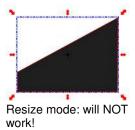







Rotate/Slant mode: will Warp NOT work!


• To activate the **Auto 4-Point Warp** function, hold the **Ctrl** key and the left mouse button while dragging the shape or shapes onto the quadrilateral. In this case, the selected shape is text. As soon as the cursor icon changes, release the mouse. This works just like **Wrap Objects to Path**, but with a different icon. (refer to *Section 8.08*):

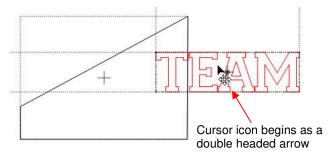

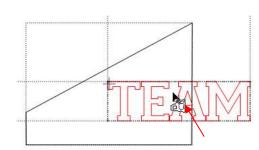


As soon as the cursor icon changes, release the **Ctrl** key and mouse button

The following window opens and the text fills the quadrilateral. Note the settings available in this window::

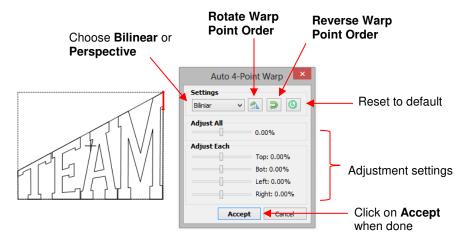


The **Bilinear / Perspective** setting changes how the shape is warped:







ar Perspective

The **Rotate Warp Point Order** rotates the shape by 90 degrees, still fitting the text within the confines of the original quadrilateral:










♦ The Reverse Warp Point Order mirrors the image:






The **Adjust All** and **Adjust Each** settings allow you to move the text from the original boundaries of the quadrilateral:







Adjust All: 15%

Adjust All: 0%








**Top only: 25%** 

Bottom only: -25%


Left only: 15%

Right: 15% Bottom: -25%


- When you achieve the desired shape, click on Accept.
- Sometimes, you may not get what you expect when first applying the **Auto 4-Point Warp**. For example, when we add KNK to a mirror image of the same quadrilateral, as was used for "TEAM", this is what we get:








• Both the Rotate Warp Point Order and Reverse Warp Point Order need to be applied:

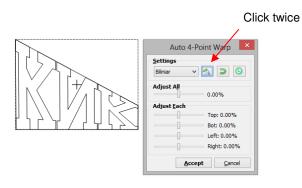

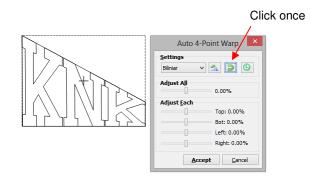

 After applying Rotate Warp Point Order twice and Reverse Warp Point Order once, we end up with the KNK in the correct orientation. After deleting the quadrilaterals, and recoloring our text, we have the final result:



### 8.10 Conical Warp



- The **Conical Warp** feature can be used for shaping designs to fit around conical shapes, which are tubular shapes in which the top is a different diameter than the bottom. What makes this feature especially fun to use in designing is the incredible 3D simulation, as you will see in the **Tumbler Wrap** example which follows below.
- The Conical Warp feature is accessed in the following ways:
  - Olick on the Conical Warp icon on the Magic Toolbar




- ♦ Press Ctrl+Q
- ♦ Right click on the screen and select **Shape Magic>Conical Warp**
- ♦ Go to Edit> Shape Magic>Conical Warp

### **Tumbler Wrap**

 A design has been created for the wrap. The pumpkin is from the free *Create-A-Card* set in the Lettering Delights window. A random font was chosen to create the lettering:



Select the entire design and then click on the Conical Warp icon. The follow window opens:

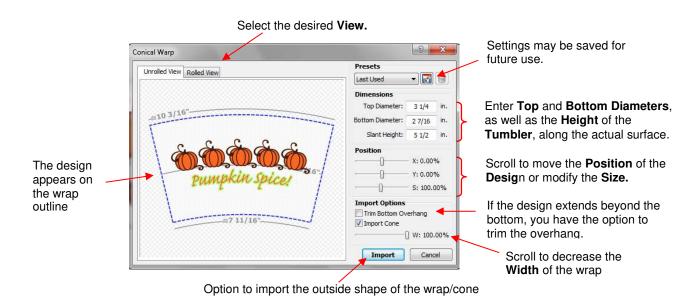

 Before clicking on Import, click on the Rolled View tab. You will be able to drag your mouse across the screen to rotate the tumbler and view from virtually any direction:







- If you wish to save this image to your computer, double click the image while in Rolled View and a window will open with the option to save as a .png file.
- You can continue to make changes to the settings in the **Rolled View**, as well, and click on **Import** when done. If you selected **Import Cone**, then you will see both the outside shape of the wrap for the tumbler, as well as the original image, reshaped to fit the wrap:



• This feature can also be used in the design of cupcake wrappers!



### 8.11 Lattice




- The **Lattice** feature can be used to create a lattice design within a shape or part of the entire shape itself. It can be accessed in any of the following ways:
  - ♦ Click on the **Lattice** icon on the **Magic Toolbar**




- ♦ Press Ctrl+E
- ♦ Right click on screen and select Shape Magic>Lattice
- ♦ Go to Edit>Shape Magic>Lattice.

# **Latticed Circle**


• Begin with a circle, select and then click on the **Lattice** icon on the **Magic Toolbar**. This window will open:

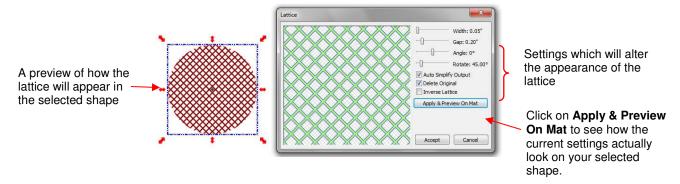

 The selected circle indicates that the current settings for Lattice will result in a much smaller, detailed look than desired. But with the adjustment of the Width and Gap settings (both made larger), the result is much more practical for cutting:

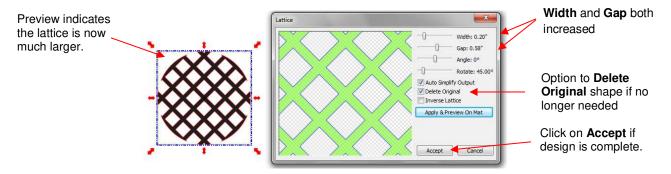

Now the design shown would cut exactly as shown. You would have a single cut piece. But for some lattice
designs, the opposite is wanted. For example, when cutting a design from the front of a greeting card, you
plan to keep the card and not the design itself. In this case, you would mark the Inverse Lattice option and
perhaps tweak the Width and Gap settings some more

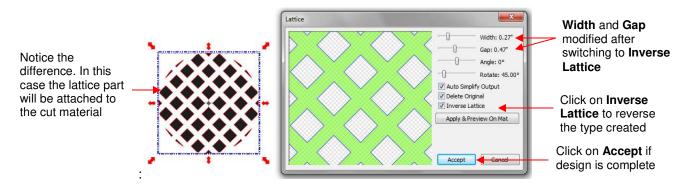

### 8.12 Rhinestone Design

Designing: Video Applying Simulations: Video

Checking circle size: Video Resizing Existing Patterns: Video Re-spacing Existing Patterns: Video Re-spacing Existing Patterns:

 MTC's Rhinestone feature provides both outlining and horizontal fill of shapes with the size of circles needed for your rhinestones and the spacing desired. It can be accessed in any of the following ways:

♦ Click on the **Rhinestone** icon on the **Magic Toolbar** 




- ♦ Press Ctrl+K
- ♦ Right click on screen and select Shape Magic>Rhinestone
- ♦ Go to Edit>Shape Magic>Rhinestone.
- There are some very specific guidelines to follow when designing a rhinestone pattern:
  - The shape needs to be sized before applying the rhinestone circles. If you wait until afterwards and then realize that you want your overall design to be twice as large, then resizing will make the circles twice as large and the spacing twice as large, too! So, before accessing the **Rhinestone** feature, decide on the overall size you wish to use.
  - The circle size selected will need to be larger than the stone size you purchased. As a general rule, select a size three numbers larger than your stones. Thus, if you purchased 10SS stones, then in the rhinestone design window, you will want to be selecting 13SS stones. This larger size will allow the 10SS stones to more easily brush into the holes.
  - When selecting a font to use, be leery of "fancy fonts". You want the lettering to be readable after it is converted to circles. When in doubt, have someone who doesn't know the words you've typed attempt to read the circle design on the screen. If they cannot decipher your words, then try a more basic font.
  - Rhinestone designs almost always need "tweaking" which involves adding, deleting, moving, or respacing circles. You will need to apply a **Break** (**Ctrl-B**) to separate the pattern into individual circles. To quickly add a circle, select one, click on the **Copy** icon and then click on the **Paste in Place** icon and drag the circle to its new location. Then you can continue to just click on **Paste in Place** to add more. To re-space a row or column of circles, marquee-select and then use the shortcut keys, [ and ] to provide equal vertical and equal horizontal spacing, respectively.

### **Rhinestone Outline**

• In this example, the initials from a high school will be outlined. As mentioned in the introduction to this section, the first step is to size width and height of the lettering. Make sure there is enough space between the letters so that the circles will not overlap. Also, you may want to resize the lettering vertically to make the letters taller. This allows more circles to be applied and can improve the ability to read the text:




To apply a rhinestone outline, select the shape and then click on the Rhinestone icon. This window opens:

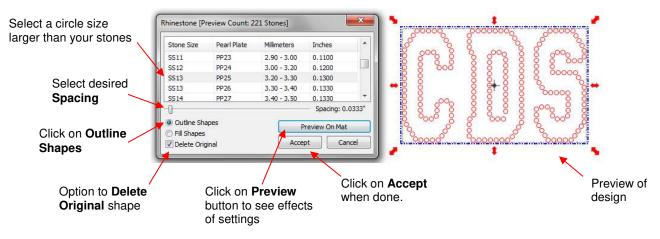

- It is recommended that you mark the **Delete Original** option while previewing your design on the screen. However, before clicking on **Accept**, remove the mark. You may need to recreate your design at some point and having the original shape will be beneficial.
- The final step will be to tweak the design using the short cut keys mentioned at the beginning of this section.

# **Rhinestone Fill**

• The other option in the **Rhinestone** feature is **Fill Shapes**. Instead of outlining the shape, the image will be filled with circles in horizontal rows. In our prior example, the same letters will now appear like this:

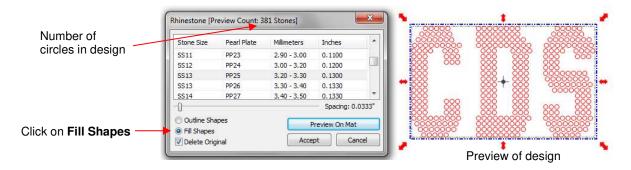


• Note that in the title of this window, the number of circles in the design is shown. Rhinestones are typically sold by the gross and 1 gross equals ~ 144 stones.



# **Additional Tips on Rhinestone Designing**


- Sometimes the circles you want to re-space equally may fall closer to a 45<sup>0</sup> angle versus vertically or horizontally. Select your entire design and rotate until the line of circles is closer to vertical or horizontal. Re-space using the [ or ] shortcut keys and then rotate back into place.
- If you want to outline your design, then create the outline first using the **Shadow Layer** function (**Ctrl-H**). Choose a **Shadow Width** at least the size of the circles plus the spacing. In the 10SS example, the circles were 0.13" in diameter and the spacing was 0.03". If the same settings are used in this next example, then the **Shadow Width** needs to be 0.16" (note that mm or cm can also be used):

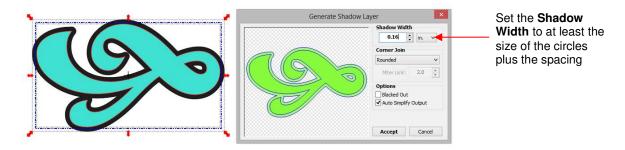


The resulting design with the shadow set to the circle size plus the spacing, looks like this:




- With symmetrical rhinestone designs, consider using the following process to perfect your design:
  - ♦ This heart outline is clearly not symmetrical:




Delete the right half and position the upper and lower circles to the desired location:



♦ Select circles and then perform the following steps shown:



Click on the **Copy** icon, followed by the **Paste In Place** icon, and then the **Mirror** icon.



With right side still selected, press right arrow key until right side is in place.



Delete the top and bottom circles since there are identical copies on top of one another




Apply the **Join** function and the design is complete

### 8.13 Texture Snapshot

- The Texture Snapshot function is used to create a texture from one or more selected shapes. Upon
  execution, any overlap between the shapes is removed and a single trace line around the exterior is
  retained. The fill becomes whatever color or texture the selected shapes had. It can be accessed in any of
  the following ways:
  - ♦ Click on the **Texture Snapshot** icon on the **Magic Toolbar**



- ♦ Press Ctrl+1
- ♦ Right click on screen and select **Shape Magic>Texture Magic**
- ♦ Go to Edit>Shape Magic>Texture Magic.
- This feature is handy for print and cut applications. For example, a detailed paper piecing pattern can be instantly converted to a print and cut using this function:

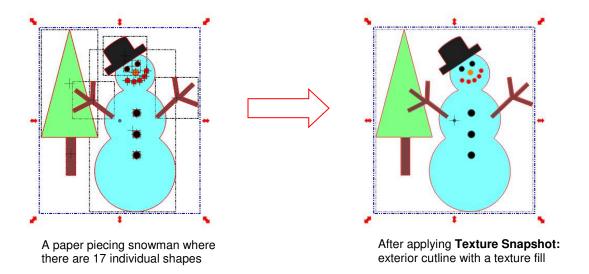


# **Creating a Gradient Texture Fill**

• The **Nested Duplicate** function can be used to create a gradient color texture for any given shape. Decide which color you wish to use for the main shape, for example yellow. Add a rectangle from **Basic Shapes** and change the rectangle to that color:




Rectangle can be any dimension.

- Select the rectangle and apply the **Texture Snapshot** function.
- Create the shape you wish to fill. In this example a flower will be used. Select the shape, right click and select Change Color/Texture/Line. Pick Select Texture and the following window will open where you can select the yellow texture and also mark the tiling option so that the entire shape will fill with the color, regardless of the size of the original rectangle:

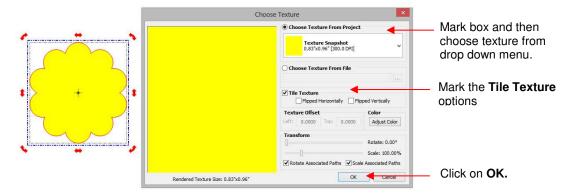

Now, with the shape still selected, access the **Duplicate Nested** function by right clicking and selecting
 **Duplicate>Nested Duplicate**. The following window will open:

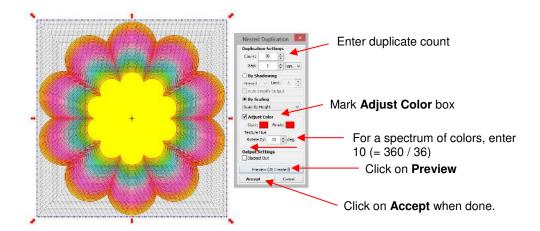


• The **Rotated Hue** function is used for this application. For a spectrum of colors which begin and end with the same color, the degrees are calculated by dividing 360 by the number of duplicates. In this case, 36 duplicates are chosen, so the **Rotated By** setting entered is 10 deg. After clicking on **Accept**, we have our finished flower. **Texture Snapshot** can again be applied:



### 8.14 Jigsaw Puzzle




- The **Jigsaw Puzzle** feature installs as a separate application. To open it, go to your Windows **Start** button, select **All Programs**, locate your **Make The Cut** folder and then select **Jigsaw Puzzle Generator**.
- The following window will open:

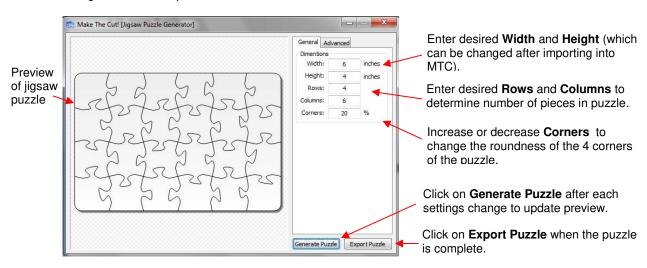


- If you plan to apply this puzzle over a specific image, you may want to choose dimensions that correspond to your image. For example, let's assume you have imported a 4" x 6" photo into MTC and plan to make a print and cut jigsaw puzzle. Enter those dimensions into the **Jigsaw Puzzle Generator**, as shown above.
- Further, to keep the pieces from becoming too distorted (or worse, overlapping); you should make the number of **Rows** and **Columns** similar to the dimensions, as shown. If you want more pieces then you can increase the number of **Rows** and **Columns** proportionately. For example, instead of having 4 **Rows** and 6

Columns use double the number to 8 Rows and 12 Columns (or 1.5 times to 6 Rows and 9 Columns). Note how the pieces would look if a rough proportion were not maintained. The pieces would cut into one another:

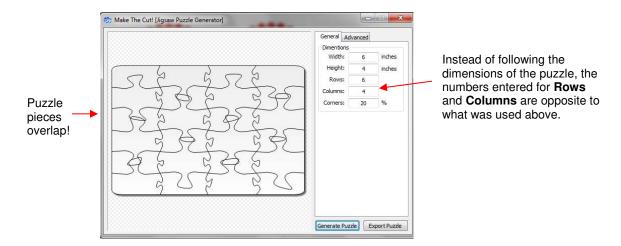


- There is also an Advanced tab you can use to alter the design of the pieces and even save your new settings.
- When you are satisfied with the appearance of your puzzle pieces, click on the **Export** button and a window will open and you can save your puzzle as an SVG file.
- In MTC, import your SVG puzzle file and align it over the image you wish to convert into a puzzle. Perform a print and cut as presented in Chapter 9. Alternatively, if you print your image a little bit larger than the overall design of the puzzle, you can set your origin just inside the corner of your printed image and then cut the design using the **Knife Point** setting (Refer to Section 2.02).
- Here is an example of an imported picture and the puzzle imported and sized to fit on top:



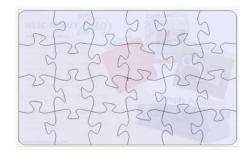


# 8.15 Notes Window


- The Notes window in MTC can be used in a host of ways: (1) providing instructions for cutting and assembling the project, (2) adding your name, copyright, and Terms of Use, (3) explaining the purpose of different pages or layers. (4) crediting others for assistance with the design, (5) citing sources for clipart or names of fonts used, and (6) attaching files you want to provide with your project.
- The **Notes** window can be opened using the following ways:
  - Click the **Toggle Notes Window** icon on the **File Toolbar** 
    - Go to View>Notes Window.
- There are two tabs in the **Notes** window **Notes** and **Files**. The **Notes** window is used for entering any text you wish to include with your project:

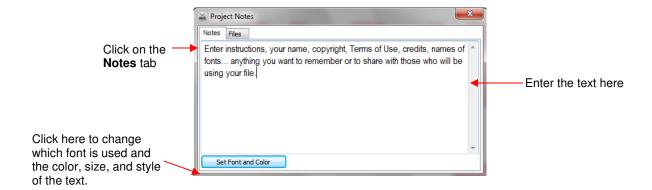


- If you choose your own font and then share the file with someone else, the **Notes** will only show up in that
  font, if the recipient has that same font installed on his/her computer. Otherwise, the **Notes** will show up in a
  system default font, such as Arial.
- The **Files** tab can be used to attach files to your project file. For example, you might want to attach a photograph of your completed project, or a PDF tutorial, or another MTC file that is associated with this one. Any file can be attached:

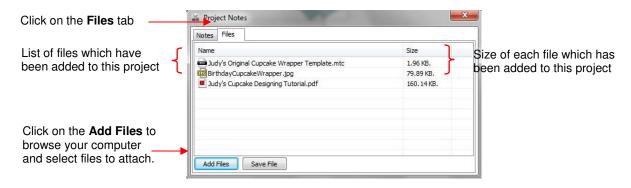

If you have any information entered into your Notes window or a file attached, then it will automatically open
when the file is opened by you or someone else. However, as of Version 4.2.0, you can turn off this feature
by going to Help>Advanced>Advanced Settings and unchecking the box next to "Enable Automatic
Notes", under Enable Notes View:



- If you open an MTC project file from someone who has attached one or more files in the **Notes** window, you can try double-clicking the file name to automatically open that file. With some file formats, such as PDF, you will need to save the file to your computer and open it outside of MTC.
- To save an attached file, click on the file name and then click on the Save File button to open a window
  where you can browse your computer to locate a folder for saving that file.

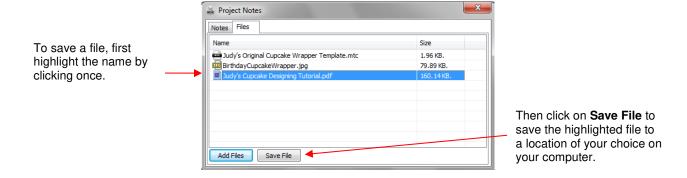

### 8.16 Design Contest Tutorials

• In October 2011, a contest was sponsored by KNK USA. The challenge was to take existing designs or shapes and transform them into new shapes using various functions in MTC. The following tutorials are from the two winning entries and are excellent examples of how the tools available in MTC can be used in creative ways.

# **Designing a Whale by Brigit Mann**



• Begin with the following Basic Shapes:




Select the Yin Yang, resize to about 3" in height. Apply the Break function. Delete the lower circle and set
the right side of the Yin Yang off to the side. Make the circle slightly smaller (this will be the whale's eye).
 Apply a Join to the left side to recombine the circle to the Yin Yang:






• Resize the crescent and rotate and put it partially on the whale body where the mouth would be. Select both pieces and apply **Boolean Join**, selecting **B-A Difference**:



• Unlock the **Aspect Ratio** and resize the tear to 2.5" **W** x 0.8"**H.** Select and click on the **Bézier Warp** tool. Under **Size** and **Position**, slide the left and right to about 37:












Rotate the tail to line up with and overlap the whale body. Apply the Weld tool:




Lock the Aspect Ratio and resize the triangle size to about 1.1". Insert nodes on each side as shown. Then
drag top node to the left:




• Curve paths outwards to form fin:




• Rotate the fin, overlap onto the whale's body and apply the **Weld** tool:




• Resize the other Yin Yang section to a width of 1". Using the **Knife** tool, slice in the middle and delete the top piece, join the two nodes together this is the flapper:



• Select the whale and apply a **Shadow Layer** (with blackout selected). Then arrange the flapper on top:




• To add some splashes, start with additional tear shapes, resize to make thinner, and apply **Warping** or other method of distorting the shape. Rotate and arrange under the whale to complete the design:

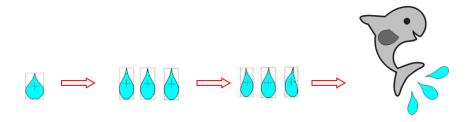

### **Designing a Flower by Laury Vaden**




- This colorful flower is made from just a few Basic Shapes: Circle, Swirl, Heart2, Tear, and Wavy 2.
- Set **Snap Position** to **No Snapping**. Choose one of the non-contrast mats such as the standard green mat.
- Select the Circle and move it down and away from the other shapes. Then select the Tear and move it down. Click on the Tear until red icons change to the mode shown below. This is the **Scale** mode. Elongate the Tear and thin it as shown:




 Holding the Ctrl key, move the Tear over the Circle and release. This will open the Wrap Objects to Path window. (Refer to Section 8.08) for details on activating this function):




• First, check the **Repeat** box. Then increase the **Repeat Count**. Use a negative value for the **Spacing** so that the Tears overlap slightly. Spacing is controlled by both the **Spacing** setting that you type in and the **Space** slider setting just above the **Accept** button. This might be a little confusing especially when you use negative numbers versus positive numbers. Practice a bit to see how it works with both. The **Vertical Align** slider controls how far into the circle the Tears will be located. The **Offset** slider is not used because the tears are being aligned along a circle:

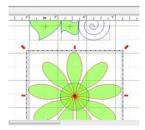


• Select the Circle and all of the Tears/Petals and apply the **Weld** function:

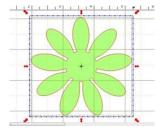


• Click on the flower and apply a **Copy** and **Paste In Place** to create a duplicate. Double click on the duplicate until the shape is in the **Rotate** mode. Then slowly rotate the copy by dragging the corner icon around until the copy lines up with the spaces of the original:

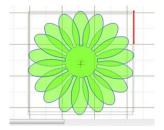


• <u>Flower Center</u>: Select one of the flowers and perform another **Copy** and **Paste in Place**. Move the copy away from the other flowers and click on the **Shadow Layer** icon:

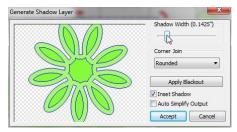


The above popup menu will appear. Check the Inset Shadow box. Uncheck the Auto Simplify Output box.
It is recommended that Mitered be selected as the Corner Join instead of Rounded. The shape for the
flower center is only the center shape. Use the Shadow Width slider to create the inset. Click on Accept
when you are done:

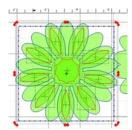

- To delete the petals, first select the inset shape and then apply the **Break** function. Now delete each of the petal insets. Again, you are only interested in the very center inset. The original shape (the one that was used for the **Shadow Layer**) may also be deleted.
- Place another circle on the mat from the Basic Shapes library. Select both the new Circle and the center inset and press S to Stack them:




Select just the inset shape and then click on the Lattice icon to open the Lattice window. Check the boxes
for Inverse Lattice, Auto Simplify Output, and Delete Original. Note the other settings used and click on
Accept:

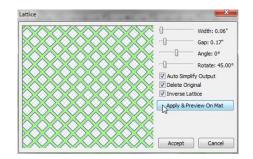


Join the Circle and the lattice by selecting both and applying the Join function. To remove the tiny cutouts, press F8 to activate the Eraser tool. Check the Inverse Eraser box and set the Size to 1. Then erase the little cutouts that you do not want.


little cutouts that you do not want.




• This is the center of the flower. Select both sets of petals and the center and press **S** to **Stack** them:




• <u>Flower Shadow or Mat:</u> The last part of the main flower is to create an outset shadow of the entire flower. The first step is to select the entire flower head and apply **Copy** and **Paste in Place** to create a new copy on top of the old. Move the new copy away from the flower and apply the **Weld** tool:




• Select the flower outline and press the Shadow Layer icon:

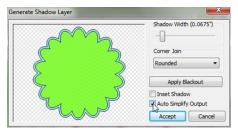


• Use the settings above to make a shadow for the flower. Press **Accept** when you are done. Delete the original outline (the smaller one). Select the flower and the shadow and press **S** to **Stack** them together.

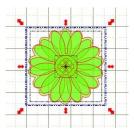


• <u>Color:</u> Set the mat to **Contrast** on the **Virtual Mat** tab. Make sure each shape is on its own layer, then move the layers up or down so that the center of the flower is on top. Change the colors of the two sets of petals and the center:




• Flower Stem: Select the Wavy shape and move it away from the other shapes. Click on the **Rotate 90** degrees icon:

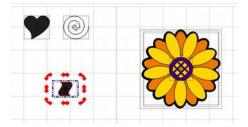

• Click on the shape until you see the red **Scale** mode icons then elongate the shape, by dragging the red icons, until it is the size and appearance of the stem you want:

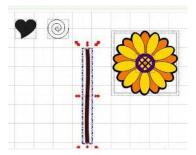

• <u>Leaf:</u> Select the Heart shape and bring it down to the stem. Manipulate it until it is the shape and size you want for a leaf. Do this by using the different red **Scale** icons in **Scale** mode. You may also wish to try some of the red warping icons in **Warp** mode (red Quad arrows):

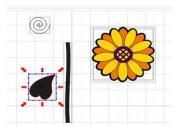

- Place the leaf near the stem. Later you will use the Fat Path in the Pen Tool in Node Edit Mode to add a
  little stem to the main stalk.
- <u>Spiral</u>: (Note that since this tutorial was written, a **Spiral** tool has been added to MTC. Thus refer to *Section* 8.03, as desired) for a quicker method to create the spiral leaf added to the stem).


• The **Basic Shape** Swirl is an open path/single line shape which needs to be converted into the spiral that will be cut out. It also has a few too many turns for the flower:




 Use the Node Edit Tool to delete nodes at the start and at the end of the Swirl to reduce the number of turns




 To convert to the spiral that will be welded to the flower stem, select the modified Swirl and use Copy and Paste In Place to make a copy. Select the copy, and reduce in size to make it smaller but not change the shape. Arrange the two shapes and press S to Stack them:



• Combine the two paths into a single shape by using the **Pen Tool** in **Edit Node Mode** (press **F5**):




When you activate the **Pen Tool** you will notice four nodes now appear at the ends of the two spirals.
 Connect the nodes by left clicking on one node and right clicking on the node to which you want to connect:



- Repeat with the other set of dots/nodes to finish closing the open path into a shape.
- To position the swirl shape, select it and click the **Mirror** icon. Next click the **Rotate 90 degrees** icon. Move the spiral into place against the stem. Select the stem and spiral and click the **Weld** icon:



• Add a Leaf Stem: Click on the leaf and position it a little away from the stem. Click on the Pen Tool again. This time check the Fat Path box. Select a Size for the Fat Path to use for drawing the leaf stem. Left click on the flower stem and right click in the center of the leaf:



- Select the flower stem, the leaf and the leaf stem and click on the Weld icon.
- Add three circles and resize two to be progressively smaller. Position them on the stem as shown below.
   Select the stem and the little circles and apply **Join**:



Recolor the stem to be green. The design is completed!



# 9. Print And Cut

### 9.01 What Is a Print And Cut (PNC)?

# Video

- The print and cut process involves printing an image from MTC to any printer you own and then, with the aid of the Zing's laser, having the image or images cut out with perfect precision. Below are three typical kinds of print and cut applications but there are more, so be sure to check out *Section 9.06* and *9.07*:
  - ♦ The cut line is along the actual border of the printed image(s):



♦ The cut line is outside of the border but follows the shape of the printed image(s):




The cut line follows a different shape from that of the printed images(s):




# 9.02 What is a PNC Calibration?

• In order to get precise PNC results, you must tweak the **Laser Offset** calibration. This is nothing more than determining how far away the laser light on your Zing is located relative to the tip of the blade. Because the laser is manually installed into a small hole inside the blade carriage, the distance from the laser light to the tip of the blade will vary from one Zing to the next. Also, you will want to use the same blade holder with all of your PNC applications, as the distance can also change with larger or smaller diameter holders.

The distance is measured in mm in an X direction and in a Y direction:

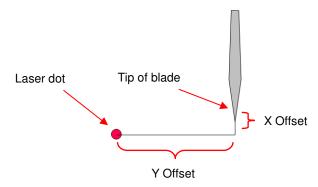

- This calibration only needs to be done one time, for a given blade holder, and then you can record this
  calibration in case you ever need to install MTC on a new computer or you have to reformat the hard drive
  on your current computer. The units are in mm which are easier to measure in very small distances.
- The Zing plug-in has a set of default calibration numbers which will be close to your final numbers, but not
  exactly the same. To access these numbers, click on the tiny wrench icon indicated below and the
  Calibrate window will open:

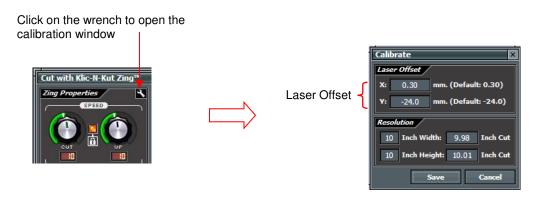

The process involves performing and repeating a PNC to see how much you need to adjust the X and Y values in order to get perfect results. And you SHOULD be able to get perfect PNC's! :)

### 9.03 PNC Procedure Part 1: Setting Up and Printing

- What do you need before you begin a PNC?
  - First, you need an image to print, a printer, and the blade holder you plan to use for all of your PNC's. The diameter of the blade holder will impact the laser calibration. Note: If you are importing an image to be used, then please refer to *Chapter 6* for details on the Pixel Trace process.
  - You need to be well rested! You don't want to start learning the PNC process when you are tired, stressed, or in a hurry. Mastering a PNC comes when you have the time to repeat it about 4 times in a row. At that point, you will not only have repeated the process enough times to feel very comfortable with the order of the steps, but you'll have your calibration perfected and then be ready to do future PNC's quickly and with ease.


IMPORTANT: Do not use high speeds when performing very precise PNC's, including the following calibration. Set both the **Cut** and **Up Speeds** to 11 (use 9 on the original Zing).

• While it is possible to do PNC's in either portrait or landscape mode, it is highly recommended that you select the same orientation you typically use for your other cutting in MTC. If you prefer to work in portrait, please skip to the *Portrait Mode Option* section following the *Landscape Mode Option* section.


### **Landscape Mode Option**

- To begin, create a new custom mat that's set for letter size or A4 or whatever size your printout will be.
  Refer to Section 3.04 if you need instructions for creating a custom mat. Uncheck the Margins box. For letter size, make the Width 11" and the Height 8.5". For A4, set the Width to 11.69" and the Height to 8.27".
- Since you are reading the *Landscape Mode Option* section of the user manual, set the **Virtual Mat** to **Landscape** and select your new custom mat.
- What's the best image to use for the **Laser Offset** calibration? An arrow is ideal because you'll be able to quickly verify if you have the printout correctly placed on the cutting mat. Also, it's a great shape for seeing how to adjust your X and Y calibration numbers. You can use most any image, but to follow the rest of the tutorial more easily, an arrow from the **Basic Shapes** library is highly recommended:


IMPORTANT: Make the arrow at least 6" high (as shown below) for an accurate calibration.

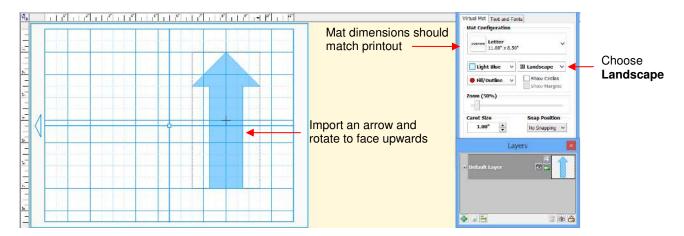


- Notice that the arrow is pointing <u>upwards</u> on the screen. <u>Make sure your arrow is also pointed upwards!</u>
   Later, when you print the arrow and place the paper on the mat, the arrow will be pointing to the right as you insert the mat into the Zing.
- Next, go to File>Print Setup, select the printer you plan to use, and set the Orientation to Landscape:

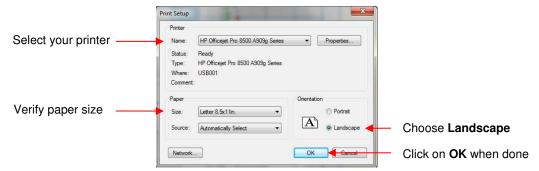


• Next, go to File>Print Options and mark the following boxes:

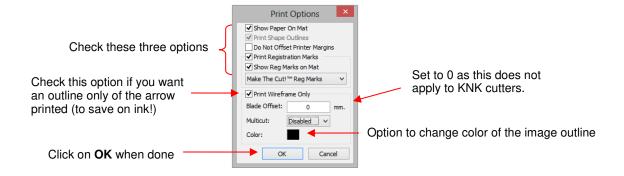


• After clicking on **OK**, you should see the green borders on the **Virtual Mat**, indicating how the printout will be placed on the mat and where the arrow will be printed. If the arrow is outside the green borders, move it so that it falls within the boundaries:

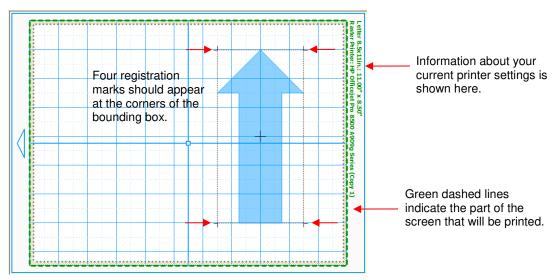

• Go to **File>Print Preview** and you will be able to see the arrow plus the four registration marks which should be aligned with the boundaries of the arrow:

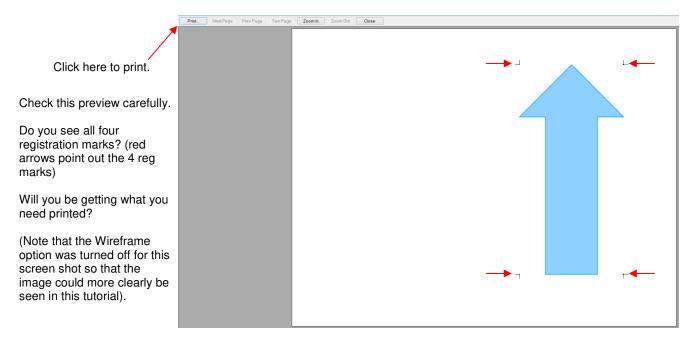

- Always make sure you can see the four registration marks before continuing since they are an integral part of the PNC process. If your print preview matches the one above and you see the four marks, click on the Print button. Also verify that what is being printed is what you need. For example, you may have added an extra shape to be cut, but you do not want it showing up in the printout. This is where you will want to use the Layers feature to control what will be printed, as well as what will be cut later.
- You may want to print several (4 or 5) copies since you will want to repeat this process several times in order to get your calibration settings perfect.
- After printing, place the printout onto the mat. As you are facing the Zing, the printout should be on the mat in a portrait orientation with the arrow pointing towards the right end cap:

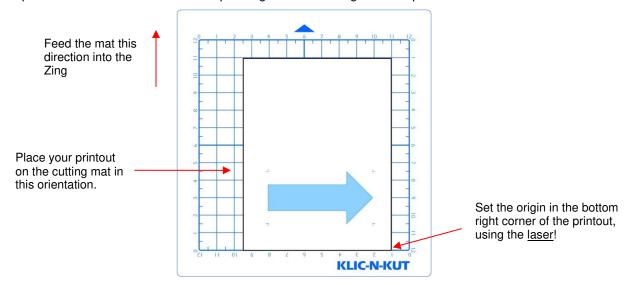


Go to Section 9.04 to continue with the next steps!

### **Portrait Mode Option**

- To begin, create a new custom mat that's set for letter size or A4 or whatever size your printout will be.
  Refer to Section 3.04 if you need instructions for creating a custom mat. Uncheck the Margins box. For letter size, make the Width 11" and the Height 8.5". For A4, set the Width to 11.69" and the Height to 8.27".
- Since you are reading the *Portrait Mode Option* section of the user manual, set the **Virtual Mat** to **Portrait** and select your new custom mat.
- What's the best image to use for the **Laser Offset** calibration? An arrow is ideal because you'll be able to quickly verify if you have the printout correctly placed on the cutting mat. Also, it's a great shape for seeing how to adjust your X and Y calibration numbers. You can use most any image, but to follow the rest of the tutorial more easily, an arrow from the **Basic Shapes** library is highly recommended:


IMPORTANT: Make the arrow at least 6" wide (as shown below) for an accurate calibration.

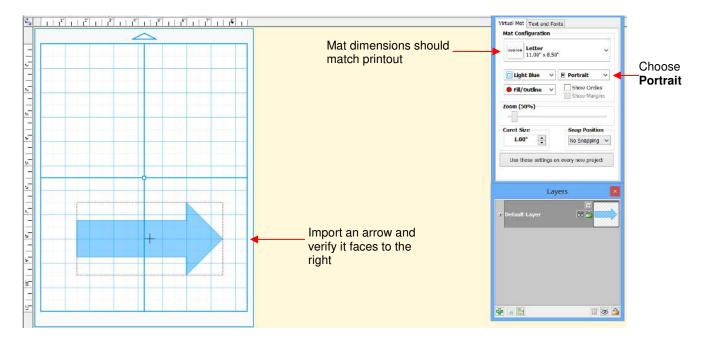


- Notice that the arrow is pointing to the right on the screen. Make sure your arrow is also pointed to the right!
- Next, go to File>Print Setup, select the printer you plan to use, and set the Orientation to Portrait:




• Next, go to File>Print Options and mark the following boxes:

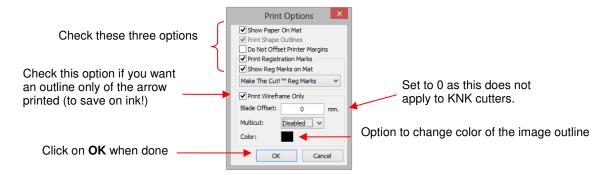

• After clicking on **OK**, you should see the green borders on the **Virtual Mat**, indicating how the printout will be placed on the mat and where the arrow will be printed. If the arrow is outside the green borders, move it so that it falls within the boundaries:

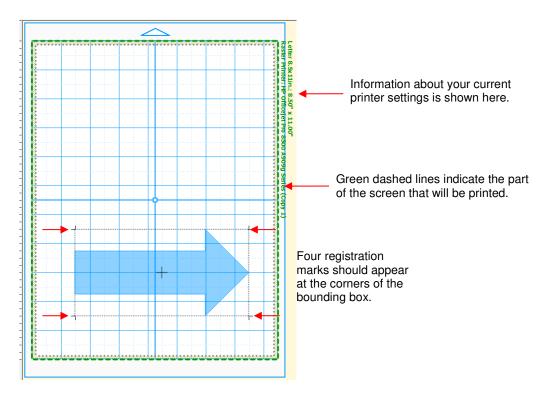


• Go to **File>Print Preview** and you will be able to see the arrow plus the four registration marks which should be aligned with the boundaries of the arrow:

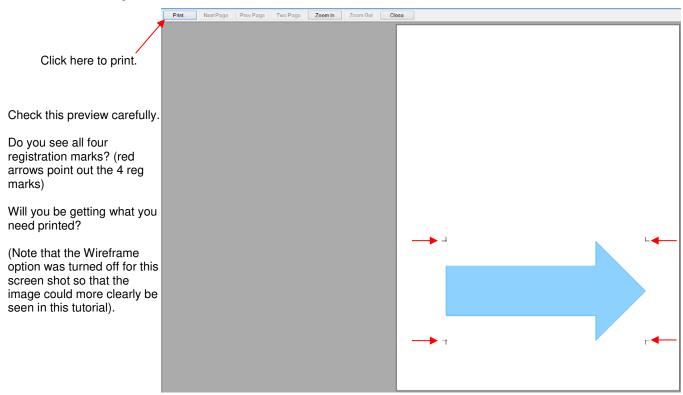

- Always make sure you can see those registration marks before continuing since they are an integral part of
  the PNC process. If your print preview matches the one above and you see the four marks, click on the
  Print button. Also verify that what is being printed is what you need. For example, you may have added an
  extra shape to be cut, but you do not want it showing up in the printout. This is where you will want to use
  the Layers feature to control what will be printed, as well as what will be cut later.
- You may want to print several (4 or 5) copies since you will want to repeat this process several times in order to get your calibration settings perfect.

After printing, place the printout onto the mat, in the same orientation you see in the main window and insert
the mat into the Zing. As you are facing the Zing, the printout should be on the mat in a portrait orientation
with the arrow pointing towards the right end cap:

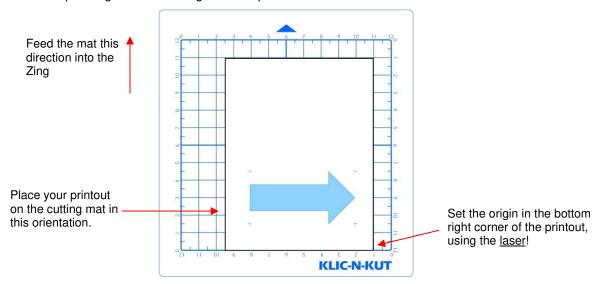


### 9.04 PNC Procedure Part 2: Aligning and Calibrating

### Aligning the Laser with the Registration Marks

IMPORTANT: Set Cut and Up Speeds to 11 (9 on original Zing)

- Click on the Cut Project With icon to go to the cut window. If you haven't yet performed a test cut, do so
  now using either the Knife Point or WYSIWYG setting. Perform the test cut in a location that won't be part
  of your final cut or use a scrap of the same material you are cutting.
- After the test cut is successful, click on the **Set Blade Origin** window. Move the <u>laser light</u> until it is directly over the lower right corner of the printout, as indicated above. Click on **Finished** to set the origin.
- Under **Cut Type**, select **Print And Cut**. Also set your **Cut** and **Up Speeds** both to 11 (9 on original Zing). In order to get perfect and repeatable PNC results, you need to make sure you are not moving the cutting mat too quickly through the cutter. Also, I do not use the left side mat guide during PNC's. So loosen that post and slide to the far left, out of the way.
- Click on **Cut Project** and the laser should automatically move to within a very short distance of the first registration mark. The following window will open:

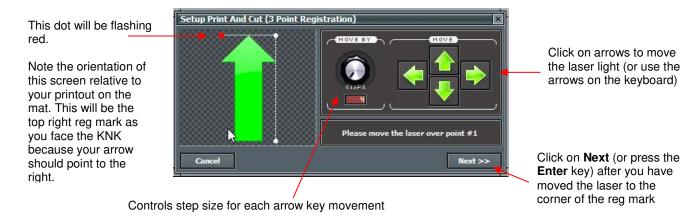


Make sure the laser has moved within an inch or less of the registration mark indicated by the flashing red
dot shown above. If not, you'll want to review the steps you've used so far to make sure you have all of the
same settings shown and you have your printout on the mat in the same orientation as shown previously.

• The next step is to move the laser dot so that it is precisely at the corner of the printed registration mark. This window is very similar to the **Set Blade Origin** window. Click on the arrow keys on the screen or use the arrow keys on your keyboard. Important: once you are close to the mark, decrease the **Move By** setting to 4 so that you'll have precise control on alignment. Once the laser dot is dead-on, click on **Nex**t or press the **Enter** key.



• The laser will move to the vicinity of the next registration mark and the flashing red light in the software moves to the same relative point:

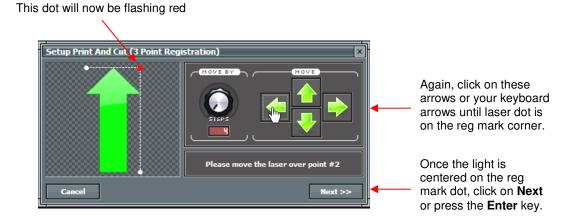

Repeat the process with the final reg mark:




 After clicking Finished, the following window will open and remind you to wait until the cutting has completed before going back to the Cut with Klic-N-Kut Zing window:



• Once you click on **OK**, the arrow shape will be cut out.

#### **Adjusting the Laser Offset**

- After the print and cut is completed, examine how the cut lines were made relative to the printed lines. If the
  offset is large enough, use a mm ruler to measure. If the offset is very small, then just estimating will be fine
  as you refine your calibration.
- In the following diagram, the red lines represent the cut lines and the black lines represent the printed lines. Use this diagram to determine whether your **Offset** values need to raised or lowered for your laser:

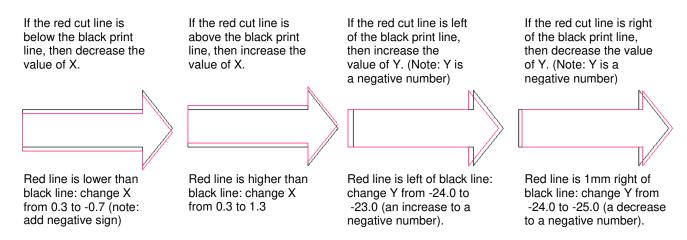

- Modify your X and Y Offset values in the window shown at the end of Section 9.02. Start with 1 mm adjustments (like shown above). When entering a number less than 1, remember to include a 0. For example, do not enter ".4". Instead enter "0.4".
- It's a good idea to keep track of prior values, so that you'll know which direction to change for subsequent
  calibration tests. Remember that you should expect to get perfect results, so keep adjusting those X and Y
  values until you get there. After adjusting by 1 mm, you will need to adjust by 0.5 mm and even smaller to
  get it perfect.
- You may find that one side is aligned but the other is not. For example, the cut line may be perfectly aligned with the print line on the lower side of the arrow but maybe 0.5 mm above the arrow along the upper side. Adjust the calibration based on the side that is off.
- Once the PNC is perfect, write down these X and Y values in case you buy a new computer or you have to reformat your hard drive.

IMPORTANT: When you are ready to try this process on an actual raster image, don't forget to turn off the **Wireframe** option under **File>Print Options**.

# 9.05 Print and Cut Tips


- When pixel tracing imported images, the trace lines will not necessarily be perfectly aligned with the image. This can result in tiny bits of white appearing in certain spots, suggesting the PNC wasn't accurate. Zoom in close on the image so that you can see the trace line following the outline of the image. Look at the same spots where the PNC didn't follow the image perfectly. This could be the cause of the inaccurate PNC. There are three ways of dealing with this situation:
  - All Retrace the imported image, increasing the **Resample** setting. This will result in a tighter fit of the trace line to the original graphic.
  - Use **Node Editing** and **Segment Editing** to move the trace lines to more closely fit the original graphic. This is covered in detail in the last part of *Section 7.13*.
  - ♦ Create an inset line to use for cutting instead of the original trace line. This is presented in Section 9.06
     PNC with an Inset Cut Line.

- If a PNC is not precise and the cause is not the alignment of the trace lines, then try slowing down the speed even more. If the mat is moving numerous times, in and out of the cutter, a slight shifting can occur, especially at higher speeds. Try reducing the **Cut** and **Up Speeds**.
- Remember that the calibration of the **Laser Offset** is specific to the blade holder type being used. Thus, if you change brands, the laser calibration will need to be modified.
- If your test arrow is cutting perfect, thus indicating you have the correct calibration, but your next print and cut is way off, then perhaps your situation is something outside of the ordinary. Please review the following section which covers different scenarios in which a few extra steps will be required when setting up the layers for your print and cut.
- It is not necessary to set the origin or even put the printout on the mat in advance of starting the PNC procedure. Watch this video for a way to make the process a little guicker!

### 9.06 Print and Cut Scenarios

### 9.06.1 Cutting Multiple PNC Images on the Same Page

• When performing a PNC on multiple images (whether they are all the same image or different images), the procedure is the same. One set of four registration marks will be printed along the outside edges of the bounding area of ALL of the images on the page:

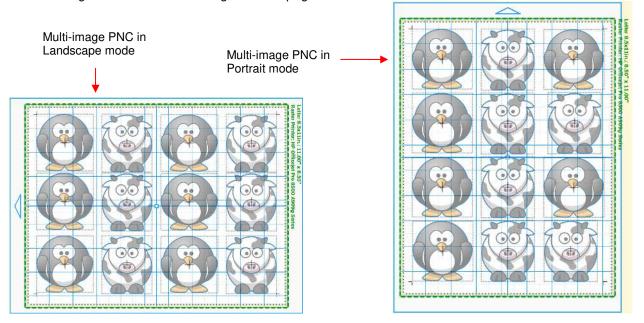

### 9.06.2 PNC With a Contour Shape Larger Than the Printed Image




• In Section 9.01, two other PNC applications were shown. In one case, an outside contour will be cut. In the other, an alternative shape is added, such as the tag shape shown below.



#### **Adding a Contour**


- You want to add a contour cut and remove the cut line on the cow, which was created during the pixel trace, so that the only line cut will be the contour. To do this:
  - Select the shape and use the **Shadow Function** to add a contour around your image. Refer to *Section 8.05* for instructions on using this function.
  - Make sure the raster image (the cow, in this example) is on a higher layer than the shadow to be cut.
  - ♦ Select both the cow image and the shadow and apply the **Weld** function from the **Magic Toolbar**. The internal cut line disappears leaving the original raster image now filling the **Shadow Layer**:



• The cutting process proceeds as described in Section 9.04.


#### Adding a Shape Around the Image

- In the other case, with the added tag shape around the original traced image, the same process can be used provided the outside shape will be white. However, if a colored background is preferred, then the process is a little different:
  - ♦ Color the tag, as desired. In this case, the tag is colored pink:

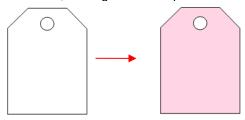

Arrange the cow inside the shape, making sure the cow is visible. Then select both and apply the Texture Snapshot function from the Magic Toolbar. This make the cow image part of the texture fill on the tag:

From the boundary lines you can see there are two shapes: the pink tag and the cow image. The cow shape will cut out if not hidden.

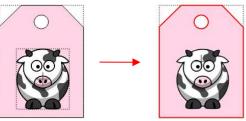

After applying **Texture Snapshot**, there is only one shape: the tag with a pink fill, plus the cow image. The cow shape will not cut.

• The cutting process proceeds as described in Section 9.04.

# 9.06.3 PNC With a Contour Shape Smaller Than the Printed Image

# Wideo

• In this situation, a shape is going to be cut that is smaller than the outside boundaries of the imported graphic. For example, let's say a scalloped border is desired as the cutline:




Original imported image




An interior scallop is to be added and cut.

• Since anything outside of the scallop will not be needed, that part will be eliminated. This is done by first arranging the scallop over the image and then moving the scallop layer to its own layer and to the bottom on the **Layers Bar**:

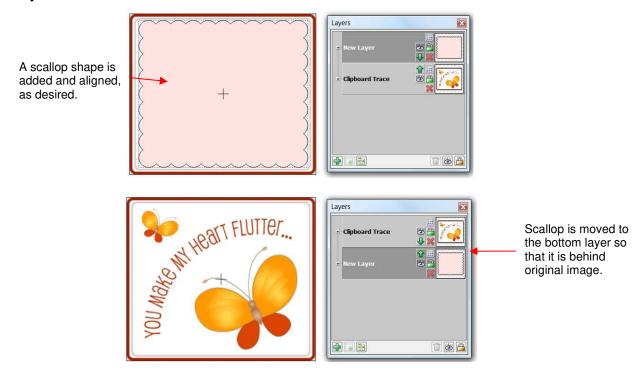

• Next, marquee-select both the original image and the scallop (or use **Ctrl+A** to **Select All**) and then apply the **Join** function from the **Magic Toolbar**. The scallop will now appear on top:

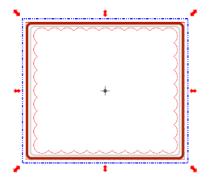

• Immediately apply the **Break** function from the **Magic Toolbar**. The original image now appears but with the scallop shape around it:



• Click elsewhere on the screen so nothing is selected. Then click on the image and drag one image away from the other:



• The original can now be deleted and the scalloped version duplicated (if desired) and the PNC process conducted, as normal.

# 9.06.4 PNC with a Contour Shape Overlapping the Printed Image



• This situation is similar to the prior one, however, in this case the scallop overlaps the borders of the printed image in such a way that it is smaller in one direction but larger in the other:





Original imported image

A heart shape is to be added and cut.

• In this case, the same **Join** and **Break** method is applied as shown in the previous example. Make sure the heart shape is colored as you desire and is on the lower layer. After applying the two functions, drag one shape away from the other:





Shape is now ready for PNC

Original imported image can be discarded or hidden

• A print preview shows that only the original graphic will be printed. Note how the registration marks are printed based on the large white rectangle:




• After printing, proceed with the usual process.

## 9.06.5 PNC with an Inset Cut Line



• This situation may seem to be identical to the one presented in 9.06.3. The difference is that the original trace line will not be eliminated because it is not desirable to eliminate parts of the original image. By using the following method, a bleed allowance is introduced.

A pixel trace can often have areas where the trace line (cut line) will be outside of the original image. This is
especially true of tight interior corners or sharp turns on the image. This results in white areas appearing
around the print and cut:

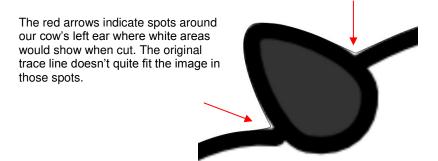


- At the end of Section 7.13, it was shown how to use node and segment editing to correct the trace line so that it better fits the original image. Sometimes, however, there may be more editing needed than would be practical to do. In these cases, an inset cut line can be created. While the same method presented in Section 9.06.3 could be used, in this case it is desired to have what is called a bleed allowance (a margin of error for cutting) by allowing the original larger image to still be printed.
- Select the traced image and access the Shadow Layer function in any of the following ways:
  - ♦ Click on the Shadow Layer icon on the Magic Toolbar




- ♦ Press Ctrl+H
- Right click on the screen and select Shape Magic>Shadow Layer
- ♦ Go to Edit>Shape Magic>Shadow Layer.
- Select the desired Shadow Width using a negative number so that an inset is created. Note that this is typically less than 0.03". Select a Corner Join option and refer back to Section 8.05 for reference. Click on Accept when done.




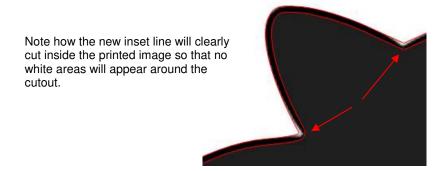


- Typically these inset lines are very close to the original trace lines and cutting both lines could lead to cutting issues, such as tearing or fine slivers of paper coming loose. For that reason, you will want to turn off the original trace lines so that they are not cut. However, the registration marks are tied to these original trace lines because they are larger than the new inset lines. If you simply turn off the original printed layer when you start the PNC process the print and cut will not work correctly. But, there is an easy way to make this work.
- Move the new inset cut line layer to the bottom of the Layers Bar so that it is behind the original imported image.
- Add a large white rectangle to the project. If the page will be filled with multiple objects then the rectangle should surround all of the images. If there is only one image, then the rectangle can be sized to fit just that image. Place on its own layer and move to the bottom:

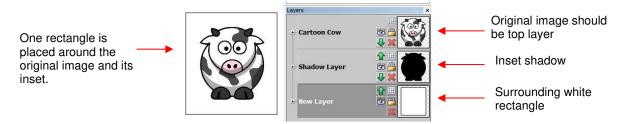


If there are multiple images:

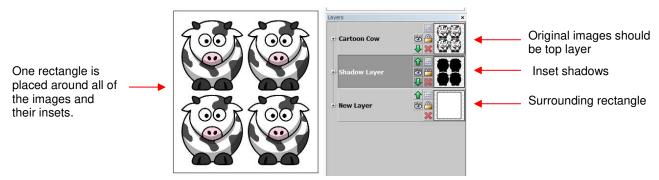

• The rectangle layer must be turned on for both printing and cutting. Because the inset shadow layer is hidden behind the original images, it can also be left on for printing. However, when you are ready to cut, the original image should be hidden so that only the surrounding rectangle and the inset cut line layer are sent to cut.

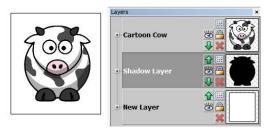

All layers are left on for printing (although shadow layer is optional)

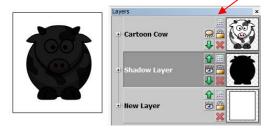

Turn off original image layer for PNC process. Make sure shadow (inset cutline) layer is showing, as well as the rectangle layer

## 9.07 Print and Cut without Printing from MTC

The following sections cover PNC situations in which there will be no printing performed from within MTC.

## 9.07.1 Printing from another Program

- Sometimes users prefer to design and print from a different computer program. In this situation, the best course of action is to add a rectangle that complete encloses the images that will be printed and later cut from MTC. The key things to remember are:
  - The size of the rectangle being added should be a specific and noted size so that an identical rectangle can be added in MTC. The borders of this rectangle will define the locations of the registration marks for the PNC process.
  - ♦ If a vector program (e.g. Adobe Illustrator, Corel Draw, Inkscape) is used and the cut shape(s) is/are defined in this program, then export both the rectangle and the cut shape(s). MTC can import .eps, .ai, .pdf, and other formats. Refer to Chapter 4 for more info on importing and exporting. Also, when you import the file, resize everything together so that the outside rectangle matches the exact size you used when creating it.
  - If a raster program (e.g. Elements, Word, Paint) is used, then you will need to scan your printout and then use the **Pixel Trace** option in MTC to import the image so that the cut shape(s) can be added to the file. In this case, create an outside rectangle to match the scanned one, in both size and location. This is important because the scanner may have scanned at a slightly different size and the results will be more accurate when matching the rectangle dimensions with what the scanner read.

## 9.07.2 PNC Applications with Existing Images



- With MTC, it is even possible to do a print and cut with no printing involved at all! Two such situations are: (1) Cutting out shapes that have been drawn or stamped by hand and (2) Cutting out printed images from a magazine, calendar, newspaper, etc.
- Similar to the prior section on *Printing from Another Program*, the only thing one needs is a rectangle that is printed or drawn onto the page that encompasses the images you want to cut out. That rectangle could be pre-printed onto sheets of paper or cardstock to use for stamping or drawing images or it could be printed onto the paper/cardstock after the images are stamped or drawn or one could even use a rectangular object to hand draw the boundaries of the rectangle. The important thing is for the corners to be precise right angles.
- Once you have the rectangle on the page, scan the image into MTC and Pixel Trace. Then rotate the
  shapes, as needed, so that the lines of the rectangle are perfectly aligned with the grid on the Virtual Mat.
  In other words, make sure the horizontal lines of the rectangle are perfectly horizontal and the vertical lines
  of the rectangle are perfectly vertical.
- Perform the PNC process as usual. The corners of the rectangle serve as the registration marks.

# 10. Applications

## 10.01 Cardstock and Paper



## **Selecting Cardstock**

- White core cardstock does not yield the same cutting quality as solid color core cardstocks.
- Some cardstock brands or types simply do not cut well. Use those for something else besides cutting
  intricate shapes. Other cardstock, such as Bazzill Smoothies, <u>Worldwin Cutmates</u>, Colormates, and
  Michael's Recollections, cut beautifully.
- If a textured cardstock cuts poorly, try flipping it over and placing the textured side face down. Remember to mirror the shapes before cutting, as needed (e.g. text).
- If your cardstock has been exposed to humidity, then dry the cardstock for about 15 30 minutes in an oven that has been preheated to ~100 150 F, but then turned off before placing the cardstock inside.
- With each brand of cardstock, record the settings that worked well so that next time, you'll have a good starting point for your test cut.

#### Settings

- Remember to set your blade exposure to only cut through the material. For thin paper, just the tiniest tip of
  the blade will be needed. For thicker cardstock, use a little more blade, but still not as much as you may
  think. Revisit Section 2.01 for reminders on both the setting of the blade length and the blade height.
- There are recommended forces shown in the *Suggested Settings for Various Materials* table near the end of Chapter 2. Use these as guidelines for your test cuts and then adjust, as needed. Remember to record your own successes!
- A speed of 15 (10 on the original Zing) should work well for most cutting of paper and cardstock. However, it is recommended that you slow the **Cut Speed** down if you feel the recommended setting is too fast.
- For most paper and cardstock, use the red capped blade. For very thick or heavily textured cardstock, you
  may wish to use the blue capped blade.
- The cutting force will vary depending on the density of the paper or cardstock, any exposure to humidity, dullness of the blade, and even the dye used to color the material! Two passes can often be needed with some cardstock, regardless of the cutting force available.
- Keep your cutting mat clean and sticky. Brayering cardstock to the mat will insure firm and even adhesion. Brayering again after the cut can aid in weeding the waste from the cut shapes.

## **Troubleshooting**

- The following list presents the various causes of tearing:
  - ♦ Too much blade is exposed. If you see that the blade is cutting into your mat, shorten the blade exposure. You should only be cutting through the material itself and then, maybe, grazing the adhesive layer on the mat.
  - ♦ The blade is chipped. Try a different blade.
  - ♦ The paper is not adhered well to the mat. Make sure the mat is clean, sticky, and the paper is pressed smoothly and evenly on the surface.
  - ♦ You may be using too much cutting force. Try reducing it and doing test cuts.
  - ♦ You may have too many nodes in the shape. Refer to Section 7.02
  - If the cardstock has been exposed to humidity, then the moisture in the material can make it difficult to cut cleanly. Try drying the cardstock.

- The material itself may be subject to tearing, especially on intricate cuts. Try a different cardstock.
- If the cardstock has spots that didn't completely cut:
  - Try increasing the blade tip height (not exposure) and/or the cutting force and verify the cardstock is will adhered to the mat. Also, some cardstock brands require two passes, so reduce the cutting force and set Multi-Cut to 2 passes.
  - To "save the cut", flip the entire sheet over, and use sandpaper to sand the spots where the cuts didn't complete. You should be able to sand down to where the blade did cut in those spots and your design will then be released from the waste. This is the best way to maintain smooth outer edges.
- My shapes are not quite cut out. Most of them are still attached to the waste at one spot:
  - You probably have **Blade Offset** turned off or set too low. Make sure the setting matches what is needed for the blade you are using. Refer to Section 2.06.

## 10.02 Chipboard

Cutting 0.02" white chipboard:



Cutting 0.03" chipboard:



## Selecting Chipboard

- There are many types of materials considered to be chipboard. Some can be cut by the KNK Zing and others cannot. The best guidelines are:
  - If the chipboard is thicker than the maximum blade length, then it cannot be cut.
  - If the chipboard is very stiff and cannot easily be bent, then it probably cannot be cut.
  - Thin flexible chipboard is the best choice. It's worthwhile finding a particular brand of chipboard, such as that sold at KNK USA, to use in your projects so that you will know which blades and settings work best each time.
  - For a thicker look, consider cutting two copies of the same shape from thinner chipboard and adhering together, especially if the design is somewhat intricate.
  - Just like with some textured brands of cardstock, some chipboard types will yield cleaner cuts on the bottom side. So, mirror your images first after verifying so that you can use the other side of the cut shape.

## **Settings**

- As with all materials, set the blade length to be just a fraction longer than the thickness of your chipboard and use the thick materials, blue capped blade. For thin chipboard you can use the red capped blade. Adjust the blade offset accordingly.
- Chipboard can easily come loose from the mat. Try using masking tape or blue painter's tape around the outside edges of the chipboard to prevent the chipboard from slipping during cutting. You can also apply a stabilizer such as freezer paper or Heat n' Bond to greatly improve both the consistency of cutting, as well as the intricacy of what can be cleanly cut.
- Some thin soft chipboards, such as cereal box, may cut at a setting of 110, thus try this setting for your test cut. Increase in increments of 10, as needed. For denser, thicker chipboards, you will probably need to increase the pressure quite high and use several passes. Set Multi-cut to two, three, or even more passes, as necessary. Use one of the **Test Cut** choices or one of your own small shapes, to make sure a clean cut can be achieved before attempting to cut your larger shape or shapes.
- The Zing offers some very slow speeds and cutting chipboard may require these. Don't hesitate to reduce the speed a setting of 8 or slower, if you find the cutter is struggling to cut the chipboard or the shapes being cut are distorted.
- When cutting thicker materials, the blade holder needs to be raised in the blade holder seat to enhance the downward force. To do this, try using a stack of 13 Post It notes, as described in Section 2.01.

## **Troubleshooting**

- Some chipboard will produce a lot of "crumbs" during the cut and this can build up inside the blade holder as
  well as build up around the cut lines causing interference with the blade during the second pass. For this
  reason, some users will use canned air to blow the crumbs away from the surface between each pass. You
  may also need to clean the inside of the blade holder by removing the blade and taking it apart, so that any
  small pieces can be removed.
- If the test cut was perfect, but the shapes failed to cut cleanly, the mat may not have been sticky enough to hold the chipboard throughout the cut. Rather than add more adhesive, you may want to use a stabilizer as described under *Selecting Chipboard*. Also try slowing the cut it the shapes were fairly detailed and the uncut sections were on tight curves.
- If a stuttering sound is heard during the cut and/or the shapes are distorted, then reduce the speed and force and increase the number of passes. The blade is catching in the chipboard causing the mat to slip. You need to make things easier on the cutter as the blade works its way through the dense chipboard.

## 10.03 Vinyl









#### **Types of Vinyl**

- There are a number of different kinds of vinyl available at KNK USA:
  - ♦ Decal/Sign vinyl which can be used to make stickers for windows, tumblers, etching projects, etc.
  - ♦ Wall vinyl which can be removed without damaged to interior walls. It has a beautiful matte finish and can also be applied to tiles, chargers, and even greeting cards.
  - ♦ Outdoor Vinyl which has an extended outdoor duration (3-5 years). There is also a 5-8 year High Performance variety.
  - Metallic Vinyl which has a permanent adhesive and is suitable for outdoor use or for party decorations, greeting cards, laptop covers, etc.
  - ♦ Accupro Wrap Vinyl for wrapping cell phones, laptops, notebooks, etc.
  - Iron-on Vinyl for decorating garments or other surfaces such as cardstock. Refer to Section 10.05 for details on cutting and applying.

## Settings

- Vinyl has a backing sheet which can serve as the carrier/mat during cutting. If you want to cut the vinyl without using a cutting mat, the vinyl needs to be at least 4" wide so that both sides will be gripped by the two rightmost pinch wheels. (For older Zing models, the vinyl needs to be at least 13" wide.) If you are cutting from vinyl which is narrower than this or cutting from scraps, then use a cutting mat to hold the vinyl during the cut. Alternatively, you can tape the vinyl to a wider medium, such as contact paper, and that can serve as a carrier in the Zing.
- On long cuts, it's important to have the vinyl aligned straight in the machine. Cut the needed length from the
  vinyl roll (adding a few inches for error allowance). Feed the vinyl about half way through the cutter and then
  drop the pinch wheels. Use the up and down arrows in the Set Blade Origin window to feed the vinyl in and
  out of the Zing, to make sure the vinyl stays aligned.
- Set the origin at least 1/2" away from the right side and a little ways in from the bottom.
- While there are many types and thickness of vinyl, in general it is very easy to cut. Thus, start with a conservative estimate for the force setting in the initial test cut, say 5. Use the red capped blade and start with <u>barely</u> any blade exposed. Do a test cut and then gently lift the corner of the vinyl from the backing sheet. Make sure the test cut is a clean cut and the blade did not penetrate the backing paper.

- Vinyl can usually be cut at a speed of 15 (10 on the original Zing), unless very small, intricate shapes are involved. Then you might want to use a lower Cut Speed.
- If you store your vinyl in a warm location, the adhesive can be affected and that can then affect the cutting. Also note that some vinyl colors have a tendency to pull away from the backing sheet more easily than others. If you notice the vinyl pulling up in corners and tight spots, try slowing the cutting speed.

#### Applying Vinyl

- For easier removal of the waste from the backing, add a rectangle around the perimeter of the shape(s) you are cutting. Select everything and apply a Join. This will then ensure that the interior shapes are cut first, with the outside rectangle cut last.
- When weeding, you may need to cut away and remove smaller waste parts versus trying to lift the entire waste section at one time. You do not want the waste vinvl inadvertently coming into contact with the shapes you want to keep. Use a craft knife or paper piercer to gently lift away pieces of waste vinyl to discard.
- If you are applying small lettering or doing an etching application, do NOT weed the waste vinyl. The entire piece should be applied to the project surface, smoothed down firmly and evenly, and then weeded. The adhesion between the vinyl and the hard surface will make weeding much easier, with less likelihood of small shapes coming loose.
- To transfer vinyl to a wall (or window or other surface), apply transfer tape across the vinyl, repeating rows of tape to completely cover the shapes. At the top, have one layer of tape with just the bottom half covering the vinyl so that the top half can be pressed to the wall and used as a hinge. Once you have the vinyl aligned as desired, flip up, leaving that top piece of tape adhered/hinged to the wall. Remove the backing sheet from the vinyl. Then carefully bring the vinyl back down and begin pressing to the wall, smoothly and evenly. Use an old credit card or plastic scraper to smooth out wrinkles and get better adhesion. Gently peel away the transfer tape from the top and press again with the credit card or scraper.

## 10.04 Fabric and Felt







- It is highly recommend that the Zing Fabric Blade be used when cutting fabric and felt. It is designed to give sharper cutting in tight corners and points.
- When cutting with the fabric blade, it is not necessary to apply a stabilizer to all fabrics. While some thicker fabrics will cut much better with an iron-on stabilizer such as Steam-a-Seam 2 or Thermo-Web's Heat n' Bond, others will still yield good results when cut without it. Some users also prefer to iron their fabrics to freezer paper before cutting.
- With or without a stabilizer, it is highly recommended that a clean and sticky mat be used. If no stabilizer has been applied, then brayer the fabric firmly and evenly to the mat. With most fabrics it will be necessary to use stickier mats than normal and tape the outside edges of the fabric.
- Because the backing sheets on Steam-a-Seam 2 and Heat n' Bond are slippery, spraying them with Odif USA 505 Temporary adhesive can then make them stick firmly to the mat and not slip during cutting. Some residue from the 505 may get onto the mat, thus the reason to use a dedicated mat for fabric. This residue will add to the bonding for future cuts. (Thanks to Lynn Keniston for this idea!)
- Some users also prefer to remove the backing sheets on stabilized fabrics before brayering to the cutting mats. This works as well.
- The best unstiffened (soft) felt to use is 100% wool. It cuts cleaner than other types. A wool blend should also work well. The Nonwovens WoolFelt is 35% wool, 65% Dacron and tends to cut very cleanly. If the felt you have is not cutting well, consider applying one of the stabilizers mentioned above.
- If the felt is pre-stiffened, then it should cut fine using the blue capped thick materials blade versus the fabric blade. Because of the thickness, you may need to tape the felt to the mat to prevent slippage during cutting.
- In general you will need to use 2 or 3 passes when cutting most fabrics and felts. It is necessary so that all fibers will be cleanly cut.

• For cutting force, it will depend on the fabric. Refer to the table at the end of Chapter 2 for recommended settings.

## 10.05 Iron-On Transfer



## **Types of Iron-On Transfer**


- There are a number of different kinds of vinyl available at KNK USA:
  - ♦ Regular Iron-On Transfer (T-Shirt Vinyl)
  - ◊ Iron-On Flock
  - ♦ Glitter Flex and Glitter Flex Ultra
  - ♦ And more!

## **Cutting Iron-On**

Iron-on transfer vinyl and flock consists of three layers:



For cutting, have the dull side up (adhesive side up):

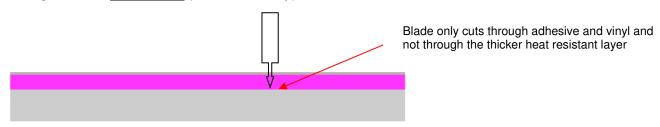

- Because iron-on transfer has the heat protection layer, which will not be cut, this can serve as the
  carrier/mat during cutting. The material will need to be at least 13" wide so that both sides will be gripped by
  the pinch wheels. If you are cutting from iron-on which is narrower than this or cutting from scraps, then use
  a cutting mat to hold the material during the cut. Alternatively, you can tape the iron-on to a wider medium,
  such as contact paper, and that can serve as a carrier in the Zing.
- The force required is ~20 30 for regular iron-on. Other types may require higher settings. Be sure to do a test cut first and then see if the vinyl layer will peel away from backing. You should be able to cut at a speed of 15 (or 10 on the original Zing).
- Remember to <u>reverse your image</u> before cutting! Because you are cutting with the adhesive side up, you'll
  be flipping the material over, after weeding, but before pressing. To mirror your image, select it and then
  apply the **Mirror** function.
- Cut around your image with scissors before weeding. Note that it's really hard to see the cut image, so be careful!
- Use a paper piercer or craft knife to grab onto a piece of the waste vinyl and then pull to remove. Remember to weed small internal parts, as well.

## **Adhering Iron-On**

- Use a hot dry iron (cotton setting) and with steam turned off.
- Use a fairly firm surface.... Not a highly cushioned ironing board.
- Insert a cloth between the layers of a shirt in case adhesive melts through to other side
- Press shirt first to create a smooth flat dry surface.
- Arrange pattern on shirt, carefully centering.
- Press firmly for 10 full seconds. Do not move iron around... just press firmly.
- Allow to slightly cool and then remove top heat-resistant layer. If pattern begins to come up, then cover with the heat-resistant layer and immediately repress for another 10 seconds.
- Some people will also flip shirt inside out and press from other side for another 5 seconds. Note: other types
  of iron-on may require additional pressing time or even less pressing time. Contact your supplier for
  information.
- Wait 24 hours before laundering.

## 10.06 Rhinestone Templates

#### **Designing Rhinestone Patterns**

- Refer to Section 8.12 for specific instructions on designing rhinestone patterns in MTC. The most important things to remember are:
  - The circles should be roughly 0.4 mm larger than the actual stones you've purchased. For example, if you have 10SS stones, then design using 13SS or 14SS stones in the software. This allows the stones to more easily fall into the holes during brushing.
  - Always size your shape first before converting into a rhinestone design. Once the circles are created for the pattern, the pattern cannot be resized without changing the size of those circles.

## **Cutting Rhinestone Template Material**



- Rhinestone templates can be used hundreds of times. There are several commonly used materials for making these templates. The current most popular choices are:
  - The green rhinestone template material sold at KNK USA is the most popular because it is less expensive than the other options and has been around longer. It is recommended over a similar thinner rubber sold by companies who market their material for the lower force cutters. The disadvantages to using any rubber template material is that you need to apply a solid backing after the template is cut and also dust the template with a powder so that the powder will cover any of the permanent adhesive exposed in the holes. The solid backing typically chosen is foam board or stencil board.
  - The black Rock-it flock, also sold at KNK USA, is more expensive than the rubber template materials but doesn't require a backing to be applied after cutting. It also doesn't require dusting. The Rock-It templates can be used to mix and match designs, such as combining letters and images.
  - ♦ Sticky Flock is a similar material to Rock-it but is more expensive still and slightly thinner. It has the same advantages as Rock-it.
- The first step before cutting the template is to check the size of the design you've created and then cut a piece of rhinestone template material that is at least 1" larger in both height and width compared to your design. It is beneficial to have a little bit of material around the edges of the design where excess rhinestones can still be brushed back over the design.

- Peel off the backing sheet first and press the rhinestone material to a clean sticky mat. Brayer firmly to make sure the rubber has excellent contact with the mat.
- Set **Multicut** to 2 times, again to aid in weeding the cut circles. Use a 60 degree blade for cutting and a force of about 90 for the green rubber and 80 85 for the flocks. Perform test cuts of small numbers of circles (say, around 8 10) to make sure the force you're using is sufficient.

## **Weeding and Brushing in Rhinestones**

- After cutting, brayer the template material again. As you lift the pattern, the majority of the little circles should remain stuck to the mat. If there are still circles attached, then press firmly and lift on other parts of your cutting mat. Eventually, you should have the majority removed.
- If your template was cut from a rubber, apply your pattern to a backing material such as <u>stencil board</u> or foam board. Make sure it's a different color from your rubber. You may wish to first cover the backing board with clear mailing tape for a slicker, more permanent surface. Verify that none of the little circles are still attached to the back of the template and causing a "bump" in the pattern.
- Again, if your template was cut from rubber, using an old toothbrush and brush some powder (talc, baking, facial) into the holes. Tap upside down to remove excess powder and then wipe the top of the pattern clean.
   The powder will stick to any adhesive inside the holes and prevent rhinestones from getting stuck in the holes.
- Place your template into the bottom of a bead tray, cake pan, or other large flat container. Those who use
  the flock materials will often cover the bottom of their container with a layer of the same flock. Pour the
  rhinestones on top of the template.
- Use a <u>Shur-Line Trim and Touch-up Pad</u> to brush the <u>rhinestones</u> in a circular motion. Keep brushing and you will find that the stones that landed upside down will be brushed out and correct ones will replace them. This pad type brush is essential to the ease and success of this important step!
- When ~95% of the pattern is correctly filled, then use tweezers, a toothpick, or just your finger to position the last few rhinestones into the pattern.
- Cut the <u>rhinestone transfer tape</u> to size and then press it down onto your stones. Press firmly but do not push the stones deep into the holes. If you have a problem with the stones jumping as you are dropping the transfer tape, then try using a Bounce sheet or anti-static spray on the tape before pressing.
- As you lift the tape, start in a corner and keep one side pressed down and watch to make sure all stones are being lifted. If a stone fails to lift, press back down to pick it up. Once the stones are lifted, you can now place the transfer tape back onto its backing or go ahead and press the stones to your shirt, other fabric, or even cardstock!
- Note that the transfer tape is reusable! You should be able to get 4 or 5 pressings from one piece, even though it becomes wrinkled from the pressing. Keep using until it doesn't pick up and hold the stones.

## **Heat Pressing Rhinestones**

- If using your home iron to press the stones to a shirt:
  - ♦ Use a hot dry iron (cotton setting or higher with steam option turned off).
  - ♦ Use a firm surface... not a highly cushioned ironing board
  - Insert a cloth between the layers of a shirt.
  - Press shirt first to create a smooth flat dry surface.
  - Arrange pattern on shirt, carefully centering.
  - ♦ Press firmly for 10 seconds. Then move about ½" in case steam holes were over areas of some stones and then press firmly for another 10 seconds.
  - Move to another area of stones and repeat.
  - Flip shirt inside out and press for another 10 seconds on side where stones are applied.

- Allow to thoroughly cool before removing clear transfer tape.
- If using a <u>heat press</u> to press the stones to a shirt:
  - ♦ Set the temperature to ~ 330—350 degrees F (165 175 degrees C) and set the pressure to medium.
  - Press garment first for a flat dry surface.
  - ♦ Arrange pattern on shirt, carefully centering. Press for 10-12 seconds.
  - Peel cold, cover with Teflon sheet, and re-press another 10-12 seconds. Alternatively, flip the shirt inside out and press from the back for 10-12 seconds.
  - Use a lower temperature if pressing on 50/50 cotton poly fabric. Use a higher temperature on denim or tote bags.

## **Extra tips on Rhinestone Applications**

- If you are combining iron-on transfer with rhinestones, do not press the rhinestones onto the iron-on vinyl. While it will appear to have worked well, the stones will fall off once the garment is laundered. When using both, create a contour line around your iron-on pattern for the stones.
- Pressing rhinestones to cardstock also works very well. If pressing onto the front of a greeting card, unfold the card first.
- After pressing and allowing to cool, use your fingernail or an old credit card/gift card to scrape the pattern to see if any stones come loose. If so, replace those stones with new ones and press again.

## 10.07 Drawing with a Pen or Glue Pen

• With the Zing, you can draw with any pen, pencil, marker, or glue pen, that can be securely gripped by the blade holder seat and not be dragging across the material. The optional Zing Pen Holder can also be used to hold thinner pens. The advantage of the Pen Holder is that the center of the pen will be positioned the same as the blade on the Zing Blade Holder, thus allowing you to draw with the pen and then cut out a shape. The pen will draw in the correct relative positions to the cut:



- If you do not own the Zing Pen Holder or you wish to use a pen which does not fit into the holder, then refer to the following section: Adjusting for Differences in Diameters of Tools and Blade Holders.
- When the project involves both drawing and cutting, you will need to use WYSIWYG for the cut mode so
  that the shapes will be aligned.
- Always draw first and then cut. Turn off the **Blade Offset** for drawing because it is not needed and can give undesired results. But then remember to turn it back on for the cut process.
- Do not have the pen positioned too low in the blade holder seat or the tip of the pen could drag across the paper when moving from one shape to the next.
- Make sure your shapes will not be drawn where any of the pinch wheels travel over the material. Otherwise, the ink or glue could smear. This may also be a problem with the small press rings. You may want to slide the rings to either side of the Zing (next to the pinch rollers), so that they will not smear the ink or glue during the drawing process.

- The Sakura Quickie glue pens work well in the Zing. They will fit into the Zing Pen Holder, as well as directly into the blade holder seat (if alignment with cutting isn't needed).
- The open path fonts available in MTC should work well for drawing as they provide single drawn lines and curves versus an outline form. Refer to *Section 5.11*.
- The following video shows how to use the Zing pen holder and the blade holder for an aligned "draw and cut."

Video

• The following video shows how to use a glue pen and the blade holder for an aligned "draw and cut."



## Adjusting for the Difference in Diameters of Tools and Blade Holders



The following method was first presented by Bryan Williams in an MTC Forum webinar. Diane Hiscoe made the video above, using Bryan's method and inspired me to create the following tutorial. Thanks, Diane!


If you plan to use two tools with different diameters, then you will face an alignment problem. In the following
example, two glasses and an inner circle will be drawn with a silver gel pen and then the outside circle cut
out



 Because the gel pen is thin, it sits further back in the blade holder seat than the blade holder. With no adjustments made, the resulting drawn image and cut circle are out of alignment:




• However, there is a straight-forward method one can use to compensate for tools with different diameters. This method involves adding a rectangle, within MTC, around the shapes. This rectangle will be drawn with the pen and then the corners will be used as registration marks for a print and cut process:

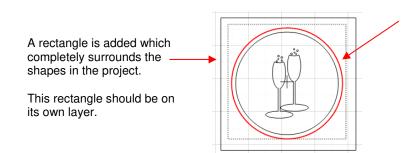


The red line is the cut line. The other lines will be drawn with the gel pen. These lines are the glasses, inner circle, and outer rectangle.

• The layers to be drawn (glasses, inner circle, and outer rectangle) are showing on the **Layers Bar** and the layer with the cut line is turned off:

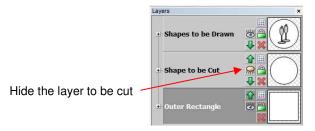

- Set the origin using the laser and select **WYSIWYG** for the **Cut Type**. Turn off **Blade Offset** and then set the appropriate **Force** and **Speed**. Draw the shapes with the pen.
- Turn off the layer with the glasses and the circle, but leave the outer rectangle layer turned on. Also, now show the layer with the circle to be cut:

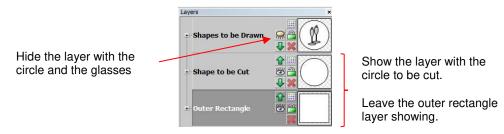

Again set the origin using the laser. Turn on Blade Offset and set the appropriate Force and Speed. Set
the Cut Type to Print and Cut. Execute the cut, using the corners of the rectangle as the registration
marks. The resulting gel pen lines and cut will now be aligned:



## 10.08 Embossing and Scoring


- The <u>Zing Embossing Tool</u> has two different sized embossing heads. The smaller one is recommended when scoring cardstock for fold-up projects, such as pop-up cards, gift bags, and small boxes. Either head can be used for embossing shapes.
- When the project involves both embossing/scoring and cutting, you will need to use WYSIWYG for the cut mode so that the shapes will be aligned.
- When embossing, it is recommend that a soft material be place beneath the paper or cardstock to allow a deeper impression to be made. One excellent material to use is non-slip shelf liner. Even though the surface is somewhat uneven, you will obtain very good results. Other materials which can be used include rhinestone rubber, craft foam, and felt. Make sure the material is well adhered to the mat (tape it down, if necessary). Then tape your paper or cardstock to the top of this material.
- When scoring, the paper or cardstock can be applied directly to the mat, just as you do for cutting. This makes it much simpler when you need to score and then immediately cut.
- Make sure you do some tests first to get the best settings for the scoring or embossing you need. For scoring cardstock, this typically involves a higher force (~150) and two or three passes. Refer to the Suggested Settings table at the end of this chapter. If you have a soft material beneath your

paper/cardstock, then a lower force can be used, but you may still need several passes. Also raise the tool in the blade holder seat the same way you do with the blade holder, to get more force applied.

- Remember to turn off the **Blade Offset** setting when scoring or embossing but turn it back on when you get ready to cut.
- When embossing paper or cardstock, it is recommended that you use the Shadow Layer function to create
  a very small outline and inline, say 0.01". These tiny offset lines will then produce a slightly thicker overall
  outline of your shapes. This works better than fill embossing which can stress the cardstock and cause
  wrinkling. Here are the steps:
  - Create the shape you wish to emboss. In this example, the numbers 25 are used for a 25<sup>th</sup> wedding anniversary:



• Select the shape and go to the **Shadow Layer** function: and perform the following:

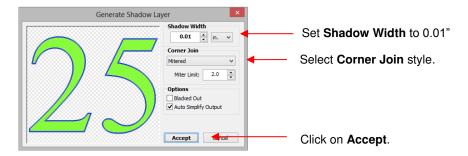

 After clicking on Accept, re-select just the original image, and go to the Shadow Layer function again and perform the following:



 Now you have three versions of your shape and when using the embossing tool, you will have a thicker outline of the shape:



The following video shows the Zing embossing tool being used to emboss a design onto metal.



## 10.09 Engraving





Engraving Precut Items: Video



- The Zing Engraving Tool can be used to engrave vellum, foils, acrylic, and most metals, including trophy labels, dog tags, and jewelry charms.
- The same basic guidelines apply to engraving as in embossing and scoring:
  - You will probably need to use the **WYSIWYG** cut mode.
  - You will need to turn off the Blade Offset setting for engraving.
  - You will probably need to use multiple passes to get the desired results.
- On softer metals, you may not want the engraving tip too far above the metal as it can leave a pock mark when it drops to start engraving. If possible, test on scraps first.
- Refer to the Suggested Settings table at the end of this chapter or force and speed settings on various materials. Note that you can engrave on materials that cannot be cut on the Zing, such as jewelry charms. dog tags, and trophy plates.
- The open path fonts available in MTC should work well for engraving. They contain single path lines and curves versus outlines and are usually more desirable when engraving letters. Refer to Section 5.11.

## **Project: Engraving a Dog Tag**

- When engraving items that are already cut (such as the items listed previously), it can sometimes be tricky getting the perfect alignment you need. Here's a method that works well (thank you to Michelle Hessler for posting this technique):
  - Carefully measure the dimensions of the item. For example, it if is a circular dog tag, then measure the diameter. Recreate the shape in MTC and size it to be the same. In the follow example, the diameter of the dog tag is 1-1/8", so a circle of the same size is drawn:

Photo of actual dog tag






Circle created in MTC at the same diameter as the tag

- Because this shape will be cut from another material to use in the alignment process, the shape is resized to be a tiny bit larger. For a circle, you can simply resize it in the Sel Properties Bar. If the shape is something non-symmetrical, then use the Shadow Function with a Shadow Width of about 0.04".
- Next the desired lettering and/or shapes are added. In this case, the dog's name and a phone number with "Please Call" are chosen. Because there is also a hole near the top of this dog tag, a 1/4" high square is added just to show the top limit of where the lettering could be located. This is deleted as soon as the lettering is added and positioned:




The lettering is placed on one layer in MTC while the circle is place on a different layer. A sheet of thin chipboard is placed on the cutting mat. Using WYSIWYG cut mode, the circle is sent to cut:

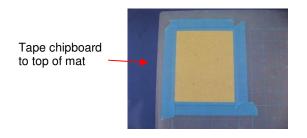



Circle layer is sent to cut and removed from the rest of the chipboard.

After the hole is cut in the chipboard, the mat is left in place in the Zing! This is important. The cut circle is removed and the actual dog tag is placed inside the cut hole. Tape is used to secure the tag:

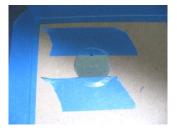

♦ The blade holder is replaced with the Zing Engraving Tool. In the Set Blade Origin window, Use Last is selected so that the laser light will return to the same location as was used for the cut. Blade Offset is turned off and a Force of 140 and 3 Multicut passes are set. The letter is engraved in the same location on the tag as was designed on the Virtual Mat:





## 10.10 Using the Punch Tool

- The Zing Punch Tool can be used for creating decorative designs (such as pergamano and other parchment arts) or for creating small holes for paper embroidery.
- To protect the mat and the thin punch, it is recommended that a thick soft material be used as a cushion between the paper/cardstock and the cutting mat. Suggested materials that will work well include non-slip shelf liner, craft foam, and stiffened felt.
- The same basic principles apply to punching as in embossing and scoring:
  - ♦ You will probably need to use the **WYSIWYG** cut mode.
  - ♦ You will need to turn off the Blade Offset setting.
  - ♦ You will possibly need to use multiple passes to get the desired results.
- Refer to the Suggested Settings table at the end of this chapter or force and speed settings on various materials.
- To design a punch pattern, use the Rhinestone function presented in Section 8.12, however, select the smallest size available from the drop down menu. This will create holes suitable in size for paper embroidery. After clicking on Accept, you may need to apply a Break in order to re-space and tweak your overall design.

- If the circle sizes from the **Rhinestone** function produce holes that are larger than what you desire, then repeat the design process but first, make your overall design twice as large as you plan to use. In the **Rhinestone** function window, again select the smallest size, but double the spacing. Then, after clicking on **Accept**, reduce the overall design by half! Your holes will now cut at half the size of the first design you created.
- As with the other tools, testing is necessary to get the perfect settings for the particular material you are punching. Don't forget to set the punch tip height higher, just as you do with the blade holder, in order to get more force applied.

## 10.11 Cake Decorating

# Video Video

- Here are some ways to use the KNK Zing in cake decorating (thank you to Rebecca Stewart for posting the info in this section):
  - ♦ Cupcake wrappers (refer to *Section 8.10*)
  - ♦ Icing sheets: both regular and print and cut
  - ♦ Stencils for airbrushing cakes
  - ♦ Fondant, gum paste, Sugar Veil cut shapes
  - Templates from thin chipboard to use as patterns when cutting thick layers of gum paste
- Icing sheets can be cut on the regular Zing mat, although it's a good idea to have one dedicated to cake use only. The same is true for the blade holder and blade.
- Press the icing sheet to the mat, making sure the pinch rollers will not travel over the icing sheet! The plastic
  backing on the sheet acts just like the backing on vinyl cut through just the icing, leave the backing intact.
  Peel off the cut and put the leftover sheet back in the bag. Recommend cut settings for icing sheets are
  presented in the table at the end of *Chapter 2*.
- When cutting fondant or gum paste, roll it out and place it on a lightly greased piece of wax paper, and stick
  that down on the sticky mat. Whether you cut through the wax paper or not, the wax paper makes it easier
  to get the cut shapes off the mat without distorting them. Some people prefer to use shortening applied to a
  mat with no adhesive, however, it can be tricky getting the shapes cleanly off the mat.

## 10.12 Additional Applications

#### Wood



- Cutting wood can be tricky because it is subject to splintering. Stick to very thin pieces of balsa or birch (1/16" or thinner).
- Use a low force (~80) and not the typical blade tip height used for other materials, which can increase the chance of splintering when the blade drops to puncture the wood. Try using 6 Post It notes for setting the blade tip height.
- Tape the balsa to a sticky mat to keep it from shifting during the cut. Also decrease the blade offset so that corners will be cut more rounded. Use a low speed (~8), but you can keep the Up speed at 15 or higher (10 or higher on the original Zing).
- If you plan to engrave the wood first, use the small end of the Zing Embossing Tool. Unlike the procedure when embossing or engraving other materials, perform the cut first and then emboss/engrave. If you try embossing first, the wood can be weakened and made more susceptible to splintering.



## **Craft Plastic**

• Craft plastic (PET-G) is sold at a variety of Internet sites, including E-Bay, Dick Blick, Clear Scraps, and Scrapbook.com. Not only can it be cut on the Zing, but fold lines can be created using the Zing engraving tool. The advantage of PET-G is that you can fold these score lines back and forth many times without the plastic snapping. If you prefer, you can also create fold lines by cutting dashed lines. These also are very strong and can be folded dozens of times before weakening.



- PET-G comes in 0.015" and 0.02" thicknesses with protective sheets on the front and back to protect it from scratches. These protective sheets will make it appear to be colored, but it is perfectly clear when the sheets are removed. You can remove both before cutting, but you might prefer to leave one of the sheets attached to protect the bottom side from any adhesive on the cutting mat. This bottom sheet can also serve as a stabilizer during the cut.
- PET-G doesn't need to be cut totally clean. So, if there are parts that are not cleanly cut, try tearing the shape away from the waste. That should work just fine. Ideally, of course, the cut will be clean and this step not needed. Refer to the table at the end of *Chapter 2* for cut settings and the table at the end of this chapter for scoring settings.

# Suggested Settings for Various Accessories<sup>1</sup>

<u>Important:</u> Remember to turn **Blade Offset** back on after using accessory tools and before cutting with your blade again!

Application/Material	<u>Tool</u>	<u>Force</u>	Speed	(Cut/Up)	# Passes	Surface	Other Comments
			Zing	Zing Air			
Drawing on paper	Sharpie Marker	20	10/10	15/15	1	Mat	Pen was almost touching paper in order to be grasped by front screw
Drawing on paper	Sharpie Liquid Pencil	40	10/10	15/15	2	Mat	Used 2 passes because pencil hesitates to start drawing each time.
Drawing on paper	Uni-ball Signo White pen	30	9/10	11/15	1 - 2	Mat	Make sure wheels will not travel over lettering; Make sure ink is flowing before drawing' have test item
Drawing with glue on paper	Sakura Quickie Glue Pen	30	9/10	11/15	2	Mat	Use 0.01" Inset Shadow and Outset Shadow to provide a thicker outline of shape.
Embossing Cardstock - Georgia Pacific 100#	Embosser - largel end	95	9/10	11/15	3	Shelf Liner	Used 0.01" Inset Shadow and Outset Shadow to provide a thicker outline of shape.
Embossing Chalkboard Cardstock	Embosser - large end	160	10/10	15/15	2	Mat	Lighter white result (refer to engraver below)
Embossing Worldwin Colormates	Embosser - largel end	130	10/10	15/15	3	Shelf Liner	Used 0.01" Inset Shadow and Outset Shadow to provide a thicker outline of shape.
Engraving Acrylic	Engraver	160	10/10	15/15	2	Mat	Hard acrylc (which cannot be cut)
Engraving Balsa - 1/16"	Embosser - small end	80	8/10	9/15	2	Mat	Balsa was more likely to split if the engraving was done first, thus cut shape first; use 6 Post It notes for height.
Engraving Balsa - 1/32"	Embosser - small end	110	8/10	9/15	2	Mat	Use 13 Post It notes for height.
Engraving Bassword - 1/16"	Embosser - small end	160	10/10	15/15	6	Mat	Use 6 Post It notes for height.
Engraving Craft Plastic	Engraver	160	9/10	11/15	2	Mat	0.03" PET-G
Engraving Chalkboard Cardstock	Engraver	30	10/10	15/15	2	Mat	Heavier white result (refer to embosser above)
Engraving Vellum - 48#	Engraver	100	10/10	15/15	2	Mat	Used 0.01" Inset Shadow and Outset Shadow to provide a thicker outline of shape.
Engraving Vellum - thin	Engraver	50	10/10	15/15	2	Mat	Used 0.01" Inset Shadow and Outset Shadow to provide a thicker outline of shape.
Engraving Metal Dog Tag	Engraver	140	9/10	11/15	3	Mat	
Letterpress Cardstock - 220 lb Crane	Embosser	160	11/11	18/18	6	Mat	tested both large and small ends of embosser
Punching Cardstock - Georgia Pacific 100#	Piercer	85	10/10	15/15	2	Craft Foam	Use craft foam in lieu of shelf liner. It's important that the punch needle not hit the cutting mat. It can break.
Punching Velllum	Piercer	10	10/10	15/15	1	Shelf Liner	Because of low force, shelf liner was placed directly onto cutting mat.

These settings should be used for the initial testing. Adjustments may be necessary based on variations in the material, surface beneath paper, humidity, condition of the cutting mat, etc. Most tests were done with a blade tip height equal to a stack 25 Post-it notes or 12 Georgia Pacific 100# cardstock pieces.

<sup>© 2009- 2014</sup> Sandy McCauley, All Rights Reserved

Application/Material	<u>Tool</u>	Force	Speed	(Cut/Up)	# Passes	<u>Surface</u>	Other Comments
			Zing	Zing Air			
IScoring Cardstock - Bazzill	Embosser - small end	160	10/10	15/15	4	Mat	
	Embosser - small end	160	10/10	15/15	3	Mat	
	Embosser - small end	160	10/10	15/15	2	Mat	
Scoring Craft Plastic	Engraver	150	9/10	11/15	1	Mat	0.03" PET-G; scoring for fold-up projects

These settings should be used for the initial testing. Adjustments may be necessary based on variations in the material, surface beneath paper, humidity, condition of the cutting mat, etc. Most tests were done with a blade tip height equal to a stack 25 Post-it notes or 12 Georgia Pacific 100# cardstock pieces.

<sup>© 2009- 2014</sup> Sandy McCauley, All Rights Reserved

# **Settings Form for Accessory Tools**

Application/Material	<u>Tool</u>	<u>Force</u>	Speed (Cut/Up)	# Passes	<u>Surface</u>	Other Comments

<sup>© 2009- 2014</sup> Sandy McCauley, All Rights Reserved

# **Appendix A Keyboard Shortcuts**

<u>Shortcut</u>	<u>lcon</u>	Description	Menu, Other Location
Standard Functions			
Ctrl+N	<b>+</b>	Open a new file/project	File>New or Tab bar
Ctrl+O		Open an existing .mtc file/project	File>Open
Ctrl+S		Save a file/project	File>Save
Ctrl+Shift+P		Print	File>Print
Ctrl+Z / Ctrl Y		Undo last action / Redo last action	Edit>Undo / Edit>Redo
Ctrl+F6		Go to next window/project	Top left icon in Menu Bar
Ctrl+Tab		Go to next window/project	Window>Next Window
Ctrl+F4	WIE.	Close current project	Top left icon in Menu Bar
Alt+F4		Close all projects and MTC, as well	

# **Viewing and Zooming Tools**

Ctrl+3		Zoom to Virtual Mat	View>Zoom To>Mat
Ctrl+4		Zoom to All Shapes on Screen	View>Zoom To>All
1		Zoom to 100%	View>Zoom To>100%
2		Zoom to 20%	View>Zoom To>20%
3		Moves display to selected shape(s), keeps current zoom level	View>Zoom To>Selected
4		Zoom to 300%	View>Zoom To>300%
5,6,7,8,9,0		Zoom to 500%, 600%, 700%, 800%, 900%, 1000%	View>Zoom To>500% 1000%
+ or -	⊕	Zoom in or Zoom out	Press + (or -) key on the numeric keypad; icons on File Toolbar
D		Display textures while other shapes are selected	
Roll mouse wheel		Move workspace up and own	
Ctrl+roll mouse wheel		Zoom in and out, centered on location of mouse cursor	
Spacebar+drag left mouse button		Pan workspace	
Ctrl+Shift+I	S	Toggle the showing of nodes for selected shapes	Edit>Shape Magic>Advanced>Nodes On Mat

# **Selecting Shapes**

Ctrl+A	Select all	Edit>Select All
Shift+Esc	Select next shape	Edit>Previous Shape
Shift+Tab	Select previous shape	Edit>Next Shape
Esc	Select none	Edit>Select None
Shift	Hold Shift and click on shapes to add to selection	

# Shortcut Icon Description Menu, Other Location Duplicating Shapes Ctrl+C Copy to clipboard Edit>Copy Ctrl+V Paste from clipboard Edit>Paste Ctrl+Shift+V Paste in Place from clipboard Edit>Paste in Place

Create a duplicate of selected shape(s)

Create duplicate copies of selected shape (s)

## **Cutting/Deleting Shapes**

Ctrl+Shift+drag

Ctrl+D

Ctrl+X	00	Cut to clipboard	Edit>Cut
Del		Delete selected shape(s)	Edit>Delete
Shift+Del		Delete all shapes in the file	Edit>Delete All
Ctrl+Shift+R		Delete all shapes smaller than specified area (W x H)	Edit>Delete By Area

Edit>Duplicate

## **Manipulating Shapes**

	Arrange shapes with equal vertical (or equal horizontal)	Edit>Align & Space>Space>Vertically ( or
	spacing	Horizontally)
	Align selected shapes along bottom of bottommost shape	Edit>Align & Space>Align>Bottom (or Top)
	(or along top of topmost shape)	Edit/Aigil & Space/Aigil/Bottoff (of 1 op)
	Align selected shapes along left side of leftmost shape (or	Edit>Align & Space>Align>Left (or Right)
	along right side of rightmost shape)	Luit/Aigit & Space/Aigit/Leit (of Right)
	Center / stack selected shapes	Edit>Align & Space>Align>Stack
	Align collected change clang beginned (or vertical) contar	Edit>Align & Space>Align>Horz. Center (or Vert.
	Alight selected shapes along nonzontal (of vertical) center	Center)
	Vertically flip selected shape(s)	Edit>Shape Magic>Flip
4	Horizontally mirror selected shape(s)	Edit>Shape Magic>Mirror
*	Rotate selected shape(s) 90 degrees clockwise	Edit>Shape Magic>Rotate 90 deg
	IModify spacing between selected shapes	
	ŧ	spacing  Align selected shapes along bottom of bottommost shape (or along top of topmost shape)  Align selected shapes along left side of leftmost shape (or along right side of rightmost shape)  Center / stack selected shapes  Align selected shapes along horizontal (or vertical) center  Vertically flip selected shape(s)  Horizontally mirror selected shape(s)

# **Opening Windows**

Ctrl+l	TI	Open "Add Text Group" window	Icon on Text and Fonts tab, Main Bar
Ctrl+Shift+U		Open "Color" window	Right click>Change Color/Texture/Line>Color
Ctrl+Shift+O		Open "Choose Texture" window	Right click>Change Color/Texture/Line>Texture
Ctrl+Shift+Y		Open "Choose Line Style" window	Right click>Change Color/Texture/Line>Line
Ctrl+Shift+X	S	Open "Shape View window"	Edit>Shape Magic>Advanced>View Path Detail
	<b>√</b>	Open "Project Notes" window	View>Notes Window

<u>Shortcut</u>	<u>lcon</u>	<b>Description</b>	Menu, Other Location
Layers Window Icons			

<b>1</b>	Move this layer up / down	On any given layer
₩ 🗭	Layer is visible / hidden	On any given layer
	Set color, texture or line style for this layer	On any given layer
	Layer is unlocked / locked	On any given layer
*	Delete this layer	On any given layer
4	Create a new layer	Bottom of Layers window
	Place current selection on a new layer	Bottom of Layers window
	Open Layer Options Menu	Bottom of Layers window
	Delete empty layers	Bottom of Layers window
8	Open Visible Toggle menu	Bottom of Layers window
	Open Lock Toggle menu	Bottom of Layers window

## **Text and Fonts Icons**

В		Bold / Italic	On Text and Fonts tab of Main Bar
	Ĉ	Refresh installed fonts list	On Text and Fonts tab of Main Bar
	$\left[ T_{\Gamma} \right]$	Open TTF/OTF font file	On Text and Fonts tab of Main Bar
	TI	Open Add Text Group window	On Text and Fonts tab of Main Bar

# Importing

Ctrl+Shift+A		Open "Make The Cut Gallery" import/download window	File>Import>From MTC Gallery
Ctrl+Shift+B		Open "Basic shapes" window import window	File>Import>From Basic Shapes
Ctrl+Shift+D	P.O.F	"Open Adobe File" import window	File>Import>Vector PDF/PS/EPS/AI
Ctrl+Shift+G	→ S V	"Open SVG File" import window	File>Import>SVG/SVGZ File
Ctrl+Shift+H	Ţ <sup>™</sup>	"Open Font File" import window	File>Import>True/Open Type Font File or Icon on Text and Fonts tab (Main Bar)
Ctrl+Shift+Q	₩ <sub>e</sub> c	"Open WPC File" import window	File>Import>WPC File
	SC SC	"Open GSD File" (or "Open SCUT File") import window	File>Import>GSD File (or SCUT File)
Ctrl+Shift+T		Open "Pixel Trace" import window	File>Import>Pixel Trace
		Open "Lettering Delights" import window	File>Import>From Lettering Delights

<b>Shortcut</b>	<u>lcon</u>	<b>Description</b>	Menu, Other Location
-----------------	-------------	--------------------	----------------------

# Exporting

Ctrl+Shift+L	Open "Add Basic shape" window	File>Export>Sel. To Basic Shapes
Ctrl+Shift+S	Open "Save SVG as" window	File>Export>Sel. To SVG File
Ctrl+Shift+W	Open "Upload" window to upload as SVG file to	o MTC File>Export>Sel. As SVG To MTC Gallery
	Gallery	File>Export>Set. AS SVG TO WITC Gallery

# **Editing Tools**

Ctrl+B		Break a shape into all of its individual paths	Edit>Shape Magic>Break
Ctrl+J	++	Join selected shapes into a single shape	Edit>Shape Magic>Join
Ctrl+P	++	Split typed text into individual characters (glyphs)	Edit>Shape Magic>Split
Ctrl+R		Remove all interior paths from selected shapes	Edit>Shape Magic>Blackout
Ctrl+L		Break apart selected shape(s) into layers	Edit>Shape Magic>Layer
Ctrl+Shift+F	S	Apply "Flatten Paths" function	Edit>Shape Magic>Advanced>Flatten Paths
Ctrl+Shift+J	So	Smooth and simplify shapes	Edit>Shape Magic>Advanced>Smooth & Simplify
Ctrl+Shift+M	S	Open "Fuse and Weld" window	Edit>Shape Magic>Advanced>Fuse n' Weld
Ctrl+Shift+N	8	Open Tiler window	Edit>Shape Magic>Advanced>Tiler
Ctrl+Shift+Z	S	Open "Auto Simplify" window to reduce nodes	Edit>Shape Magic>Advanced>Auto Simplify Path
	S	Toggle Auto Simplify Welds	Edit>Shape Magic>Advanced>Auto Simplify Welds

# **Designing Tools**

Ctrl+1	0	Apply "T exture Snapshot"	Edit>Shape Magic>T exture Snapshot
Ctrl+E		Open "Lattice" window	Edit>Shape Magic>Lattice
Ctrl+H		Open "Generate Shadow Layer" window	Edit>Shape Magic>Shadow Layer
Ctrl+K	00000	Open "Rhinestone" window	Edit>Shape Magic>Rhinestone
Ctrl+Q	$\bigcirc$	Open "Conical Warp" window	Edit>Shape Magic>Conical Warp
Ctrl+Shift+K	S	Apply "Thin Paths" function to create a center line trace	Edit>Shape Magic>Advanced>Thin Paths
Ctrl+Shift+N	S	Open "Tiler" window	Edit>Shape Magic>Advanced>Tiler
Ctrl+T	<b>(</b>	Open "Bézier Warp" window	Edit>Shape Magic>Bezier Warp
Ctrl+U		Open "Boolean Join" window	Edit>Shape Magic>Boolean Join
Ctrl+W		Weld selected shapes to remove overlap	Edit>Shape Magic>Weld
Ctrl+Drag one shape onto another		Open "Wrap Objects to Path" window	

<u>Shortcut</u>	<u>lcon</u>	<u>Description</u>	Menu, Other Location
-----------------	-------------	--------------------	----------------------

# Output

Ctrl+Shift+C	*	Open controller window for current default cutter	Cut Project With>current default sel. Cutter
Ctrl+Shift+E		Show preview of cut shapes	Cut Project With>Cut Preview
Ctrl+Shift+P		Print	File>Print
	2	Reverse Paths (change direction of cut on selected shape)	Edit>Shape Magic>Advanced>Reverse Paths

# **Node Editing Tools**

W		Toggle Node Mode Toolbar on/off	Upper left corner of Virtual Mat
F1	W	Edit This Project Normally	On the node editing toolbar
F2		Edit Paths at Node Level	On the node editing toolbar
F3		Draw Freehand Lines	On the node editing toolbar
F4		Draw Bezier Curves and Straight Lines	On the node editing toolbar
F5		Add basic shapes	On the node editing toolbar
F6	0	Create spirals	On the node editing toolbar
F7	<b>C</b>	Create stars and polygons	On the node editing toolbar
F8		Erase sections of paths	On the node editing toolbar
F9	1	Slice shapes and lines	On the node editing toolbar
F10		Measure shape lengths and angles	On the node editing toolbar

# Zing Plug-In

F1	Cut Project	Connected>Cut Project
F2	Toggle Laser On/Off	Connected>Toggle Laser On (or Off)
F3	Reconnect	Connected>Connection>Reconnect
F4	Toggle Zing Speak On/Off	Drop Down Menu>Zing Speak
F5	Create Preset	Drop Down Menu>Presets>Create Preset

# Appendix B Troubleshooting FAQ's

## **Communication Issues**

Nothing happens when I try to use the arrow keys in the **Set Blade Origin** window. But it shows that the **Z**ing is connected in the **Cut with Klic-N-Kut Zing** window.

•	Most likely the wrong COM Port is selected. Click on the green Connected button and then select
	Connection. The correct COM Port will be the one that says "USB-Serial".

There is no "USB-Serial" COM Port connection available in the list of available COM ports.

- Unplug the Zing from your computer. In MTC, go to Help>Advanced>Download and Install FTDI D2XX Drivers. Once the drivers have installed, reboot your computer. When your computer has finished restarting, reconnect the Zing to your computer. You should get a pop-up that will finish the installation.
  - ♦ If this fails, again unplug the Zing from your computer. Download and install the driver for the KNK Zing from here:

http://knkusa.com/resources/

Once you have downloaded and installed the driver, reboot your computer. When your computer has finished restarting, reconnect the Zing to your computer. You should get a pop-up that will finish the installation. If you continue to have trouble, contact your Zing dealer or KNKUSA.

\_\_\_\_\_

The Cut Project With window shows the Zing as Not Connected.

- Check the USB cable to make sure it is properly inserted into the Zing and into a USB port on your computer. Then close the Cut Project With window and reopen. Try pressing F3 if it still says "Not Connected."
- Click on the **Not Connected** button and then choose **Connection** and pick the **COM Port** which says "USB-Serial COM X" from the list.
- Contact your dealer for assistance if the Zing continues to not be recognized. You will probably need to reinstall the driver for the Zing.

I'm using Parallels on a Mac and the KNK isn't being recognized.

• Go to **Devices>USB** and make sure that the FT232R USB UART connection is checked.

\_\_\_\_\_\_

The Zing connection gets dropped even though it's not been turned off or the software closed.

 This is probably due to a setting in Windows 7. Open Windows Control Panel and select System and Security. Then select Power Options. Balanced should be selected. To the right of that, click on Change plan settings.

Click on **Change advanced power settings**. Open the **USB Settings** option in the list and locate **USB Selective**. Change to **Disabled** and then click on **OK**. This keeps the USB on a normal mode, not a save power mode.

- If the Zing still becomes disconnected, make sure you are using the latest Zing plugin. Check by clicking on the little triangle in the upper right corner of the **Cut with Zing** window and then selecting **About**. You should be running at least version 2.0.5 (if using Windows) and version 2.0.3 (if using a Mac).
- Try applying Flatten Paths before sending to the cut window. Select your shapes, click on the wrench icon at the bottom of the screen, and select **Flatten Paths** from the pop up menu.
- Try changing the COM Port that has been assigned.



My cut starts but stops during the cut with the blade holder sitting in the spot where it stopped cutting. I'm very sure that it's not going out of range. I am using a Mac computer to run the Wine version of MTC.

• There is a setting called **Data Throttle** which can be used to fix this. In the cut window, click on the small triangle shown below. Then select **Advanced Options**. Drop the **Pause** to 3. Try again and you may need to drop it to 2. If you continue to have problems, try increasing the **ms** from 10 to 15.



## **Operating Issues**

When I first turn on the Zing, the blade carriage moves to the right and starts making a terrible noise!

• There is a clear rubber piece that is located just under the top of the Zing and can sometimes become rolled slightly out of place when the foam protector is inserted or removed. Move that rubber piece so that the flat side is down and the blade carriage will be able to clear it as it moves to the right and into home position. If this does not solve the issue, contact KNK USA at 800-268-3672 or your KNK dealer.

\_\_\_\_\_

When I click on Cut Project, the blade carriage returns to the Home Origin instead of executing my cut.

- Make sure you are using Version 2.0 (or later) of the Zing plug-in. Refer to Section 2.10.
- Select your shape and click on the Advanced option (wrench icon) at the bottom of the screen. Then
  select Auto Simplify Path. Try sending the file to cut again.

My mat is rotating when the Zing starts to cut!

• Both pinch wheels need to be gripping the mat. Move the mat either left or right so that it is under both wheels.

I cannot get one (or both) of the pinch wheel levers to move correctly.

# Video

- Use a screwdriver to tighten the screw on the lever. Remember that clockwise is tighter, counterclockwise is looser. Avoid loosening as there is a ball and spring which will fall out and it's a bit tricky getting the lever reassembled and screwed back into place.
- Apply some WD40 to a cotton swab and dab it on the inside plate where the pinch roller bar enters the end cap.
- If one or both levers are still very difficult to move, watch this video:



Help! I turned the screw on my lever the wrong way and the spring and ball fell out!



- 1. Unplug the power cable and USB cable. Then slide the blade carriage towards the opposite end so that you will have room to use a screwdriver.
- 2. Place the Zing on its side so that the ball bearing holes are facing up.
- 3. Place the ball bearing into the hole that would position the roller bar down. Refer to the opposite side to make sure you have the correct hole.
- 4. Place one end of the spring into the hole of the lever and then align the other end of the spring over the ball bearing. Press down on the lever and hold it in place. Rotate so that the screw hole is aligned with the hole needed for attaching the lever to the Zing.
- 5. Insert the screw and use a screwdriver to turn the screw clockwise until tight.

\_\_\_\_\_

## **Cutting/Drawing Issues**

I am getting large diagonal lines sliced through all of my cuts.

Your Make The Cut software is still in trial mode. You need to register your copy of MTC using the
activation pin that came on the software CD. Here is the link: <a href="https://www.make-the-cut.com/Register.aspx">https://www.make-the-cut.com/Register.aspx</a>

My shapes are drawing off the material. What am I doing wrong?

- If you are using **Knife Point**, make sure you are setting the origin based on the position of the test pen or blade holder, not the laser light. The laser light is used for **WYSIWYG** mode.
- Check whether your Virtual Mat is in Portrait or Landscape mode. This will change whether your
  image appears the same way you see it on the screen or rotated 90 degrees relative to the screen.
- Details on these various settings are covered in Section 2.07.

When drawing with the test pen, I have extra lines being drawn.

Make sure you raise the pen in the blade holder seat on the Zing before tightening the front screw. The blade holder seat needs to be able to drop the pen down when it reaches the spot to draw the shape. Otherwise, the pen tip will be dragging across the paper from the origin to where the shape will begin to be drawn and then back to the origin at the end of the "cut".

I'm drawing with the test pen and there are bubbles at the corners.

For perfect corners, turn off Blade Offset (set to 0) since you do not need an offset for pens. Refer to Sections 2.01 and 2.06.

My cut started out fine but by the end of the cut, it's not cutting through the material.

- Make sure the blade holder housing doesn't have any bits of material inside of it.
- Make sure the front screw is tight so that the blade holder isn't slipping upwards during the cut.

My cut is clean in some places but not in others. Why am I not getting consistent cutting?

- Try raising the blade holder a little ways up in the blade holder seat (~1/16"). If the blade is too close to the material, not enough force is being applied.
- Make sure your material is pressed firmly onto a clean and sticky mat (assuming you are cutting a material such as paper or cardstock).
- Your material may require two passes. If a material is not homogenous or if it is heavily textured, using two passes is sometimes needed to get the entire shape cut cleanly. Also, if the material has been exposed to humidity, then it will become difficult to cut in one pass. You can dry paper and cardstock in a pre-heated 150 degree oven for half an hour or so to release the moisture. Turn the oven off before opening and putting the paper inside. That should provide a good drying temperature.

I am getting a lot of tearing in my cuts.

- A number of things can cause tearing so work through this check list:
  - Too much blade is exposed. If you see cut lines in your mat, shorten the blade exposure. You should only be cutting through the material itself.
  - The blade is chipped. Try a different blade.
  - The paper is not adhered well to the mat. Make sure the mat is clean, sticky, and the paper is pressed smoothly and evenly on the surface.
  - You may be using too much cutting force. Try reducing it and doing test cuts.
  - You may have too many nodes in the shape. Refer to Section 7.02
  - The material itself may be subject to tearing, especially on intricate cuts. Also, if the cardstock has been exposed to humidity, then the moisture in the material can make it difficult to cut cleanly. Try blow drying the cardstock or placing in a slightly warm oven for half an hour. Worst case, try a different cardstock.

I am cutting a file with dashed lines for folds and the dashes look terrible in some places. How can I fix this?

Those dashes are probably a series of separate straight line paths or even rectangles, versus being a solid cut line with a dashed line style assigned. Try replacing them with solid lines (Section 7.10) and

then converting the line style from solid to dash as shown in Section 3.14.

My shapes are not completely cutting out. They are still attached to the waste part of the material.

• Make sure you have turned the **Blade Offset** back to the appropriate value for the blade you are using. If the **Offset** is at 0, then your closed paths will not quite close when cutting with a blade.

\_\_\_\_\_

My cardstock is not cutting all the way through. I have the blade all the way out and using the maximum force.

- Please refer to Section 2.01. It's important to only have as much blade exposed as is necessary to penetrate the cardstock. You may also need to raise the blade tip height. Reduce your force back to suggested values for the material you are cutting and do a test cut.
- Do not use more pressure than is needed. If the cardstock is cutting through about 90% of the cut, then turn on Multi-cut. Some cardstocks do better with a second pass.

When I try to select my registration marks during a Print and Cut the head refuses to go all the way to the mark.

- It is strongly recommended that the Virtual Mat be set to the same dimensions as your print out and the origin be set in the lower right corner of your print out. This will result in the laser light automatically moving more closely to each reg mark. Then you can use the arrow keys to move the laser to the exact center of each mark.
- Alternatively, there is a software bug that can prevent the laser from going to all three marks. The current solution is to set the origin so that there is little need to adjust the movement at the first reg mark. Then the other two should be fine. Another way to do this is to adjust the placement of the mat after the laser automatically moves to the first mark, so that very little tweaking is needed.

\_\_\_\_\_

## **Software Issues**

I cannot get the MTC Bridge to install on my Mac.

- The Mac O/S needs to be 10.5.8 or newer.
- You may need to change a setting which allows programs not download from the Apple Store to be installed. Refer to this link: http://knkusa.com/resources/

\_\_\_\_\_

Make The Cut will not accept the registration number on the CD that came with my Zing.

• The **Activation Pin** is the number on the CD envelope. This number needs to be used for registering your copy of the software <u>at the web site</u> shown on the Quick Start Guide (also shown in *Section 1.06*). Once you register, you will be given a **Registration Number** to then use in MTC.

I have a new computer and I want to install Make The Cut. I cannot locate my registration number for MTC.

- Go to this link to have your registration number emailed to you at the email address you used when registering your copy of MTC: <a href="http://www.make-the-cut.com/LostRegKey.aspx">http://www.make-the-cut.com/LostRegKey.aspx</a>
- If the email address you used for registering is no longer valid, go to this link and submit a support ticket to MTC: <a href="http://www.make-the-cut.com/Support/">http://www.make-the-cut.com/Support/</a>

I prefer to work in metric versus inches. How do I switch to metric?
 At this time, MTC will only display the rulers and location/sizing in inches. However, you can enter a dimension in metric by typing the size and then followed by mm or cm. Refer to Section 3.13. To verify the dimension of shapes in metric units, use the Measure Tool on the Node Edit toolbar. Refer to

\_\_\_\_\_\_

Is there a way to see thumbnail images of my MTC files in Explorer?

Section 7.08.

• Yes. The link to download the MTC File Viewer and instructions for using are detailed in Section 3.06.3.

\_\_\_\_\_\_

I have a very complicated file that I am attempting to edit. Make The Cut keeps crashing.

 You can allocate more memory by going to Help>Advanced>Advanced Settings and enabling the Limit Undo/Redo Size. Or you can clear the Undo steps by going to Edit>Clean Undo History. Refer to Section 3.11 for more details.

\_\_\_\_\_

When importing images into Pixel Trace window, MTC is freezing up.

• Go to Help>Advanced> Advanced Settings. Uncheck the box next to Enable Twain:

T<u>W</u>AIN Import
Enable T<u>W</u>AIN

I'm having problems using the 3D view under Conical Warp.

Go to Help>Advanced> Advanced Settings. Uncheck the box next to Enable OpenGL. The 3D view will now be disabled.



MTC crashed and I thought I had Auto-save turned on. But my file isn't being recovered.

The last version that was auto-saved should be available in the folder specified here: Help>Advanced>
 Advanced Settings. Uncheck and recheck the box next to Enable Automatic Saving and the settings window will open. Check the location for your backup file shown by Auto-save Path.

\_\_\_\_\_

When I import vector files into MTC, I lose the individual colors. All of the shapes end up the same color. How do I retain the colors that were used in the original program?

• Some file formats may not import with the original assigned colors. If possible choose SVG as an import format when MTC is not available.

\_\_\_\_\_

I am trying to import a PDF file but nothing is showing up.

•	PDF files can be made from vector or raster or a combination. If MTC doesn't detect any vector paths,
	then you should be able to click on a blue link at the bottom of this import window (in MTC versions 4.3
	and older). The Pixel Trace window will open and allow you to then vectorize the raster image(s) within
	that PDF file.

\_\_\_\_\_

I am trying to use my scanner to import a file to Pixel Trace, but the Twain button that shows in Chapter 6 isn't there. How do I get it back?

Go to Help>Advanced>Advanced Settings. Check the box next to Enable Twain:

T <u>W</u> AIN Import	
✓ Enable TWAIN	
	_

I am trying to move a node but it keeps jumping. I can't just move it where I want.

• You probably have **Snapping** turned on. Check the current setting on the **Virtual Mat** and switch to **No Snapping**.

\_\_\_\_\_

When trying to resize an image by using the boxes at the corner of the image, I am having a problem controlling the sizing.

You probably have Snapping turned on. Check the current setting on the Virtual Mat and switch to No Snapping.

-<u>-----</u>

I have **Pixel Traced** an image and imported it for a print and cut. But my original image is faded. How do I import the image so that it looks like the original?

On the Virtual Mat, select Contrast from the list of available colors. Note that your image will print just
like the original regardless of the mat color selected. But if you prefer to see your image in full color,
then use the Contrast option.

My raster images cause MTC to be very slow. Is there a fix for this?

As of version 4.2.0, this should no longer be a problem. Go to Help>Advanced>Advanced Settings.
 Check the box next to Enable Image Caching:

Image Caching

✓ Enable Image Caching

My raster image isn't showing up when I print it for my print and cut.

• Two possibilities: Check the **Layer Bar** and make sure it is not being covered by another layer. Also, go to **File>Print Options** and make sure you do not have **Print Wireframe Only** checked.

\_\_\_\_\_

I am trying to use Boolean Join but it is grayed out. I have my shapes selected. Why can't I select this function?

I have been using the Eraser tool and my image has become distorted! Help!
Before using the Erase function (or Inverse Erase), you need to click on the <b>Advance</b> icon on the <b>Magic</b>
Toolbar and turn off (uncheck) Auto Simplify Welds. Then, when you have completed the editing, have your shape or shapes selected and go to the same menu and select Auto Simplify Path. The nodes will be reduced. Then recheck Auto Simplify Welds.
Is there a way to move all of the letters in my text closer together at one time?
Yes. When typing your text, make sure you have <b>Split by Glyphs</b> selected. If you forget, then select
your title and click on the <b>Split</b> icon on the <b>Magic Toolbar</b> . Next, make sure you are in <b>Resizing</b> mode where your selected text has the double headed arrows pointing outwards (refer to <i>Section 3.13</i> of the User Manual). Then hold the <b>Ctrl</b> key while dragging the middle right arrow of the selected text. This will allow you to separate the individual letters or make them closer together.
I have carefully gone through the setup in Section 3.06 several times for showing Thumbnails of my MTC files in
Windows Explorer, however I still cannot get them to appear.
<ul> <li>In Windows Explorer (Windows 8), click on the View tab, then Options and select Change Folder and Search Options. Click on the View tab and make sure the top option (Always show icons, never thumbnails) is NOT checked. If you own an earlier version of Windows, then use this video to locate</li> </ul>
this same folder: but then make sure you look at that same top option about icons and thumbnails.
<del></del>

**Boolean Join** can only be applied to two shapes at one time. If, for example, you are trying to stencil some letters using rectangles, then all of the letters need to have Join applied first. And all of the

rectangles need to have Join applied first. Then you have two shapes. Alternatively, you could just stencil one rectangle and one letter at a time.

# Appendix C Zing Speak Quick Reference<sup>1</sup>

This is a quick reference to samples of inquiries and commands within Zing Speak. There are many other word combinations which will work. For a more complete list, refer to the Zing Speak Vocab Guide here: <a href="http://www.iloveknk.com/Support/Tutorials/Make-The-Cut/">http://www.iloveknk.com/Support/Tutorials/Make-The-Cut/</a>

<u>Function</u>	Command or Inquiry	Example of What To Say	Purpose of Inquiry or Command
Connection	Inquiry	Am I connected?	Find out if the Zing is still connected
	Command	Reconnect	Reconnect, if not connected
Speed	Inquiry	What is the speed?	Find out the current Cut Speed and Up Speed
	Inquiry	What is the cut speed?	Find out the current Cut Speed
	Inquiry	What is the up speed?	Find out the current Up Speed
	Command	Set the speed to "X"	Change both Cut and Up Speeds (range:1 to 20)
	Command	Set the cut speed to "X"	Change Cut Speed (range:1 to 20)
	Command	Set the up speed to "X"	Change Up Speed (range:1 to 20)
Force	Inquiry	What is the force	Find out the current force
	Command	Set the force to "X"	Change the Force (range:1 to 160)
Multi-cut	Inquiry	What is the multi-cut?	Find out the current number of passes for Multi-cut
	Command	Set the multi-cut to "X"	Change the Multi-cut (range:1 to 10)
Presets	Command	Use preset "X"	Change all settings to those for the preset you specify
Blade Offset	Inquiry	What is the blade offset?	Find out the current blade offset
	Command	Set the blade offset to "X"	Change Blade Offset (range: Off or from 1 to 95)
Cut Type	Inquiry	What is cut type?	Find out the current Cut Type setting
	Command	Set cut type to knife	Set Cut Type to Knife Point
	Command	Set cut type to wizzy wig	Set Cut Type to WYSIWYG
	Command	Set cut type to print and cut	Set Cut Type to Print and Cut
Set Blade Origin (open window)	Command	Set Blade Origin	Opens the Set Blade Origin window
Set Blade	Inquiry	What are Steps set to?	Find out current setting for Steps (Move by)
Origin (setting)	Command	Set Steps to Minimum	Set Steps to the minimum value of 4
(Setting)	Command	Set Steps to Maximum	Set Steps to the maximum value of 1016
	Command	Set Steps to "X"	Set Steps from 4 to 1016
	Command	Move "X" left	Move specified number of steps to the left
	Command	Move "X" right	Move specified number of steps to the Iright
	Command	Move "X" forward	Move specified number of steps forward/up
	Command	Move "X" back	Move specified number of steps to backwards/down
	Command	Use last	Move to last origin used

	Command	Zero Zero	Move to Home Origin
	Command	Finished	Blade origin is now set
Laser Control	Command	Laser on	Turn the laser light on
	Command	Laser off	Turn the laser light off
Test Cut	Command	Test cut Asterisk	Test cut the asterisk
	Command	Test cut Circle	Test cut the circle
	Command	Test cut Circle in Square	Test cut the circle in square
	Command	Test cut Double Circle	Test cut the double circle
	Command	Test cut Drop	Test cut the drop
	Command	Test cut Flower	Test cut the flower
	Command	Test cut Rhinestone	Test cut the rhinestone pattern
	Command	Test cut Square	Test cut the square
	Command	Test cut Star	Test cut the start
	Command	Test cut Zing Logo	Test cut the Zing logo
Cut Project	Command	Cut	Cut the current Project
Print and Cut	Inquiry	What are Steps set to?	Find out current setting for Steps (Move by)
	Command	Set Steps to Minimum	Set Steps to the minimum value of 4
	Command	Set Steps to Maximum	Set Steps to the maximum value of 1016
	Command	Set Steps to "X"	Set Steps to "X"
	Command	Set Steps to "X"	Set Steps from 4 to 1016
	Command	Move "X" left	Move specified number of steps to the left
	Command	Move "X" right	Move specified number of steps to the right
	Command	Move "X" forward	Move specified number of steps forward/up
	Command	Move "X" back	Move specified number of steps to backwards/down
	Command	Cancel	Cancel the PNC process
Disable	Command	Ignore me	Stop listening/responding to what is being said
Re-enable	Command	Pay attention to me	Start listening/responding to what is being said
Turn Off	Command	Turn Zing Speak Off	Shuts downs Zing Speak
Zing Plugin Version	Command	What version	Find out the current version of the Zing plug-in

<sup>&</sup>lt;sup>1</sup> For a more complete list of Zing Speak commands, refer to this link: <a href="http://www.iloveknk.com/Support/Tutorials/Make-The-Cut/">http://www.iloveknk.com/Support/Tutorials/Make-The-Cut/</a>

# Appendix D Connecting Via Bluetooth on a Mac

While it is possible to connect to a Mac using Bluetooth, it is highly recommended that USB is used instead. The Bluetooth connection on a Mac can result in erratic cutting and a need for adjusting a data throttle setting based on both the Mac itself, as well as the file being sent to cut. If you still wish to test Bluetooth on your Mac, then follow these steps and be sure to note the data throttle setting at the end of the instructions, as it will inevitably need adjustment.

(1) To verify you have Bluetooth available on your Mac, go to **System Preferences** and look for the Bluetooh icon:



- (2) If you do not have Bluetooth, then insert the Bluetooth USB device which came with your Zing Air and restart your Mac. Return to **System Preferences** to verify you now see the Bluetooth icon shown above.
- (3) Click on the Bluetooth icon and the following should appear:



(4) Click on **Pair** and you should get the following:




(5) Click on **Options** and enter the "1234" code. Click on **Pair**. Then the Zing Air should be connected:



(6) If you happen to get the following window, click on the "X" and select **Remove**. Restart your Mac and follow the previous instructions again.



(7) From the Applications folder, launch the MTC COM Bridge program. If you receive an error message, click on "Continue Anyway". The following window will open and you should select the connection in the menu which says "tty.CUTTER":

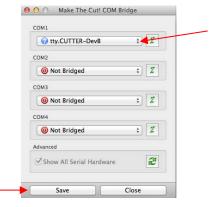

Click on Save before Close.

- (8) Click on Save and Close.
- (9) You are now ready to do the testing presented in Section 1.10. Note however that you most likely need to experiment with the **Data Throttle** setting. To access this setting, send a shape to the cut window, and then click on the small triangle shown below. Then select **Advanced Options**. You will find a tab to the right of the **Baud Rate Information** tab called **Throttle Data**. Select that tab and try decreasing the **Pause** and increasing the **ms**.



# **Acknowledgements**

Please send an email to <a href="mailto:sandy@iloveknk.com">sandy@iloveknk.com</a> if any errors are found in this manual or if you have suggestions for additions or changes.

I would like to thank the following people for proof-reading this manual. Without their assistance, this manual would be riddled with typos! I also greatly appreciate their suggested changes to make things clearer, more consistent, and more accurate:

Ann Hunting
Deb Manis
Elisabeth Bier
Laury Vaden
Nelda Sturgill
Ted Rauenbuehler
Tom Maskus

I also would like to thank the following people for technical input and/or videos:

Liz Ackerman

Andy Heinlein: <a href="http://www.make-the-cut.com/">http://www.make-the-cut.com/</a>
Diane Hiscoe: <a href="http://scrapitcmh.blogspot.com/">http://scrapitcmh.blogspot.com/</a>
Maggie Hen: <a href="http://knkzingreview.com/">http://knkzingreview.com/</a>

Michelle Hessler: <a href="http://www.paperthreads.com/">http://www.paperthreads.com/</a> Brenda Josselet: <a href="http://www.digitalcuttersplus.com/">http://www.digitalcuttersplus.com/</a>

Judy Keating Lynn Keniston

Fred Muraca: <a href="http://www.skatkatz.com.au/">http://www.skatkatz.com.au/</a>
Joe Rotella: <a href="http://www.createncraft.com/">http://www.createncraft.com/</a>

Rebecca Stewart Bryan Williams

Chad Youngblut: http://knkusa.com/

And a really big thank-you to my family and friends for their patience and their support of my Klic-N-Kut passion!

Sandy McCauley